

TEST REPORT



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

Report No.
CTK-2022-02138
Page (1) / (9) pages

1. Applicant

◦ Name : Hanwha Techwin Co., Ltd
◦ Address : 6 Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si,
Gyeonggi-do, 13488 KOREA
◦ Date of Receipt : 2022-08-02

2. Manufacturer

◦ Name : Hanwha Techwin Co., Ltd

3. Use of Report :

Quality Control

4. Test sample / Model :

Network Camera / XNV-9083RZ

5. Date(s) of test :

2022-08-04

6. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing

Address: (5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea)

7. Test Standard (Method) used :

KS C IEC 62262: 2005

8. Testing Environment :

Temperature: (25.0 ± 5.0) °C, Humidity: (40.0 ± 5.0) %

9. Test Results :

Refer to each test items

The results shown in this test report refer only to the sample(s) tested unless otherwise stated. This Test Report cannot be reproduced, except in full.

Approval	Tested by:	Technical Manager:
	Min-Gi Mun (Signature)	WonHyeon Choi (Signature)

Remark. This report is not related to KOLAS accreditation and relevant regulation.

2022-08-16

CTK Co., Ltd




1. Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts (IK code)

1.1. Test standard: KS C IEC 62262: 2005

1.2. Arrangement of the IK code

Code letters (International mechanical protection)

Characteristic numeral (numerals 00 to 10)

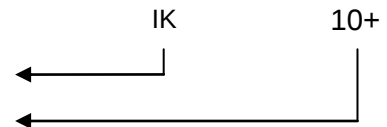

1.3. Vertical Hammer

1.3.1 Test equipment

Equipment	Model	Manufacturer	Serial	Calibration date	Application
Spring impact hammer	Spring impact hammer (IEC 60068-2-75)	Kingpo Technology Development Limited	KP-SH05	2022-10-18	☐
Vertical Hammer Tester	Vertical Hammer	Kingpo technology Development Limited	0190605A01002	-	☒
Vertical Hammer	50J	Kingpo	TX028-4	-	☒

1.3.2 Test condition

IK code	Impact Energy (J)	Equivalent mass (kg)	Drop height (mm $\pm$ 1%)	Application
00	Non-protected	-	-	☐
01	0.14	0.25	56	☐
02	0.20	0.25	80	☐
03	0.35	0.25	140	☐
04	0.50	0.25	200	☐
05	0.70	0.25	280	☐
06	1.00	0.25	400	☐
07	2.00	0.50	400	☐
08	5.00	1.70	300	☐
09	10.00	5.00	200	☐
10	20.00	5.00	400	☐
10+ (Customer request)	50.00	10.00	500	☒
- Impact times: five times for each of the exposed surface. (Do not impact more than 3 times in the same spot) - Test conducted with a higher impact energy of 50 J at the request of the customer				

 CTK Co., Ltd. The Prime Leader of Global Regulatory Compliance	CTK Co., Ltd. 5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea Tel: +82-31-339-9970 Fax: +82-31-624-9501	Report No. CTK-2022-02138 Page (3) / (9) pages	
--	--	---	--

1.3.3 Check Item

- External protection Enclosure damage check
(except accessories not related to outer protection function)

1.3.4 Test Result

Item	Contents	Result
External protection Enclosure	No damage	Pass
Comment - Some scratches were generated on the outside of the product.		

Manufacturer's name

Name and address of factory (ies)	D-TECH CO.,LTD. 173-25, Saneop-ro, Gwonseon-gu, Suwon-si, Gyeonggi-do, Korea (Suwon Industrial Complex) HANWHA TECHWIN SECURITY VIETNAM CO.,LTD Lot O-2, Que Vo Industrial Zone extended area, Nam Son commune, Bac Ninh city, Bac Ninh province, Vietnam
--------------------------------------	--


Model description

Basic Model	XNV-9083RZ
Series model	XNV-8083RZ, XNV-6083RZ, XNV-8083Z, XNV-6083Z
Model differences	Same appearance and material (case, finish, PCB, cable, etc.), product sensor/lens difference


 CTK Co., Ltd. The Pioneer Leader of Global Regulatory Compliance	CTK Co., Ltd. 5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea Tel: +82-31-339-9970 Fax: +82-31-624-9501	Report No. CTK-2022-02138 Page (4) / (9) pages	
--	---	---	--

2. APPENDIX

2.1. Product Photographs

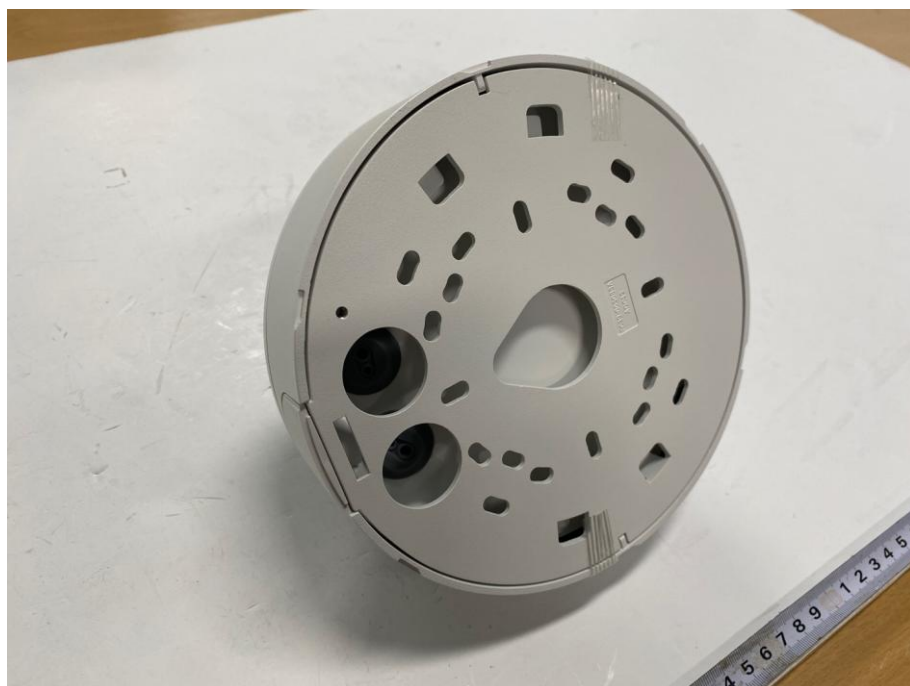

2.2. Test photos

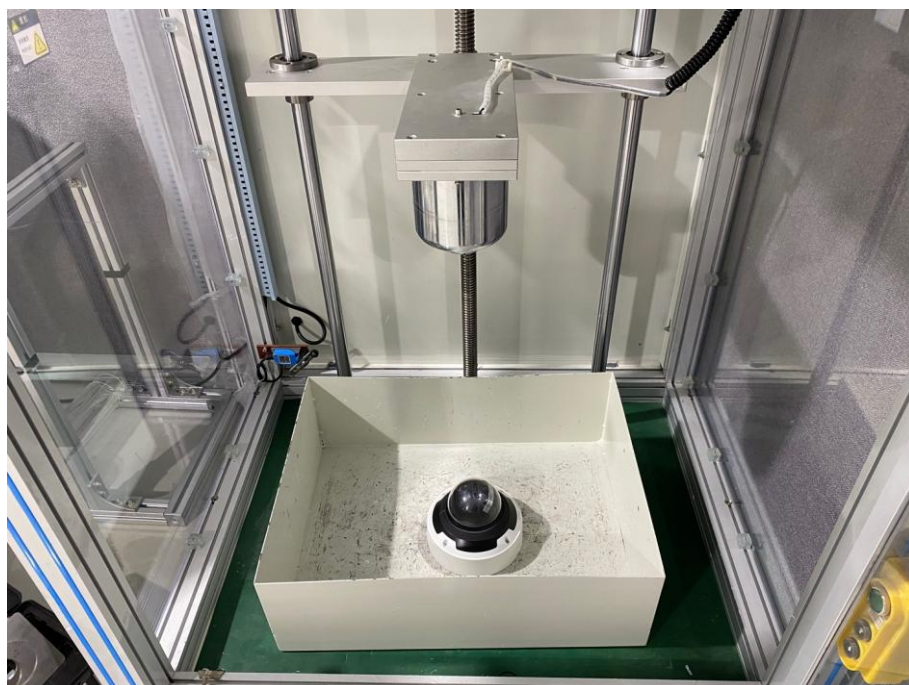




 CTK Co., Ltd. The Prime Leader of Global Regulatory Certification	CTK Co., Ltd. 5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea Tel: +82-31-339-9970 Fax: +82-31-624-9501	Report No. CTK-2022-02138 Page (6) / (9) pages	
---	---	---	--



2.3. Photos after test





2.4. Enclosure Dimensions or Impact point (Unit: mm)

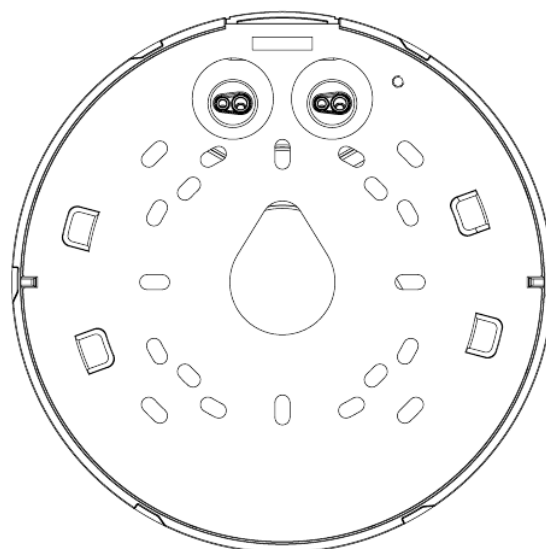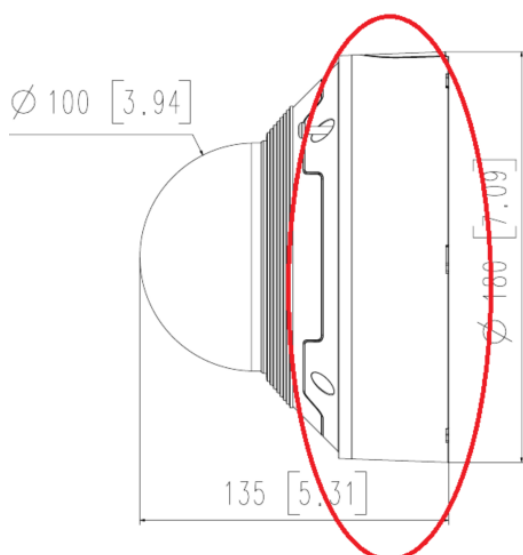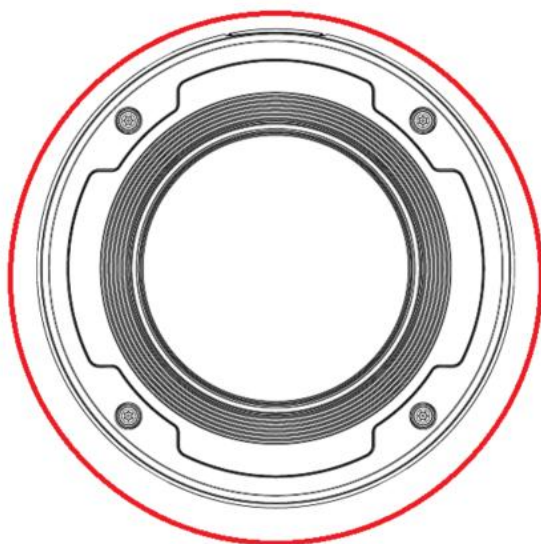

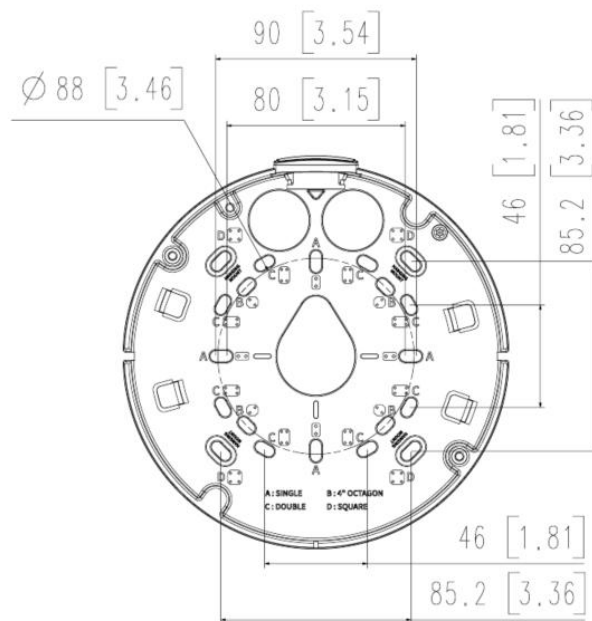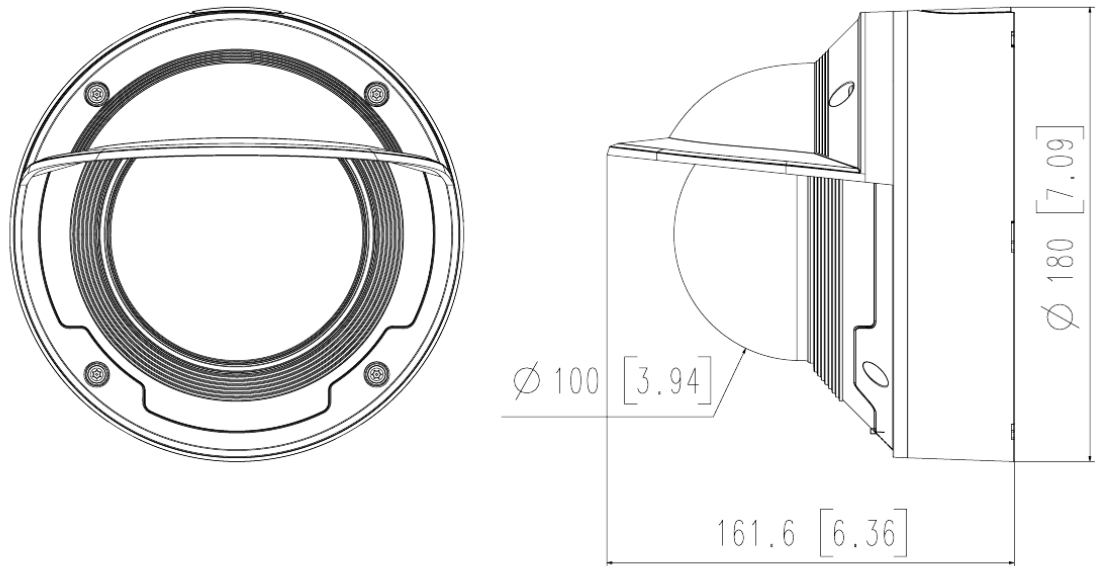

- END -