

TEST REPORT

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (1) / (17) pages

1. Applicant

- Name : Hanwha Vision Co., Ltd
- Address : 6, Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si,
Gyeonggi-do, 13488 Republic of Korea
- Date of Receipt : Feb. 25, 2022

2. Manufacturer

- Name : Hanwha Vision Co., Ltd

3. Use of Report :

For submission to customer

4. Test sample / Model :

Network Thermal Camera / TNM-C4940TD

5. Date(s) of test :

Apr. 03, 2022

6. Test Standard (Method) used :

KS C IEC 62262: 2002

7. Testing Environment :

Temperature: (25 ±10) °C, Humidity: (50 ±25) % R.H.
Pressure: (96 ±10) kPa

8. Test Results :

Refer to the test results

9. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing
(113, Yejik-ro, Cheoin-gu, Yongin-si, Gyeonggi-do, 449-100,
Republic of Korea)

The results shown in this test report refer only to the sample(s) tested unless otherwise stated. This report cannot be reproduced or copied without the written consent of CTK.

Approval	Tested by	Technical Manager
	Name: HyungUk Jeon (Signature)	Name: HoHyun Lee (Signature)

Remark. This report is not related to KOLAS accreditation and relevant regulation.

Nov. 12, 2025

CTK Co., Ltd.



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (2) / (17) pages

Table of Contents

1. Testing laboratory	3
1.1 Testing laboratory information	3
1.2 Testing laboratory accreditation status.....	3
2. Product description and equipment information	4
2.1 Product description	4
2.2 Model description	4
2.3 Equipment information	4
2.4 Pre-test product images	5
2.5 Testing equipment images.....	6
3. Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts (IK code)	7
3.1 Test date and environmental conditions	7
3.2 Test condition	7
3.3 Testing images	8
3.4 Test result.....	9
3.5 Post-test product images and hit area images.....	10
3.6 Enclosure Dimensions or Impact point	12

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (3) / (17) pages

1. Testing laboratory

1.1 Testing laboratory information

Lab. Name	CTK Co., Ltd.
Representative	Young Joseph Seungwon
Address	5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea
Tel.	+82-31-339-9970
Fax.	+82-31-624-9501
E-Mail	all.youngin@element.com
Website	www.elementkorea.kr

1.2 Testing laboratory accreditation status

Country	Classification	Accreditation Number	Logo
International	KOLAS	TESTING NO. KT119	

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (4) / (17) pages

2. Product description and equipment information

2.1 Product description

Product Name	Model Name	Quantity	Comment
Network Thermal Camera	TNM-C4940TD	1 EA	–

2.2 Model description

Basic Model	TNM-C4940TD	
Series model	TNM-C4950TD, TNM-C4960TD, TNM-C4940TDR, TNM-C4942TDR, TNM-C4952TD, TNM-C4962TD	
Model differences	TNM-C4950TD, TNM-C4960TD, TNM-C4952TD, TNM-C4962TD	Use of the same external shape and materials (case, finishing material, PCB, cable, etc.), differences in SW.
	TNM-C4940TDR, TNM-C4942TDR	differences in SW.

2.3 Equipment information

Testing equipment	Model Name	Manufacturer	Manufacturing Number	Next Cal. Date
Vertical Hammer	20J	Kingpo	TX028-3	-
Vertical Hammer Tester	Vertical Hammer	Kingpo	0190605A01002	



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (5) / (17) pages

2.4 Pre-test product images

2.4.1 Test sample



Front



Rear



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-03141
Page (6) / (17) pages

2.5 Testing equipment images

2.5.1 Test equipment



Vertical Hammer

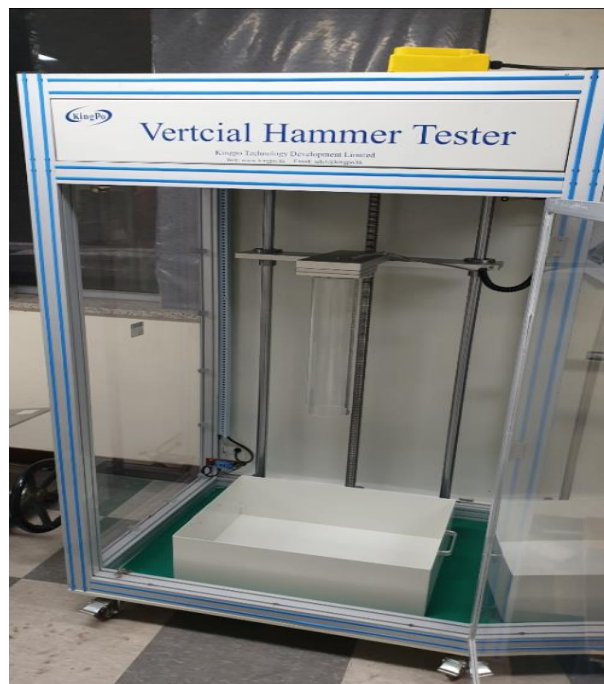

Vertical Hammer Tester

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (7) / (17) pages

3. Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts (IK code)

3.1 Test date and environmental conditions

3.1.1 Test date: Feb. 25, 2022

3.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.8	58.8	101.2

3.2 Test condition

3.2.1 Test standard: IEC 62262:2002+AMD1:2021

IK code	Impact Energy (J)	Equivalent mass (kg)	Drop height (mm ± 1%)	Application
00	Non-protected	-	-	☐
01	0.14	0.25	56	☐
02	0.20	0.25	80	☐
03	0.35	0.25	140	☐
04	0.50	0.25	200	☐
05	0.70	0.25	280	☐
06	1.00	0.25	400	☐
07	2.00	0.50	400	☐
08	5.00	1.70	300	☐
09	10.00	5.00	200	☐
10	20.00	5.00	400	☒
11	50.00	10.00	500	☐

Impact times: five times for each of the exposed surface. (Do not impact more than 3 times in the same spot)



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (8) / (17) pages

3.3 Testing images

3.3.1 Evidence of test setting



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (9) / (17) pages

3.4 Test result**3.4.1 Test result table**

Evaluation Criteria	Test Results	Remark
Visual Inspection	Some scratches were generated on the outside of the product.	-

※ Refer to the product photos after the completion of testing in section 3.5.2



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (10) / (17) pages

3.5 Post-test product images and hit area images

3.5.1 Check the hit area during the test




Check the hit area the test_1



Check the hit area the test_2



Check the hit area the test_3

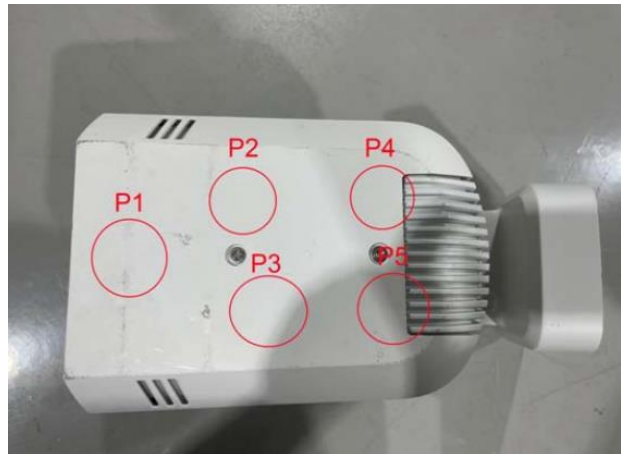

Check the hit area the test_4



Check the hit area the test_5



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (11) / (17) pages

3.5.2 Post-test product images






CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-03141
Page (12) / (17) pages

3.6 Enclosure Dimensions or Impact point

3.6.1 Enclosure Dimensions (Unit: mm)

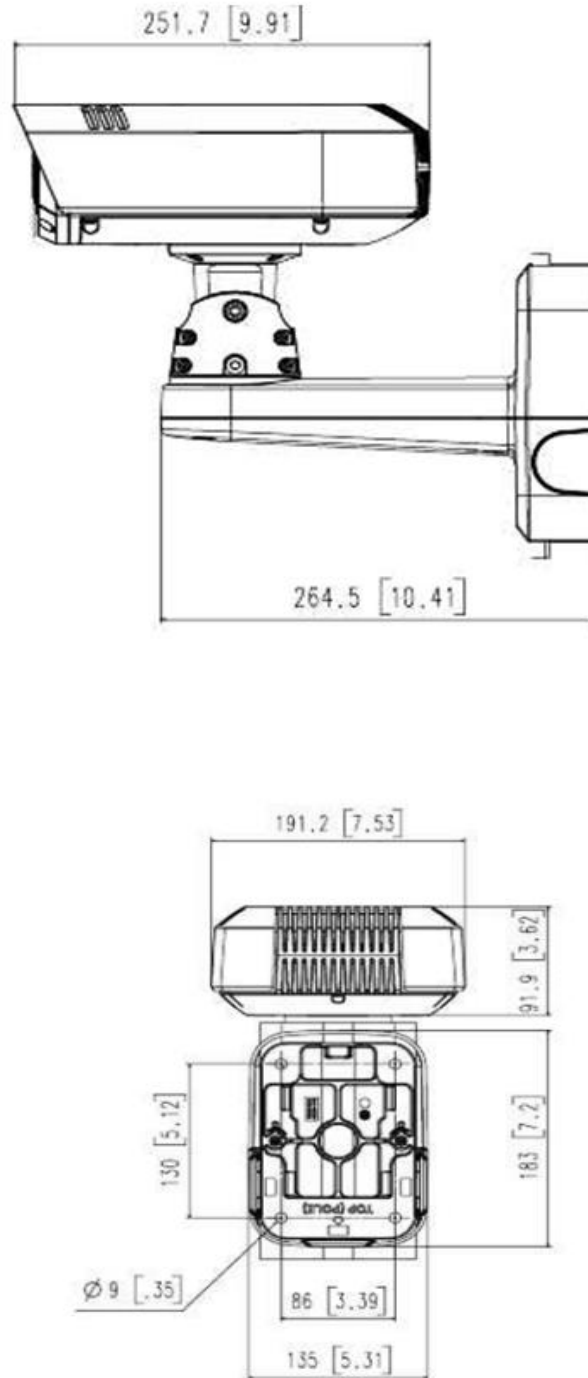

3.6.2 Enclosure Dimensions (Unit: mm)

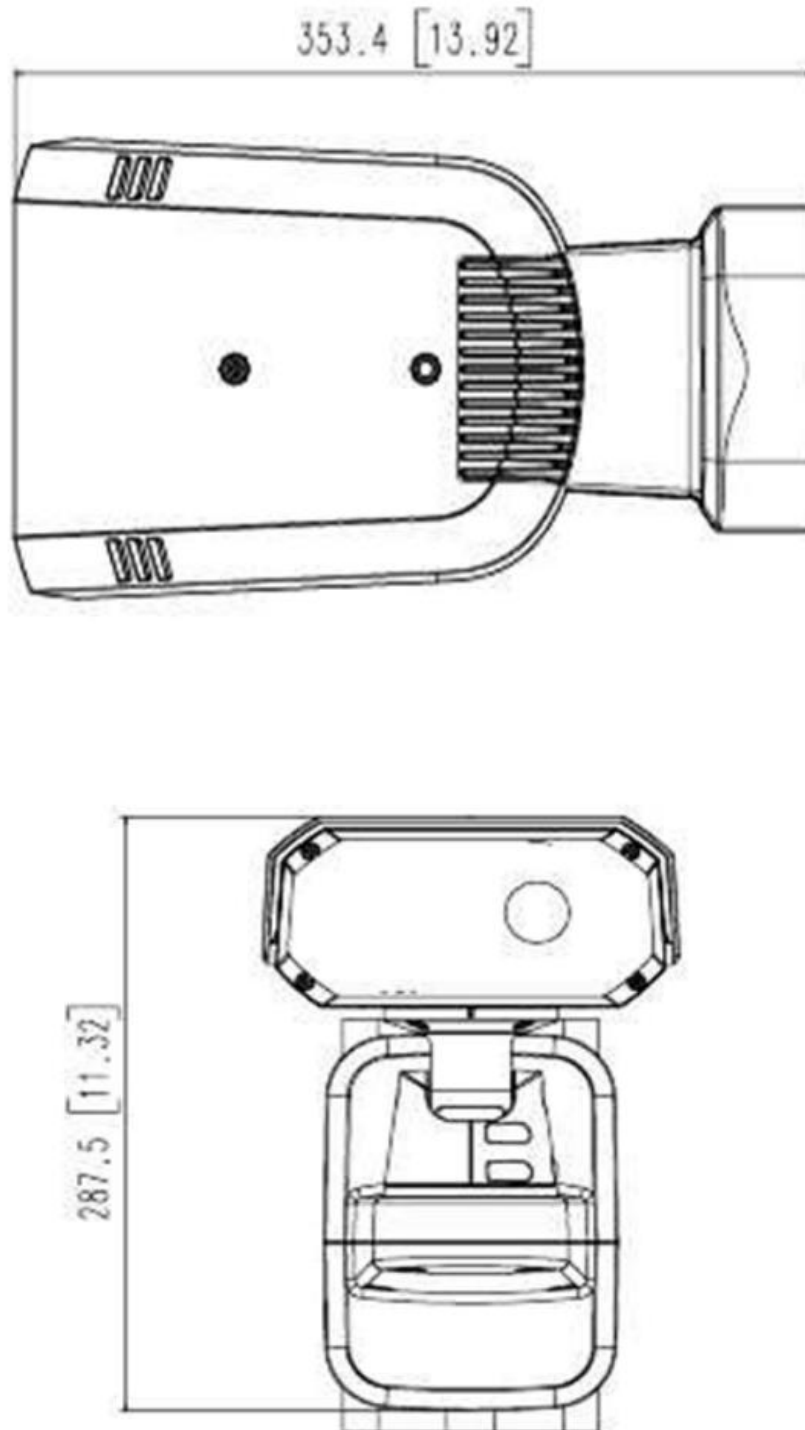




CTK Co., Ltd.



5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-03141
Page (14) / (17) pages


3.6.3 Enclosure Dimensions (Unit: mm)

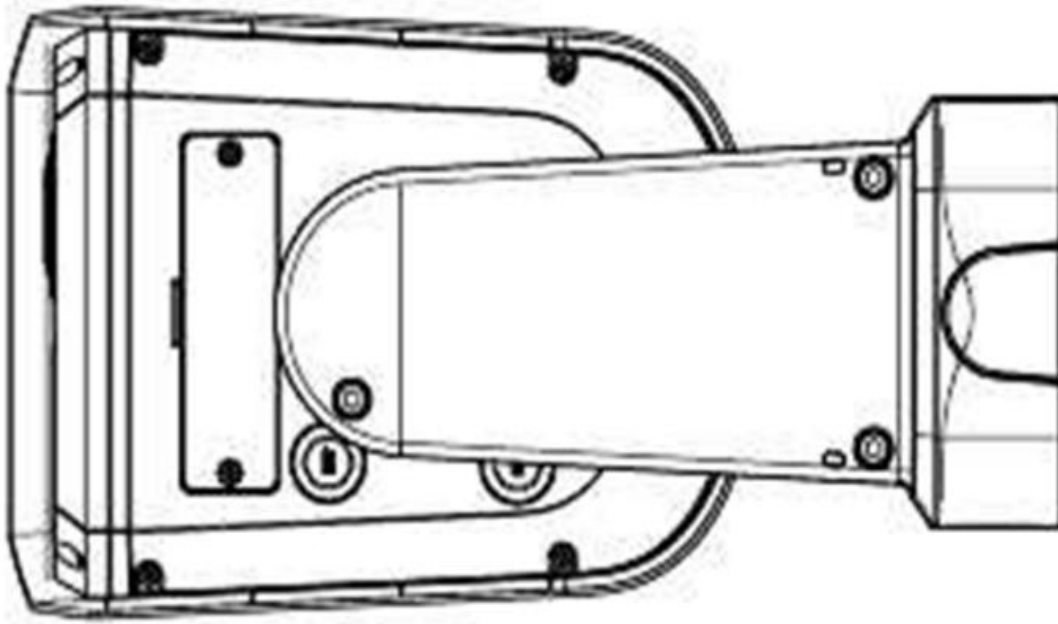


3.6.4 Impact point

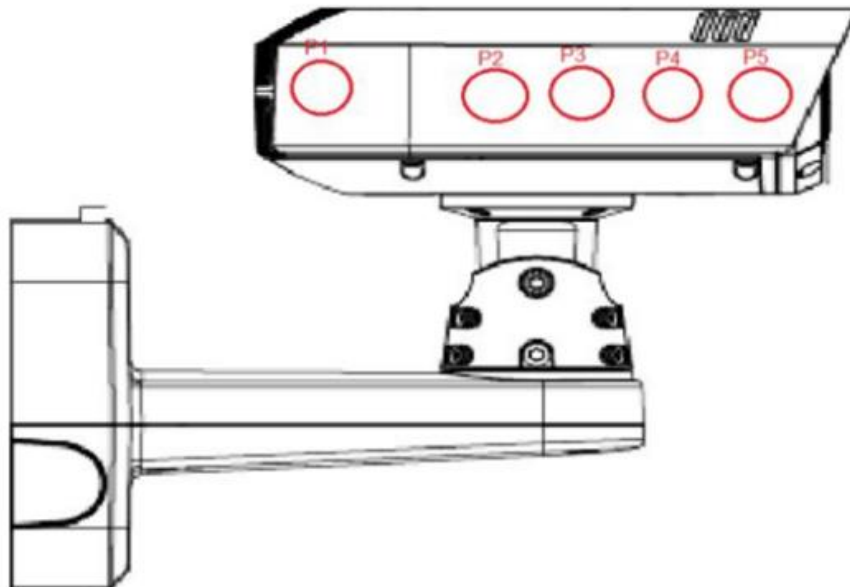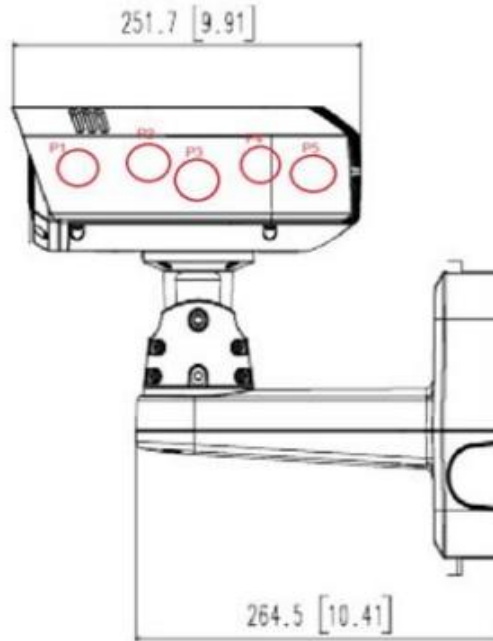

3.6.5 Impact point

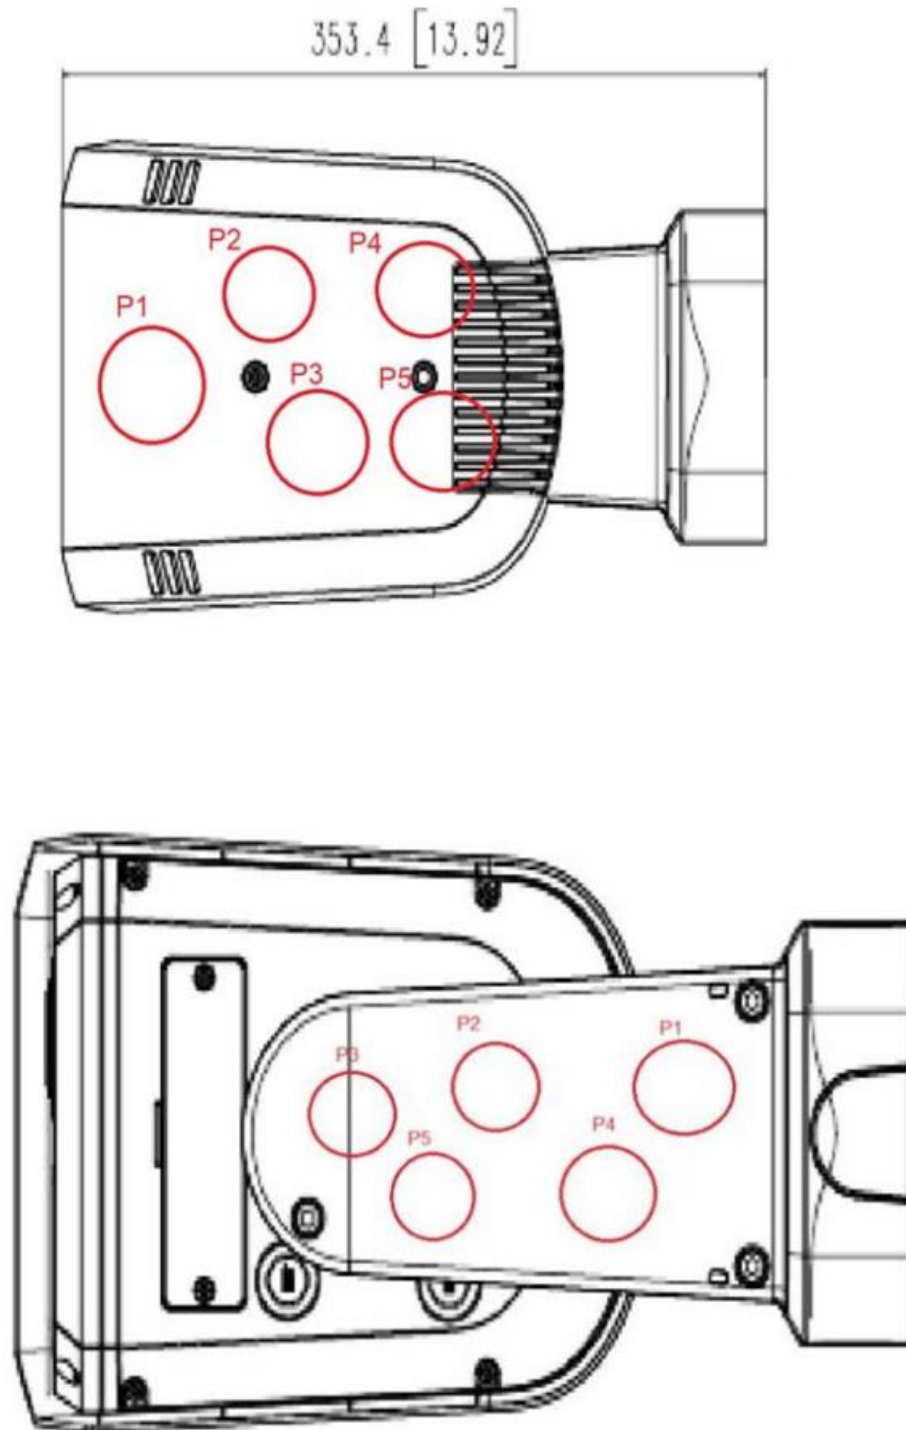

3.6.6 Impact point

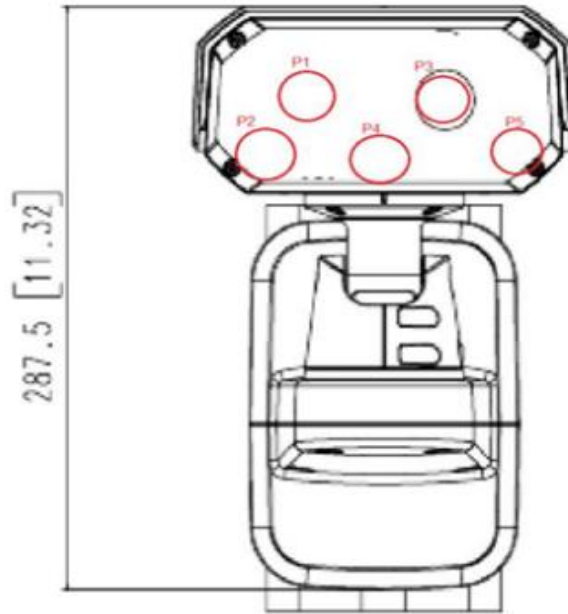

- End -