

TEST REPORT



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (1) / (43) pages

1. Applicant

- Name : Hanwha Vision Co., Ltd
- Address : 6 Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si, Gyeonggi-do, 13488 KOREA
- Date of Receipt : Feb. 23, 2026

2. Manufacturer

- Name : Hanwha Vision Co., Ltd

3. Use of Report :

For submission to customer

4. Test sample / Model :

NETWORK THERMAL CAMERA / TNO-C4060T

5. Date(s) of test :

Feb. 24, 2026 ~ Apr. 07, 2026

6. Test Standard (Method) used :

EN 60068-2-1, EN 60068-2-2, EN 60068-2-14, EN 60068-2-6, EN 60068-2-27, EN 60068-2-78, IEC 60068-2-1, IEC 60068-2-2, IEC 60068-2-14, IEC 60068-2-6, IEC 60068-2-27, IEC 60068-2-78

7. Testing Environment :

Temperature: (25 ± 10) °C, Humidity: (50 ± 25) % R.H.
Pressure: (96 ± 10) kPa

8. Test Results :

Refer to the test results

9. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing
(5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea)

The results shown in this test report refer only to the sample(s) tested unless otherwise stated.

This report cannot be reproduced or copied without the written consent of CTK.

Approval	Tested by	Technical Manager
	Name: HongBeom Jeon (Signature)	Name: HoHyun Lee (Signature)

Remark. This report is not related to ISO/IEC 17025, KOLAS accreditation and relevant regulation.

Apr. 17, 2026

CTK Co., Ltd.



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (2) / (43) pages

Table of Contents

1. Testing laboratory	4
1.1 Testing laboratory information	4
1.2 Testing laboratory accreditation status	4
2. Sample description and equipment information	5
2.1 Sample description	5
2.2 Model description	5
2.3 Equipment information	6
2.4 Pre-test sample images	7
2.5 Testing equipment images	8
2.6 Sample appearance	9
3. Cold test (EN 60068-2-1, IEC 60068-2-1)	10
3.1 Test date and environmental conditions	10
3.2 Test conditions and methods	10
3.3 Test Setup and During test sample images	11
3.4 Test result	12
3.5 Test Data	13
3.6 Post-test operation and function	14
4. Dry heat test (EN 60068-2-2, IEC 60068-2-2)	15
4.1 Test date and environmental conditions	15
4.2 Test conditions and methods	15
4.3 Testing images	16
4.4 Test result	17
4.5 Test Data	18
4.6 Post-test operation and function	19
5. Change of temperature test (EN 60068-2-14, IEC 60068-2-14)	20
5.1 Test date and environmental condition	20
5.2 Test conditions and methods	20
5.3 Testing images	21

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (3) / (43) pages

5.4 Test result	22
5.5 Test Data	23
5.6 Post-test operation and function	24
6. Vibration Test (EN 60068-2-6, IEC 60068-2-6)	25
6.1 Test date and environmental conditions	25
6.2 Test conditions and methods.....	25
6.3 Test Setup and During test sample images	26
6.4 Test result	27
6.5 Test Data	28
6.6 Post-test operation and function	30
7. Shock Test (EN 60068-2-27, IEC 60068-2-27)	31
7.1 Test date and environmental conditions	31
7.2 Test conditions and methods.....	31
7.3 Test Setup and During test sample images	32
7.4 Test result	33
7.5 Test Data	34
7.6 Post-test operation and function	37
8. Damp heat Test (EN 60068-2-78, IEC 60068-2-78)	38
8.1 Test date and environmental conditions	38
8.2 Test conditions and methods.....	38
8.3 Test Setup and During test sample images	39
8.4 Test result	40
8.5 Test Data	41
8.6 Post-test operation and function	42
8.7 Post-test sample images.....	43

	CTK Co., Ltd. 5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea Tel: +82-31-339-9970 Fax: +82-31-624-9501	REPORT No.: CTK-2026-01027 Page (4) / (43) pages	
---	--	--	--

1. Testing laboratory

1.1 Testing laboratory information

Lab. Name	CTK Co., Ltd.
Representative	Young Joseph Seungwon
Address	5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea
Tel.	+82-31-339-9970
Fax.	+82-31-624-9501
E-Mail	all.youngin@element.com
Website	www.elementkorea.kr

1.2 Testing laboratory accreditation status

Country	Classification	Accreditation Number	Logo
International	KOLAS	TESTING NO. KT119	

※ CTK Co., Ltd. is an independent third-party testing laboratory and is not affiliated with the manufacturer (Hanwha Vision Co., Ltd.) or any of its parent or subsidiary companies.

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (5) / (43) pages

2. Sample description and equipment information

2.1 Sample description

Sample Name	Model Name	S/N	Date of Manufacture	Quantity	Comment
NETWORK THERMAL CAMERA	TNO-C4060T	ZWXG70GL20000CF	Feb, 2026	1 EA	-

2.2 Model description

Basic Model	TNO-C4060T
Series model :	TNO-C4040T, TNO-C4042T, TNO-C4050T, TNO-C4052T, TNO-C4062T
Model differences	TNO-C4040T : Fixes Lens TNO-C4042T : Fixes Lens, SW different TNO-C4050T : Fixes Lens TNO-C4052T : Fixes Lens, SW different TNO-C4062T : SW different General: Fixed Lens does not contain electronic material

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (6) / (43) pages

2.3 Equipment information

Testing equipment	Model Name	Manufacturer	Manufacturing Number	Next Cal. Date
Temperature & Humidity Chamber	ARS-0390-AE	ESPEC	4120200057	Aug. 21, 2026
Temperature & Humidity Chamber	1410146	perform	1410646	Sep. 15, 2026
Vibration Testing System	LT1010	FAMTECH	D2012335	-
Vibration Testing System	GT1000M	FAMTECH	D1803072-1	-
Acceleration sensor	8703A250M5	KISTLER	5722241	Aug. 17, 2025

※ All test equipment used for this testing was calibrated in accordance with the manufacturer's requirements, and the calibration ranges cover the measurement values recorded in this report.



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (7) / (43) pages

2.4 Pre-test sample images

2.4.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (8) / (43) pages

2.5 Testing equipment images

2.5.1 Test equipment



Temperature & Humidity Chamber



Temperature & Humidity Chamber



Vibration Testing System



Vibration Testing System



8703A250M5



8703A250M5




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (9) / (43) pages

2.6 Sample appearance

Enclosure dimensions [unit: mm]

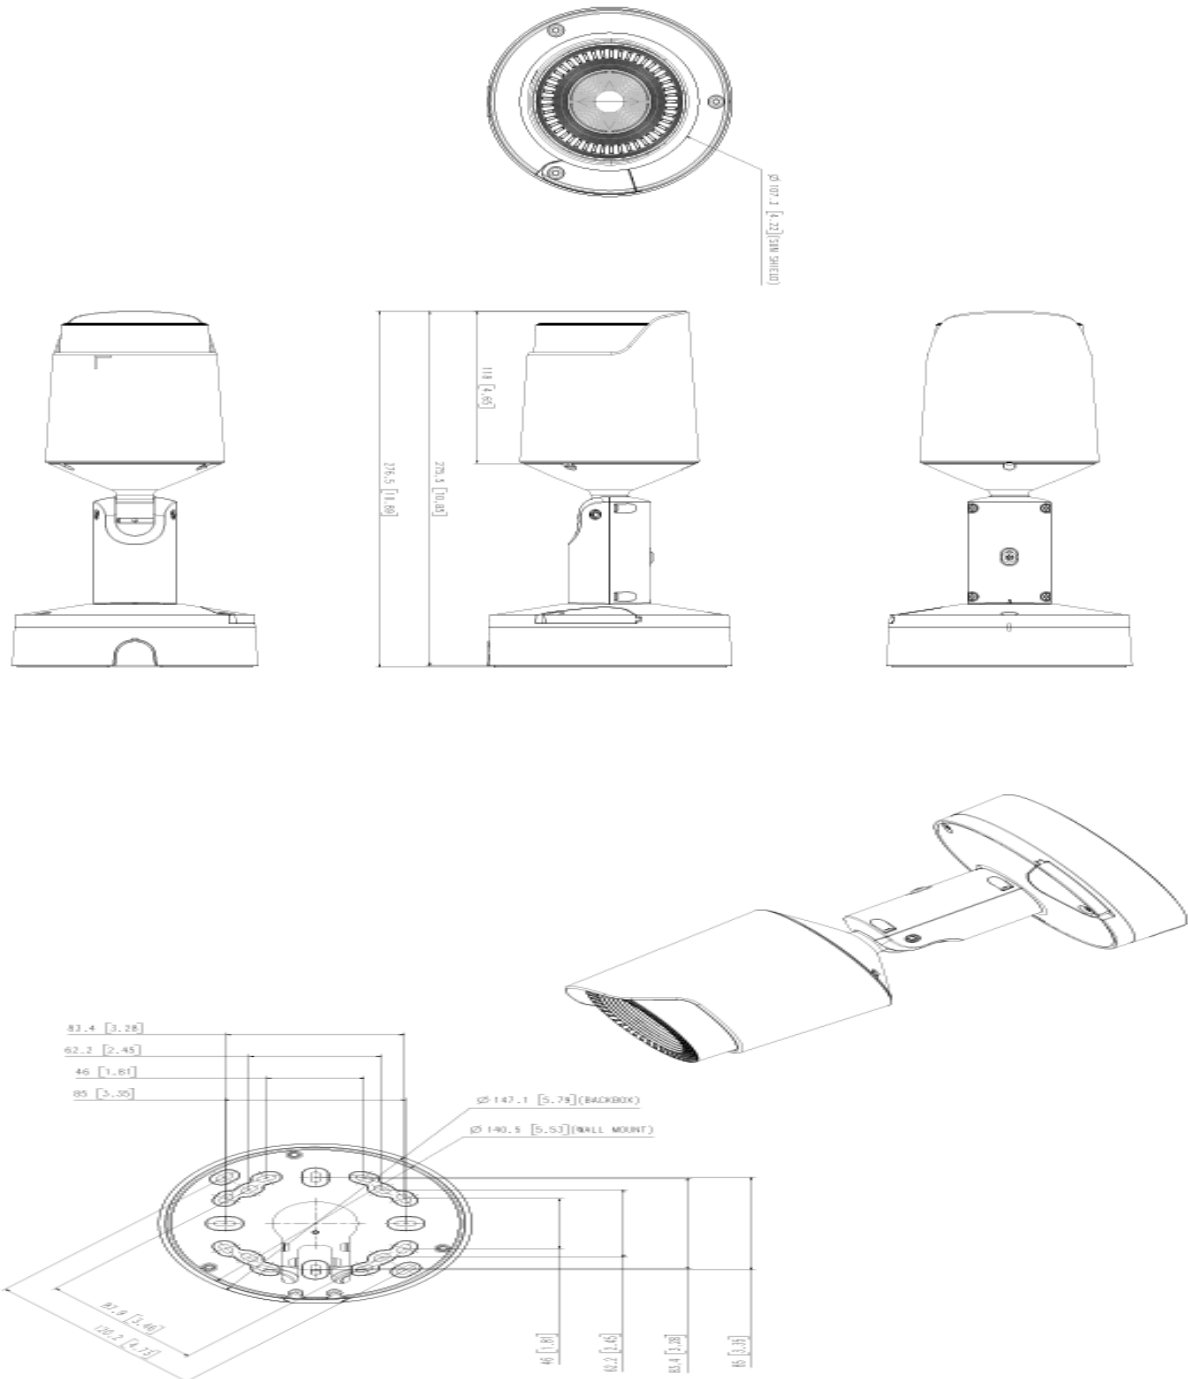

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (10) / (43) pages

3. Cold test (EN 60068-2-1, IEC 60068-2-1)

3.1 Test date and environmental conditions

3.1.1 Test date: Apr. 01, 2026 ~ Apr. 02, 2026

3.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.3	40.6	98.6

3.2 Test conditions and methods

3.2.1 Preconditioning temperature: 25 °C

3.2.2 Sample status: Operation

3.2.3 Test temperature: -33 °C

3.2.4 Test time: 16 h

3.2.5 Recovery Temperature: 25 °C

3.2.6 Evaluation items

- 1) The test sample shall be checked to determine that it is functionally operable in all modes of its prescribed operation




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (11) / (43) pages

3.3 Test Setup and During test sample images

3.3.1 Evidence of test setting

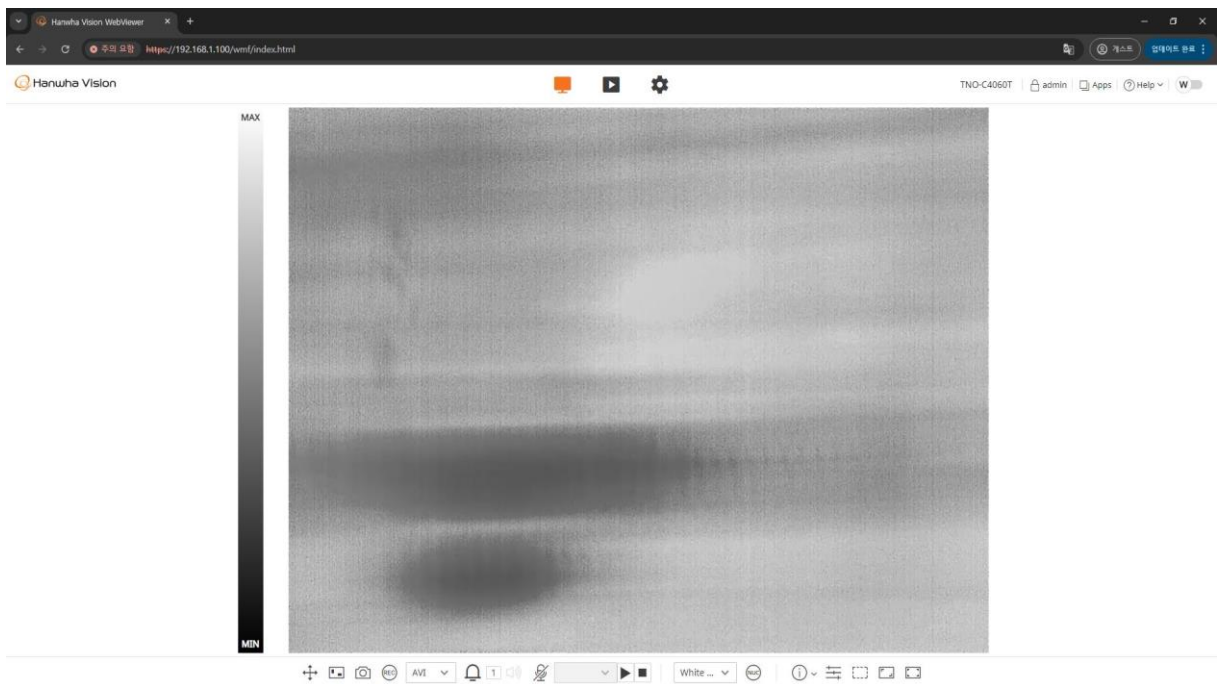

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (12) / (43) pages

3.4 Test result**3.4.1 Test result table**

Evaluation Criteria	Test Results	Comment
Functional operation	Pass	-
Mechanical inspection	Pass	-

※ Refer to the sample operation after the completion of testing in section 3.6.




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (13) / (43) pages

3.5 Test Data

3.5.1 Test data and graph

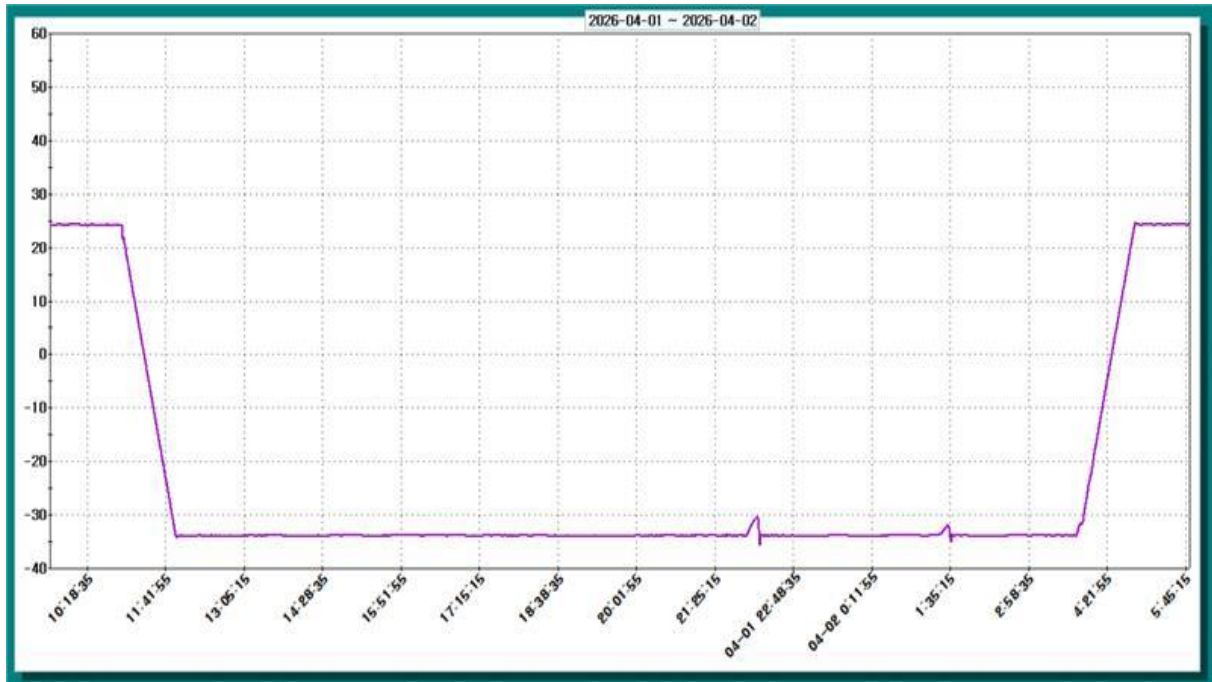

Temperature Data




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (14) / (43) pages

3.6 Post-test operation and function

3.6.1 Test sample operation and function

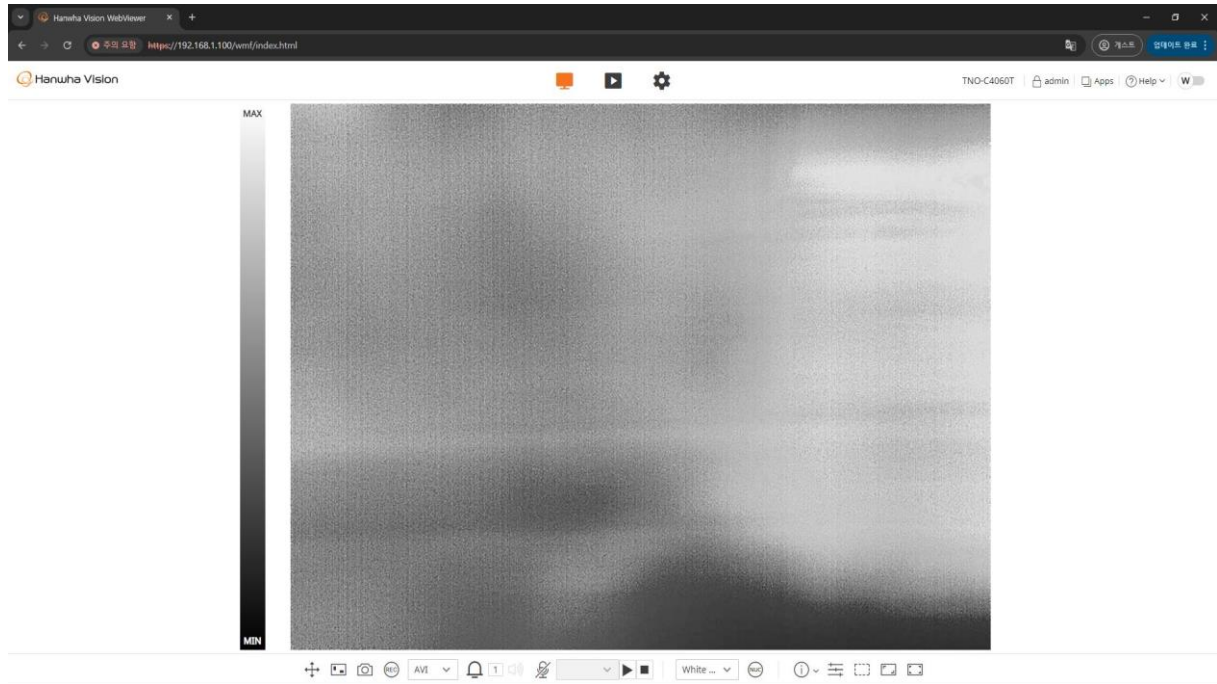

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (15) / (43) pages

4. Dry heat test (EN 60068-2-2, IEC 60068-2-2)

4.1 Test date and environmental conditions

4.1.1 Test date: Mar. 27, 2026 ~ Mar. 31, 2026

4.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.8	45.1	89.9

4.2 Test conditions and methods

4.2.1 Preconditioning temperature: 25 °C

4.2.2 Sample status: Operation

4.2.3 Test temperature: 60 °C

4.2.4 Test time: 96 h

4.2.5 Recovery Temperature: 25 °C

4.2.6 Evaluation items

- 1) The test sample shall be checked to determine that it is functionally operable in all modes of its prescribed operation




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (16) / (43) pages

4.3 Testing images

4.3.1 Evidence of test setting

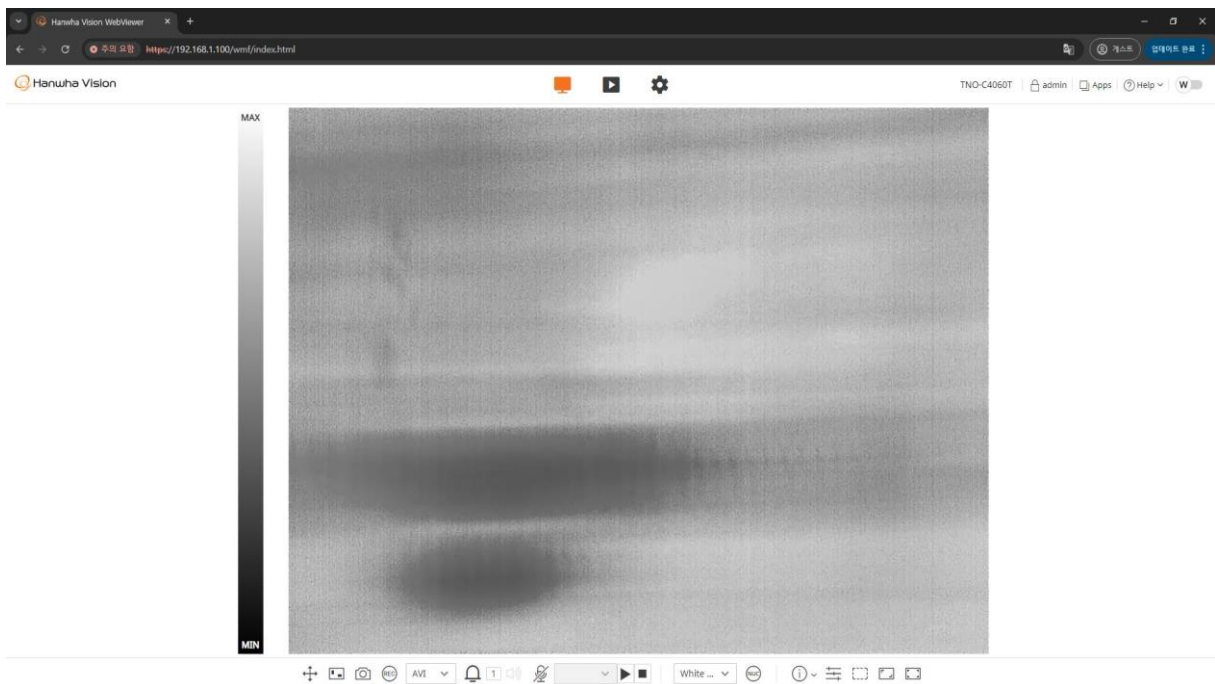

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (17) / (43) pages

4.4 Test result

4.4.1 Test result table

Evaluation Criteria	Test Results	Comment
Functional operation	Pass	-
Mechanical inspection	Pass	-

※ Refer to the sample operation after the completion of testing in section 4.6.




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (18) / (43) pages

4.5 Test Data

4.5.1 Test data and graph

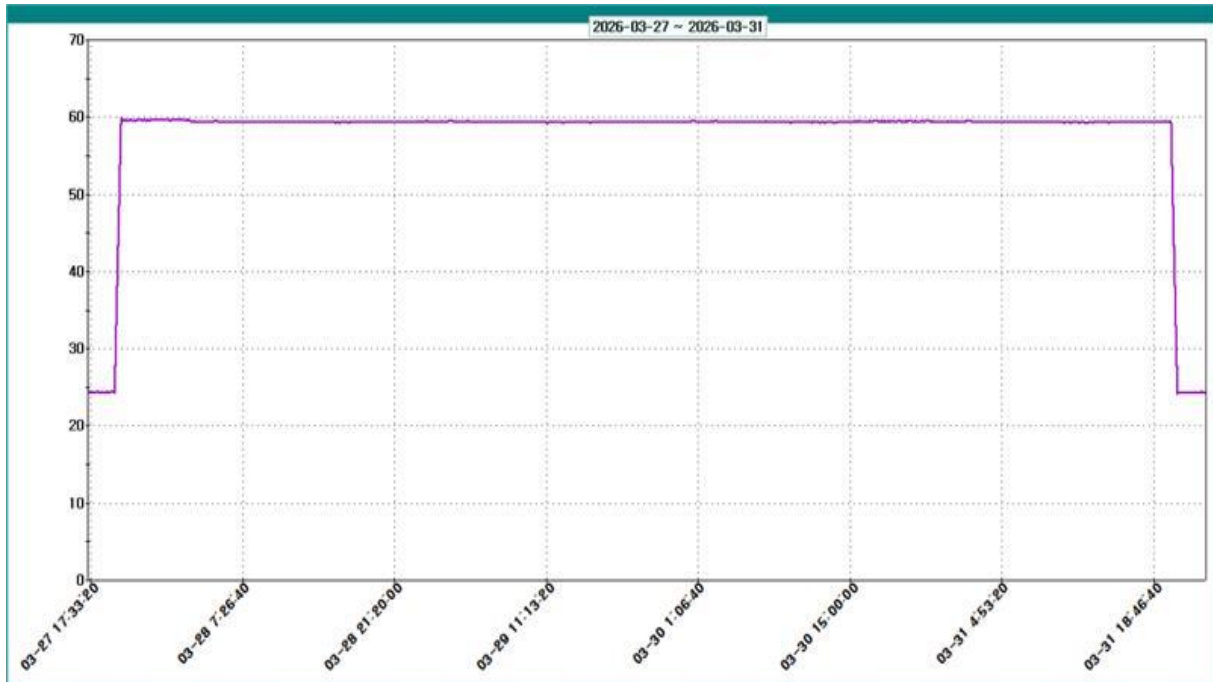

Temperature Data




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (19) / (43) pages

4.6 Post-test operation and function

4.6.1 Test sample operation and function

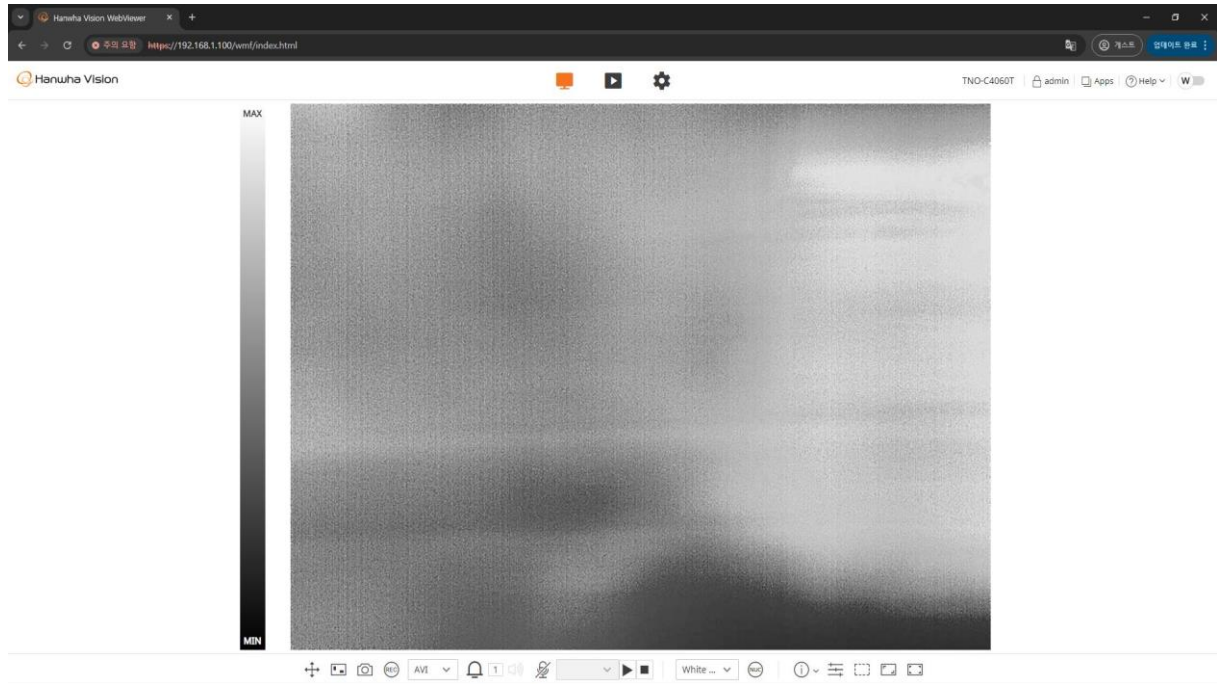

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (20) / (43) pages

5. Change of temperature test (EN 60068-2-14, IEC 60068-2-14)

5.1 Test date and environmental condition

5.1.1 Test date: Mar. 26, 2026 ~ Mar. 27, 2026

5.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	23.6	40.8	99.5

5.2 Test conditions and methods

5.2.1 Sample status: operation

5.2.2 Test temperature: - 40 °C, 60 °C

5.2.3 Evaluation items

- 1) The test sample shall be checked to determine that it is functionally operable in all modes of its prescribed operation

5.2.4 Test method

Temp↵	Temperature change rate(°C/min)↵	t ₁ (idle time)↵	Cycles↵
High↵	5 °C/min↵	3 h↵	3↵
Low↵	1 °C/min↵	3 h↵	3↵




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (21) / (43) pages

5.3 Testing images

5.3.1 Evidence of test setting

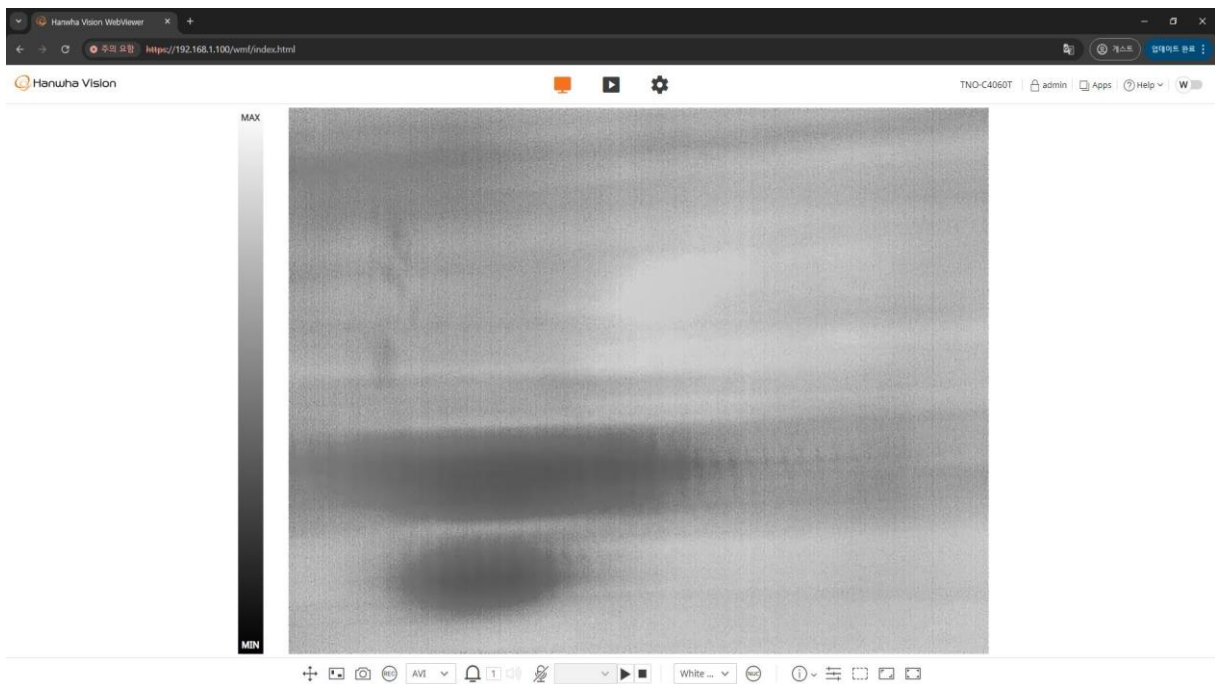

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (22) / (43) pages

5.4 Test result

5.4.1 Test results table

Evaluation Criteria	Test Results	Comment
Functional operation	Pass	-
Mechanical inspection	Pass	-

※ Refer to the sample operation after the completion of testing in section 5.6.




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (23) / (43) pages

5.5 Test Data

5.5.1 Test data and graph

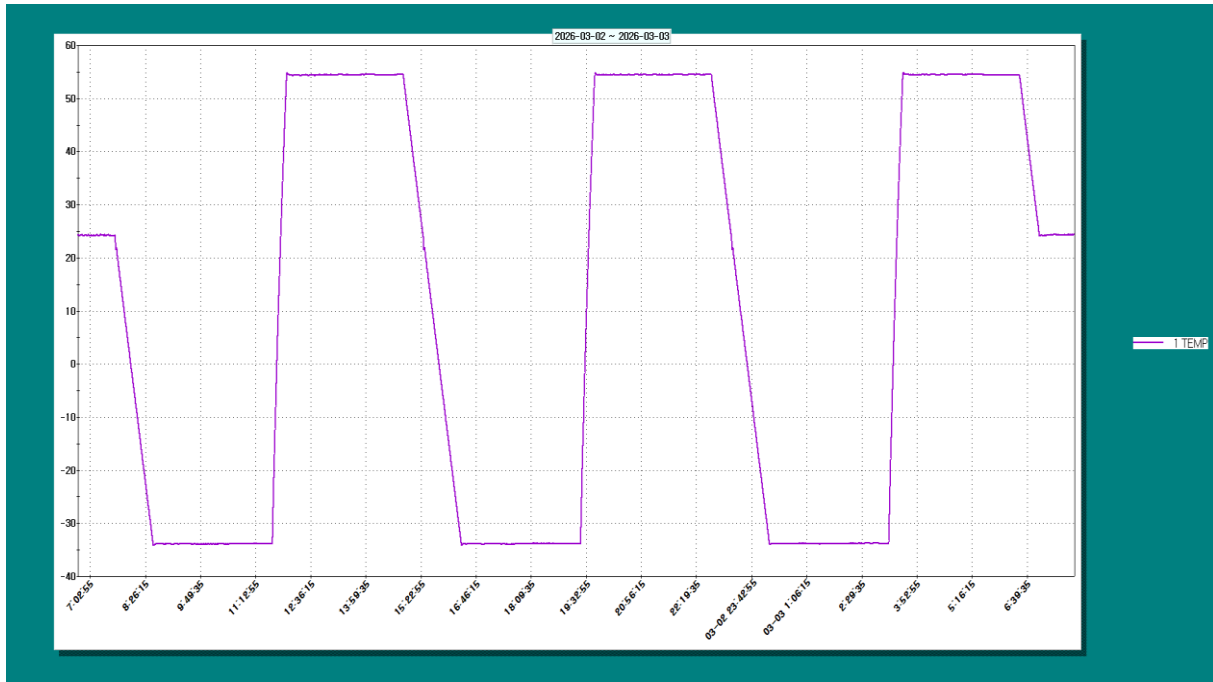

Temperature Data




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (24) / (43) pages

5.6 Post-test operation and function

5.6.1 Test sample operation and function

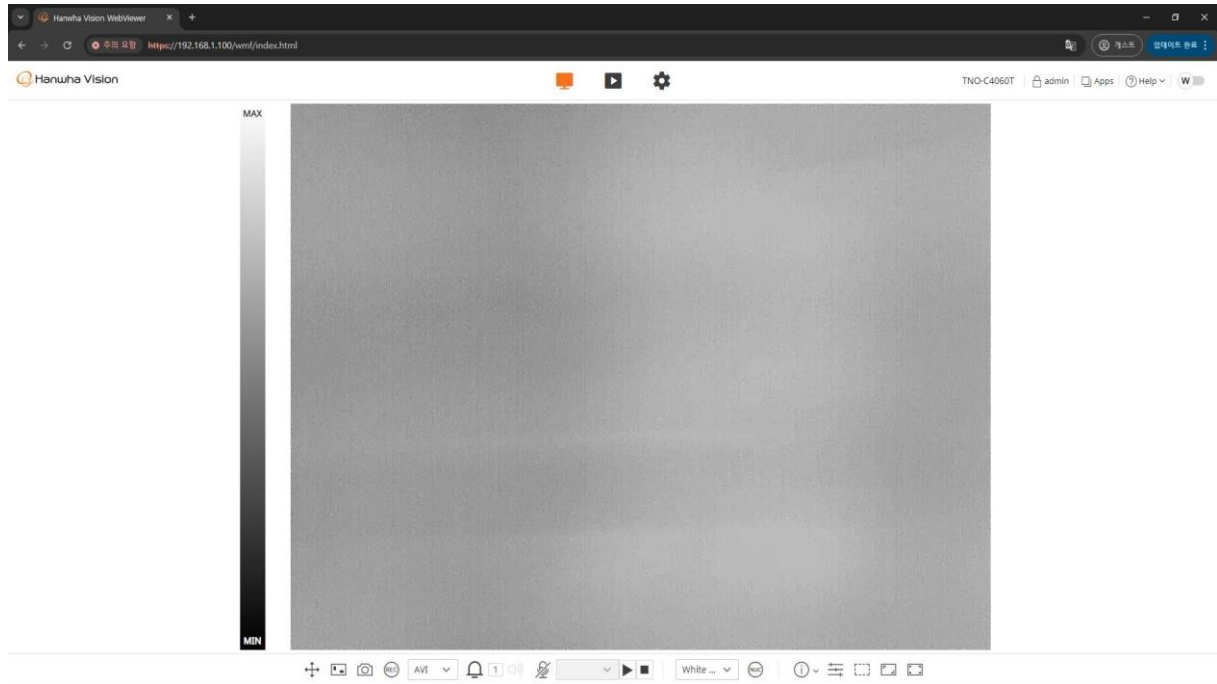

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (25) / (43) pages

6. Vibration Test (EN 60068-2-6, IEC 60068-2-6)

6.1 Test date and environmental conditions

6.1.1 Test date: Apr. 01, 2026 ~ Apr. 07, 2026

6.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.8	45.2	96.8

6.2 Test conditions and methods

6.2.1 Sample status: Operation

6.2.2 Applied waveform: Sine

6.2.3 Frequency (Hz): (5 ~ 200) Hz

6.2.4 Acceleration(G): 1 G

6.2.5 Sweep rate: 1 oct/min

6.2.6 Applicable axis: X, Y, Z


6.2.7 Test time: Total 30 minutes (10 min. per each axis)

6.2.8 Evaluation items


- 1) The test sample shall be checked to determine that it is functionally operable in all modes of its prescribed operation

6.3 Test Setup and During test sample images


6.3.1 Evidence of test setting

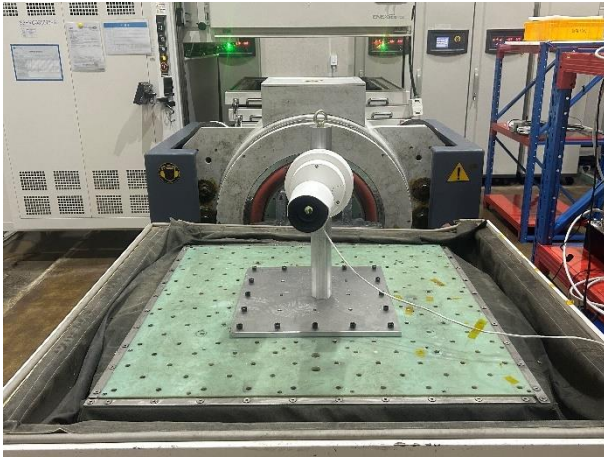

X axis

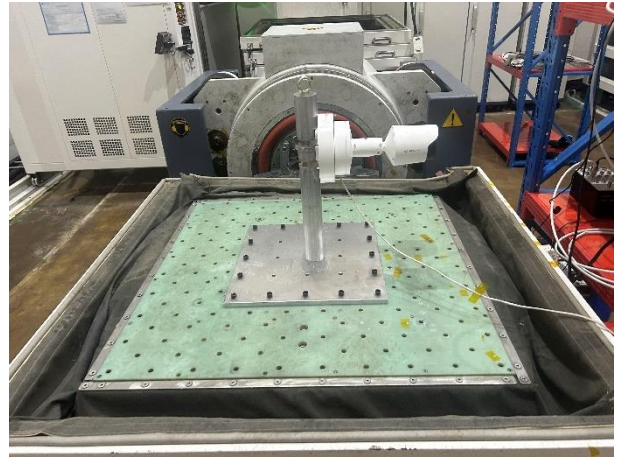

Y axis

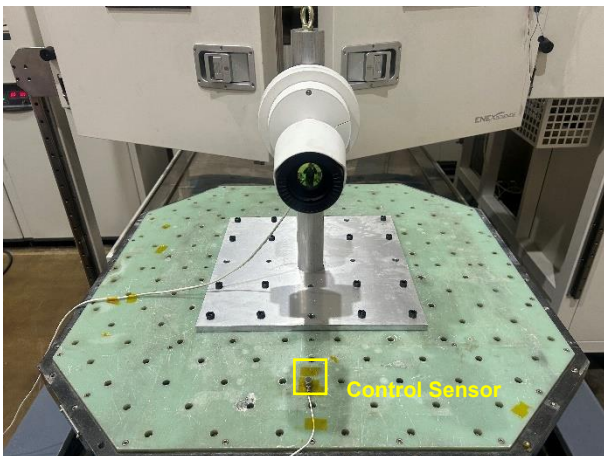

Z axis

※ The control sensors for the X and Y axes are mounted on the vibration plate.

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (27) / (43) pages

6.4 Test result

6.4.1 Test results table

Evaluation Criteria	Test Results	Comment
Functional operation	Pass	-
Mechanical inspection	Pass	-

※ Refer to the sample operation after the completion of testing in section 6.6.




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (28) / (43) pages

6.5 Test Data

6.5.1 Test Data (X, Y Axes)

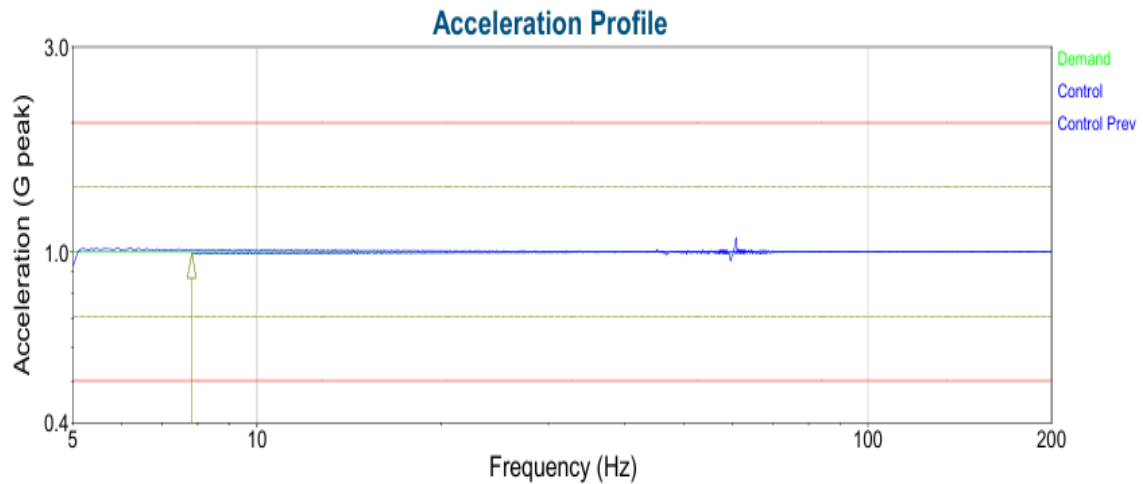

4 03, 2026 18:21:25

Level 1) 100 %

Output: 0.2588 Volts peak

한화비전 60068-2-6

Demand: 1 G

Level Time: 0:10:00


Frequency: 7.835 Hz

Control: 0.993 G

Total Time: 0:10:12

End of Timed Test

Vibration Test (X Axis)

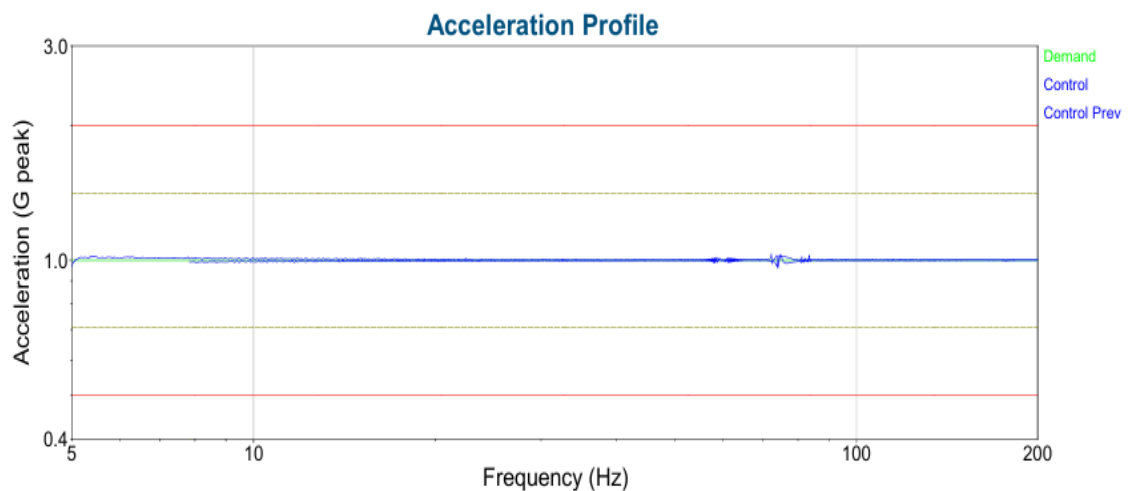

4 06, 2026 11:01:49

Level 1) 100 %

Output: 0 Volts peak

한화비전 60068-2-6

Demand: 1 G

Level Time: 0:10:00

Frequency: 7.841 Hz

Control: 0.002031 G

Total Time: 0:10:13

End of Timed Test

Vibration Test (Y Axis)




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (29) / (43) pages

6.5.2 Test data (Z Axis)

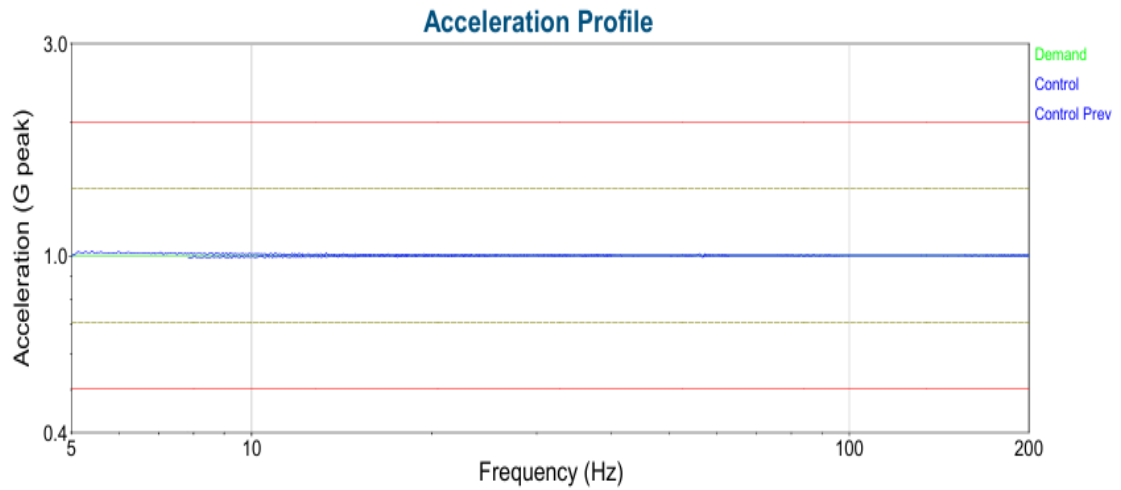

4 07, 2026 11:21:22

Level 1) 100 %

Output: 0 Volts peak

한화비전 60068-2-6

Demand: 1 G

Level Time: 0:10:00

Frequency: 7.846 Hz

Control: 0.001228 G

Total Time: 0:10:13

End of Timed Test

Vibration Test (Z Axis)




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2026-01027
Page (30) / (43) pages

6.6 Post-test operation and function


6.6.1 Test sample operation and function

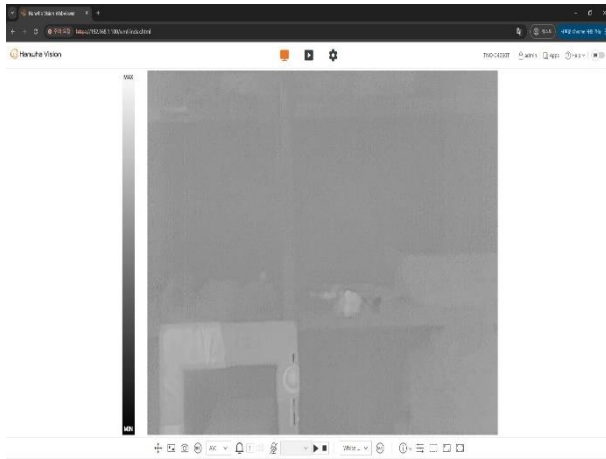

X axis

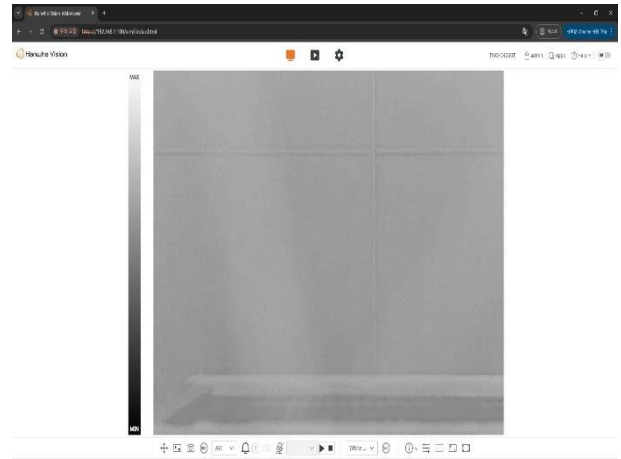

Y axis

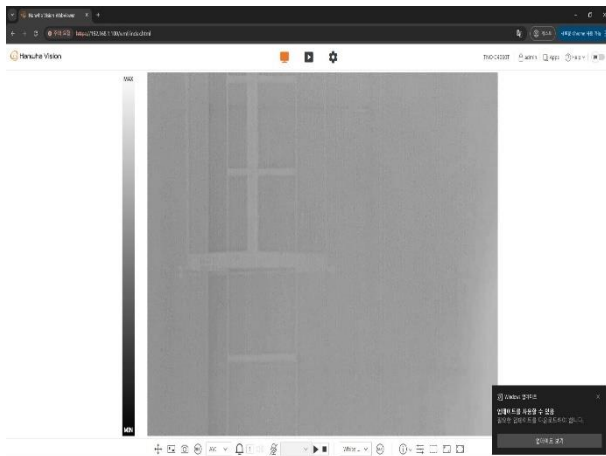

Z axis

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (31) / (43) pages

7. Shock Test (EN 60068-2-27, IEC 60068-2-27)

7.1 Test date and environmental conditions

7.1.1 Test date: Apr. 01, 2026 ~ Apr. 07, 2026

7.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.8	45.2	96.8

7.2 Test conditions and methods

7.2.1 Sample status: Operation

7.2.2 Acceleration(m/s^2): 100 m/s^2


7.2.3 Applicable axis: X, Y, Z

7.2.4 Number of impacts: 10 per direction (total 60)

7.2.5 Evaluation items


- 1) The test sample shall be checked to determine that it is functionally operable in all modes of its prescribed operation

7.2.6 Profile

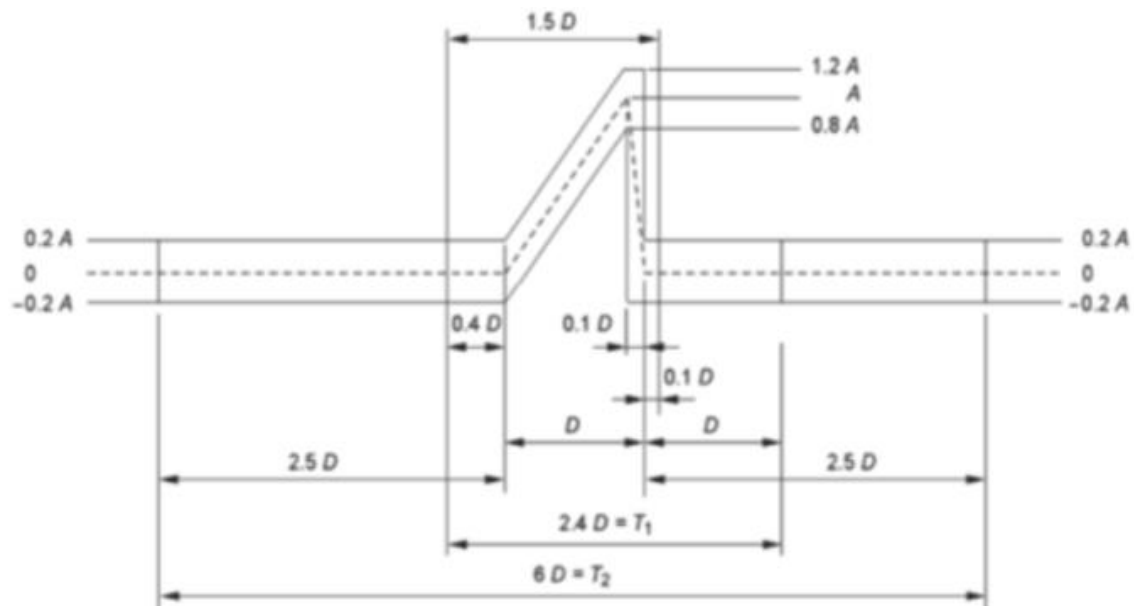


7.3 Test Setup and During test sample images


7.3.1 Evidence of test setting

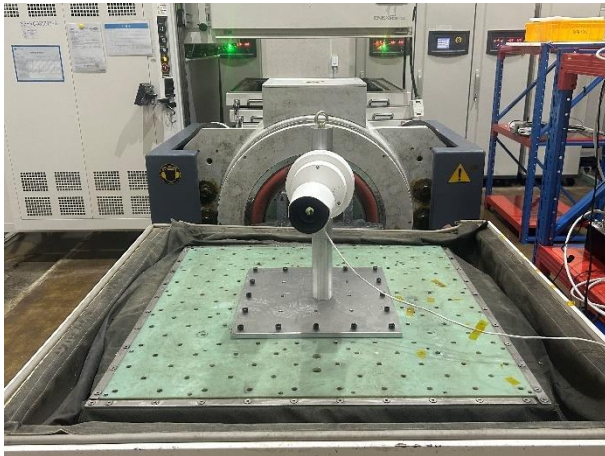

X axis

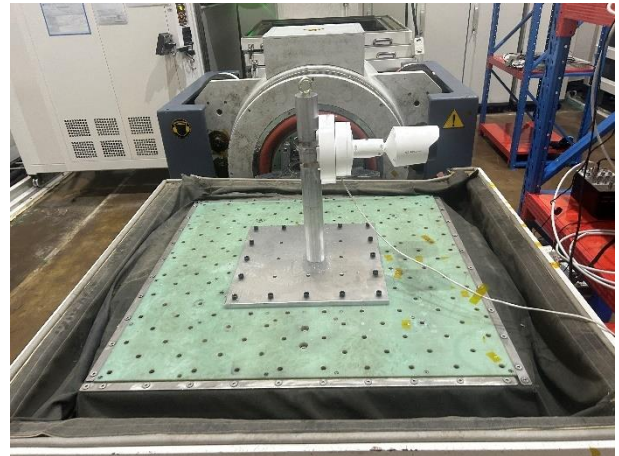

Y axis

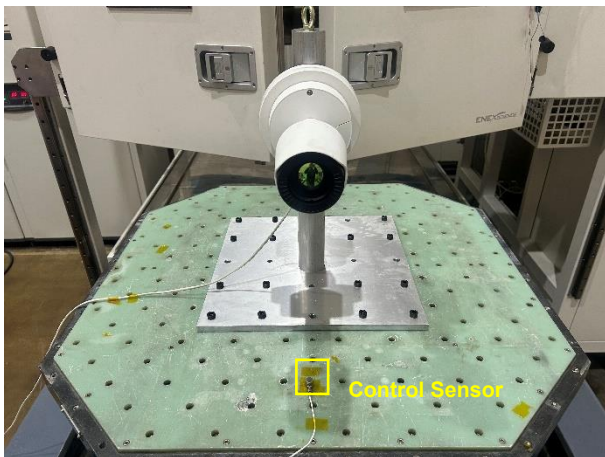

Z axis

※ The control sensors for the X and Y axes are mounted on the vibration plate.

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (33) / (43) pages

7.4 Test result

7.4.1 Test results table

Evaluation Criteria	Test Results	Comment
Functional operation	Pass	-
Mechanical inspection	Pass	-

※ Refer to the sample operation after the completion of testing in section 7.6.




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (34) / (43) pages

7.5 Test Data

7.5.1 Mechanical shock data ($\pm X$ Axis)

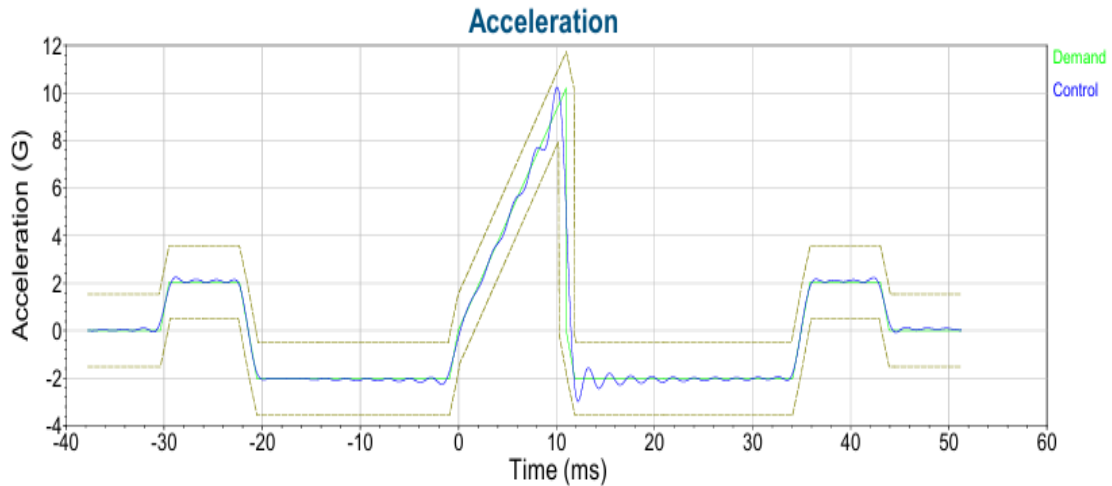

4 03, 2026 18:23:29 Level 1) 100 %


Output: 0.5417 Volts peak 한화비전 60068-2-27

Demand: 10.2 G

Control: 10.23 G Pulse: 10 of 10

Running

Mechanical Chock data +X Axis

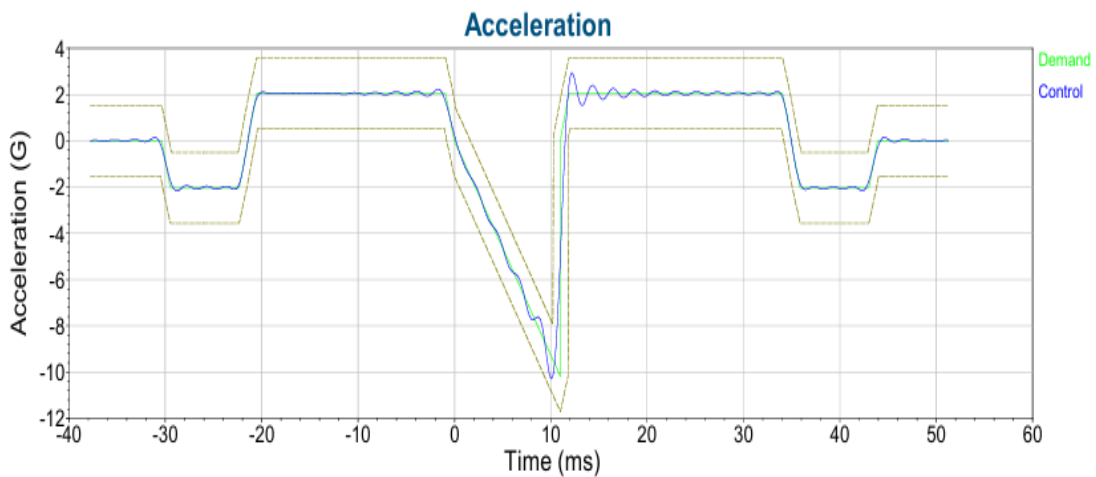

4 03, 2026 18:23:39 Level 2) 100 %

Output: 0.5468 Volts peak 한화비전 60068-2-27

Demand: 10.2 G

Control: 10.3 G Pulse: 10 of 10

End of Test

Mechanical Chock data -X Axis




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (35) / (43) pages


7.5.2 Mechanical shock data ($\pm Y$ Axis)

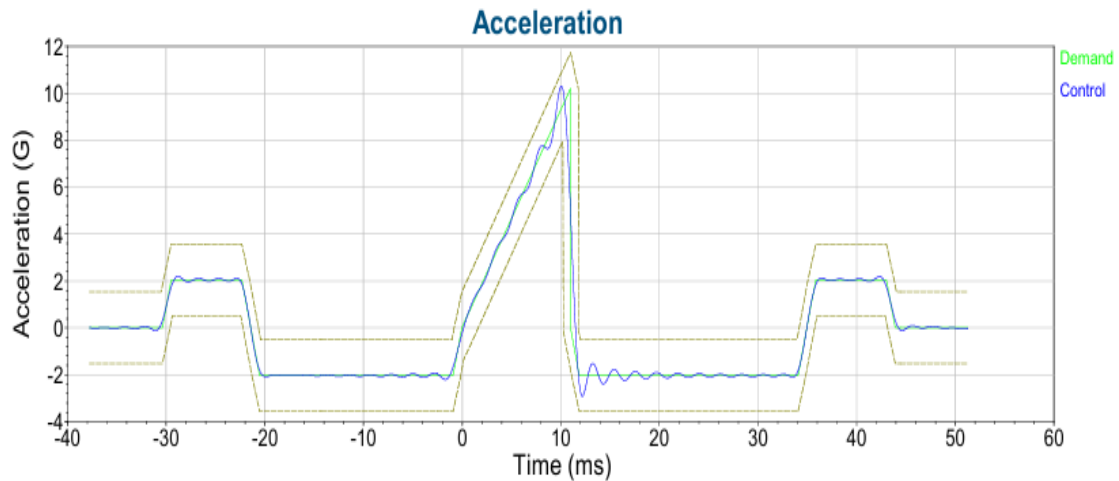

4 06, 2026 11:02:10 Level 1) 100 %
Demand: 10.2 G
Control: 10.29 G Pulse: 10 of 10

Output: 0.5378 Volts peak 한화비전 60068-2-27
Running

Mechanical Chock data +Y Axis

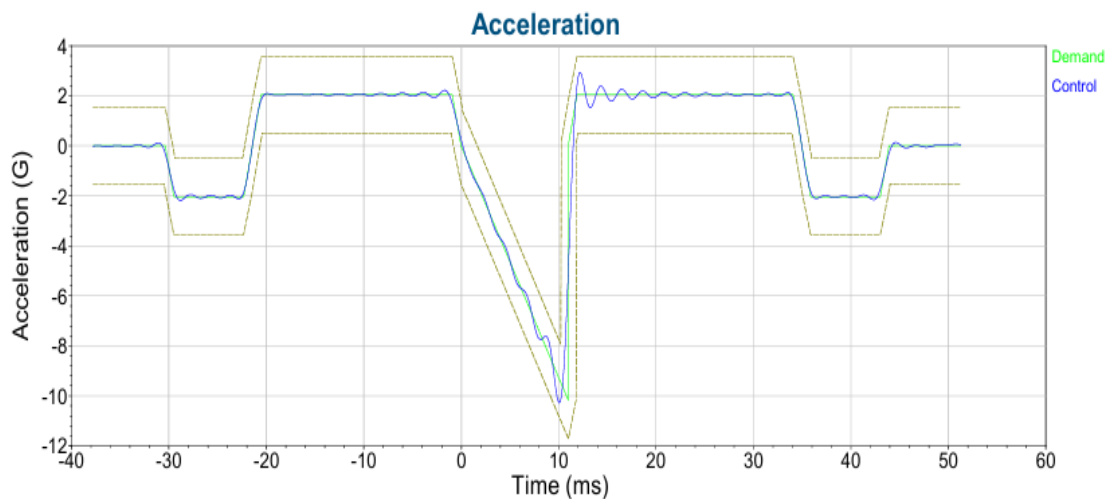

4 06, 2026 11:02:59 Level 2) 100 %
Demand: 10.2 G
Control: 10.29 G Pulse: 10 of 10

Output: 0.5384 Volts peak 한화비전 60068-2-27
End of Test

Mechanical Chock data -Y Axis




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (36) / (43) pages

7.5.3 Mechanical shock data ($\pm Z$ Axis)

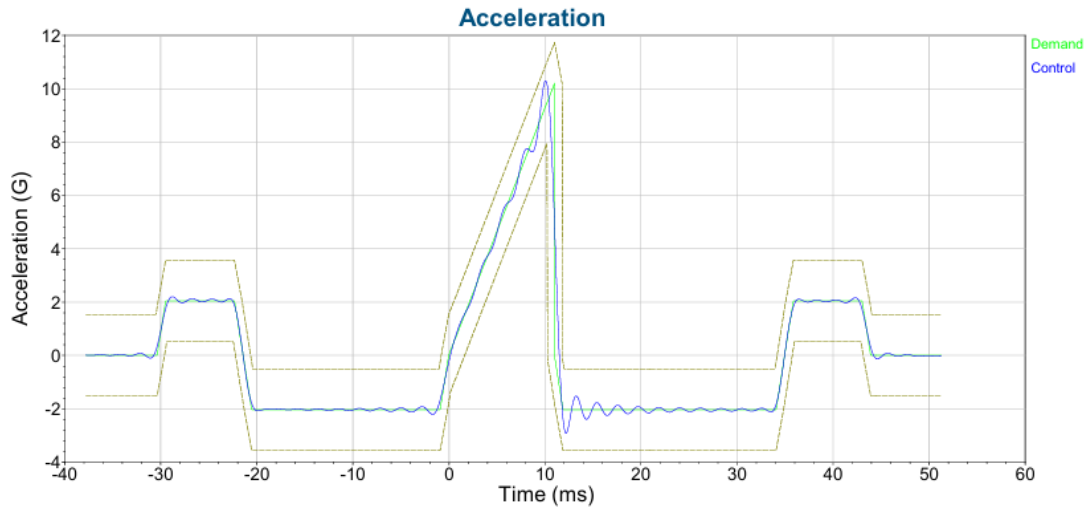

4 07, 2026 11:09:21

Level 1) 100 %

Output: 0.9168 Volts peak

한화비전 60068-2-27


Demand: 10.2 G

Control: 10.29 G

Pulse: 10 of 10

Running

Mechanical Chock data +Z Axis

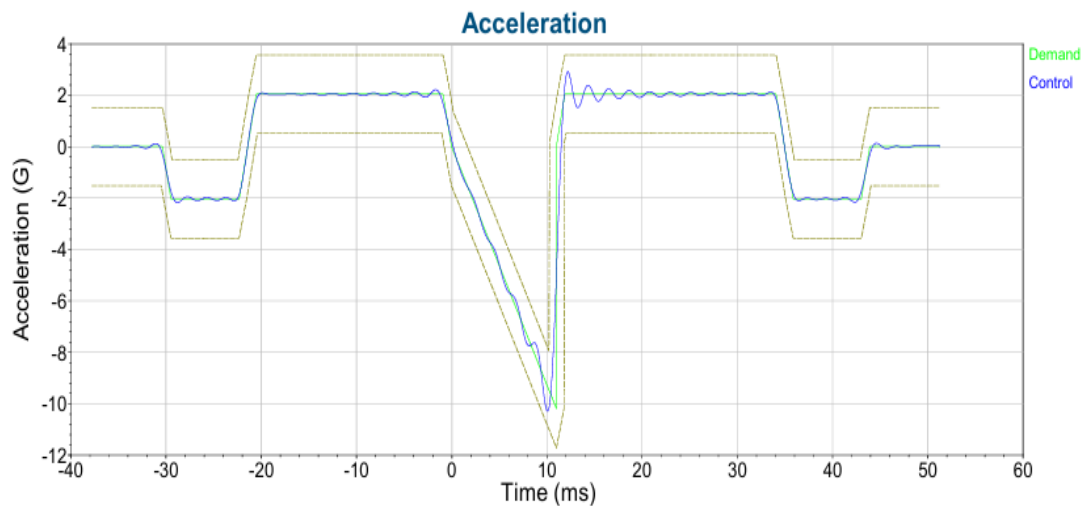

4 07, 2026 11:10:17

Level 2) 100 %

Output: 0.9179 Volts peak

한화비전 60068-2-27

Demand: 10.2 G

Control: 10.3 G

Pulse: 10 of 10

End of Test

Mechanical Chock data -Z Axis




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2026-01027
Page (37) / (43) pages

7.6 Post-test operation and function


7.6.1 Test sample operation and function

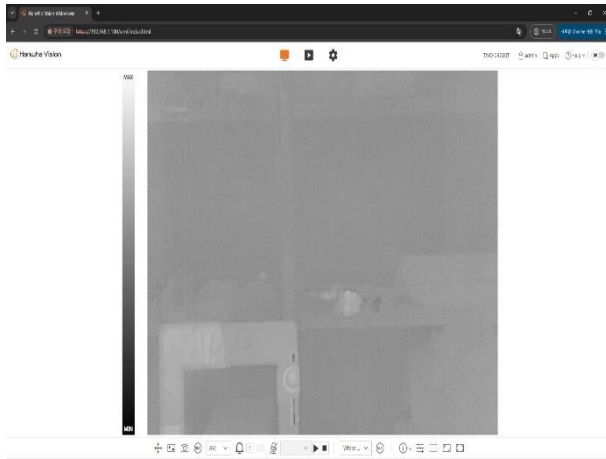

X axis

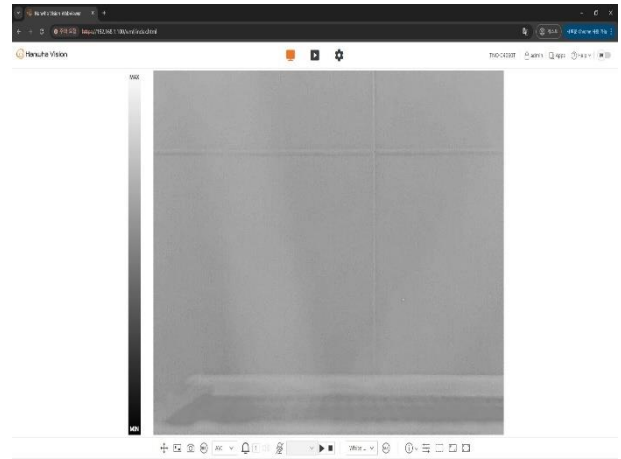

Y axis

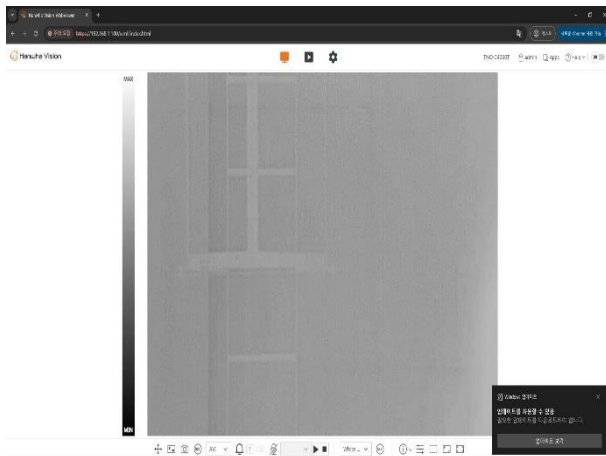

Z axis

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (38) / (43) pages

8. Damp heat Test (EN 60068-2-78, IEC 60068-2-78)

8.1 Test date and environmental conditions

8.1.1 Test date: Feb. 24, 2026 ~ Mar. 06, 2026

8.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	23.3	54.6	95.9

8.2 Test conditions and methods

8.2.1 Preconditioning temperature: 25 °C

8.2.2 Sample status: Operation

8.2.3 Test temperature: 40 °C

8.2.4 Test humidity: 93 % R.H.

8.2.5 Test time: 240 h

8.2.6 Recovery Temperature: 25 °C

8.2.7 Evaluation items

- 1) The test sample shall be checked to determine that it is functionally operable in all modes of its prescribed operation

8.3 Test Setup and During test sample images

8.3.1 Evidence of test setting



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (40) / (43) pages

8.4 Test result

8.4.1 Test results table

Evaluation Criteria	Test Results	Comment
Functional operation	Pass	-
Mechanical inspection	Pass	-

※ Refer to the sample operation after the completion of testing in section 8.6.

8.5 Test Data

8.5.1 Test data and graph



Temperature Data




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (42) / (43) pages

8.6 Post-test operation and function

8.6.1 Test sample operation and function

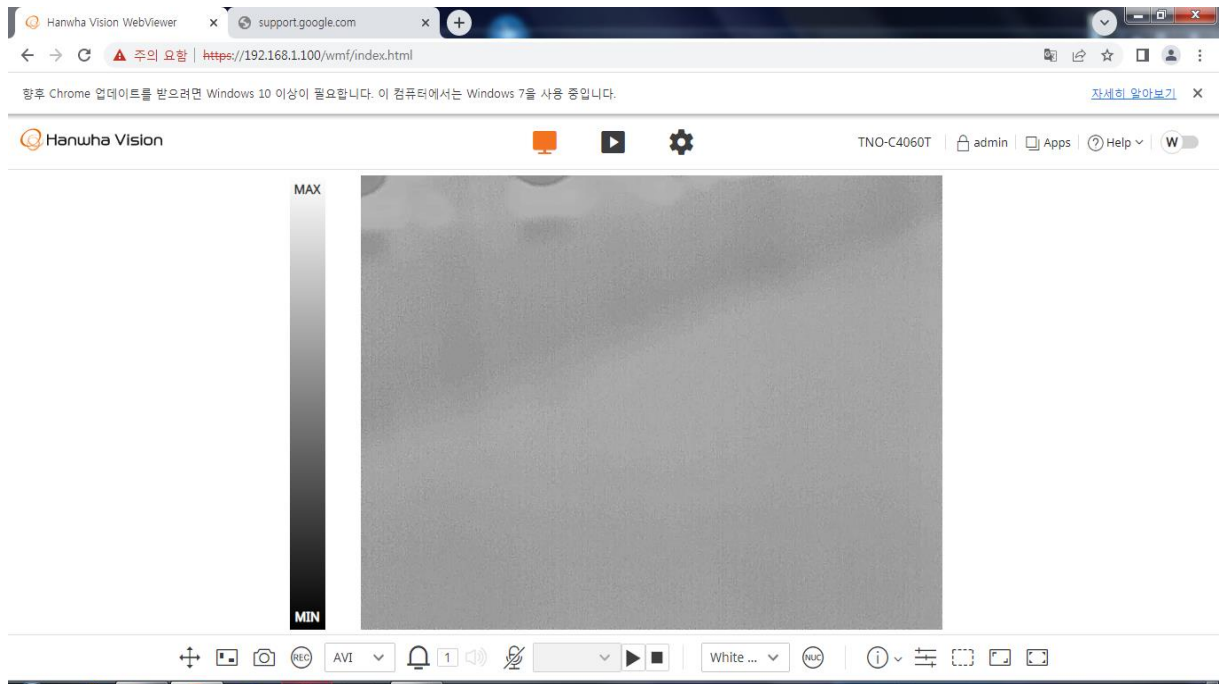



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2026-01027
Page (43) / (43) pages

8.7 Post-test sample images

8.7.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side

- End -