

TEST REPORT

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (1) / (20) pages

1. Applicant

- Name : Hanwha Vision Co., Ltd
- Address : 6, Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si,
Gyeonggi-do, 13488 KOREA
- Date of Receipt : Jul. 04, 2025

2. Manufacturer

- Name : Hanwha Vision Co., Ltd

3. Use of Report :

For submission to customer

4. Test sample / Model :

NETWORK CAMERA / TNP-A9430RW

5. Date(s) of test :

Jul. 22, 2025 ~ Jul. 31, 2025

6. Test Standard (Method) used :

NEMA TS 2.2.8, NEMA TS 2.2.9

7. Testing Environment :

Temperature: (25 ±10) °C, Humidity: (50 ±25) % R.H.

Pressure: (96 ±10) kPa

8. Test Results :

Refer to the test results

9. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing
(5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea)

The results shown in this test report refer only to the sample(s) tested unless otherwise stated. This report cannot be reproduced or copied without the written consent of CTK.

	Tested by Name: HyungUk Jeon (Signature) 	Technical Manager Name: HoHyun Lee (Signature) 
--	---	---

Remark. This report is not related to KOLAS accreditation and relevant regulation.

Sep. 04, 2025

CTK Co., Ltd.



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (2) / (20) pages

Table of Contents

1. Testing laboratory	3
1.1 Testing laboratory information	3
1.2 Testing laboratory accreditation status	3
2. Product description and equipment information	4
2.1 Product description	4
2.2 Model description	4
2.3 Equipment information	4
2.4 Pre-test product images	5
2.5 Testing equipment images	6
3. Resonant search, Endurance Test [NEMA TS 2-2013 2.2.8]	7
3.1 Test date and environmental conditions	7
3.2 Test conditions and methods	7
3.3 Testing images	9
3.4 Test Result	10
3.5 Test Data	11
4. Shock(impact) Test [NEMA TS 2-2013 2.2.9]	14
4.1 Test date and environmental conditions	14
4.2 Test conditions and methods	14
4.3 Testing images	15
4.4 Test Result	16
4.5 Test Data	17
4.6 Post-test product images	20

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (3) / (20) pages

1. Testing laboratory

1.1 Testing laboratory information

Lab. Name	CTK Co., Ltd.
Representative	Young Joseph Seungwon
Address	5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea
Tel.	+82-31-339-9970
Fax.	+82-31-624-9501
E-Mail	all.youngin@element.com
Website	www.elementkorea.kr

1.2 Testing laboratory accreditation status

Country	Classification	Accreditation Number	Logo
International	KOLAS	TESTING NO. KT119	

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (4) / (20) pages

2. Product description and equipment information

2.1 Product description

Product Name	Model Name	Quantity	Comment
NETWORK CAMERA	TNP-A9430RW	1 EA	–

2.2 Model description

Basic Model	TNP-A9430RW
Series model	TNP-A7430RW, TNP-A6550RW, TNP-A9430RWB, TNP-A7430RWB, TNP-A6550RWB
Model differences	Use of the same external shape and materials (case, finishing material, PCB, cable, etc.), differences in SW.

2.3 Equipment information

Testing equipment	Model Name	Manufacturer	Manufacturing Number	Calibration Date
Temperature & Humidity Chamber	C4-340	Weissttechnik	54260023190010	Feb 6, 2026
VIBRATION TESTING SYSTEM	LT1010	FAMTECH	D2012335	N/A
Acceleration sensor	8703A250M5	KISTLER	5830236	Jan. 16, 2026
Acceleration sensor	8703A250M5	KISTLER	5722241	Jan. 16, 2026

2.4 Pre-test product images

2.4.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (6) / (20) pages

2.5 Testing equipment images

2.5.1 Test equipment



Temperature & Humidity Chamber



VIBRATION TESTING SYSTEM



8703A250M5



8703A250M5

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (7) / (20) pages

3. Resonant search, Endurance Test [NEMA TS 2-2013 2.2.8]

3.1 Test date and environmental conditions

3.1.1 Test date: Jul. 22, 2025 ~ Jul. 24, 2025

3.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.7	45.0	89.9

3.2 Test conditions and methods

3.2.1 Resonant search [NEMA TS 2-2013 2.2.8.3]

- Sample status : unpackaged / not in operation
- Applied waveform : Sine
- Frequency(Hz) : 5 ~ 30
- Double amplitude displacement (inch) : 0.015
- Sweep rate(Sweep/min) : 12.5
- Applicable axis : X, Y, Z
- Test time(h) : 12.5
- Evaluation items
 - Check for mechanical damage before and after testing
- Test methods
 - With the test unit securely fastened to the test table, set the test table for a double amplitude displacement of 0.015 inch.
 - Cycle the test table over a search range from 5 to 30 Hz and back within a period of 12.5 minutes.
 - Conduct the resonant frequency search in each of the three mutually perpendicular planes.
 - Note and record the resonant frequency determined from each plane.
 - ◆ In the event of more than one resonant frequency in a given plane, record the most severe a. resonance.
 - ◆ b. If resonant frequencies appear equally severe, record each resonant frequency.
 - ◆ c. If no resonant frequency occurs for a given plane within the prescribed range, 30 Hz shall be recorded.

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02422
Page (8) / (20) pages

3.2.2 Endurance Test[NEMA TS 2-2013 2.2.8.4]


- Sample status : unpackaged / not in operation
- Applied waveform : Sine
- Frequency(Hz) : 30 or 3.2.2 Test results
- Acceleration(G) : 0.5
- Applicable axis : X, Y, Z
- Test time(h) : All 3(Each axis 1)
- Evaluation items
 - Check for mechanical damage before and after testing
- Test methods
 - Vibrate the test unit in each plane at its resonant frequency for a period of 1 hour at an amplitude resulting in 0.5 g acceleration. (test profile)
 - When more than one resonant frequency has been recorded in accordance with Section 1.2 Item 4, the test period of 1 hour shall be divided equally between the resonant frequencies.
 - The total time of the endurance test shall be limited to 3 hours, 1 hour in each of three mutually perpendicular planes.

3.3 Testing images


3.3.1 Evidence of test setting (NEMA TS 2-2013 2.2.8)

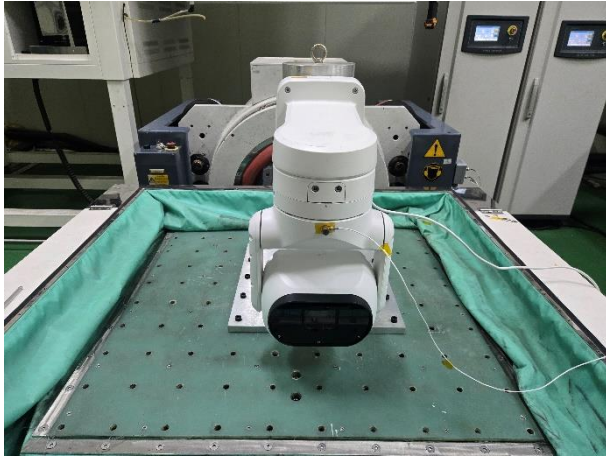


X axis_1

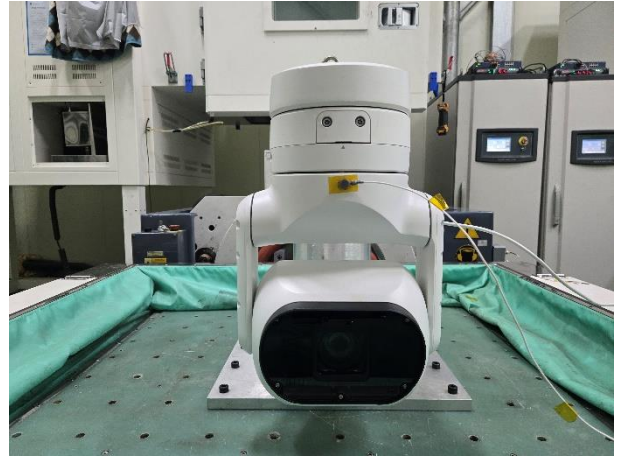


X axis_2

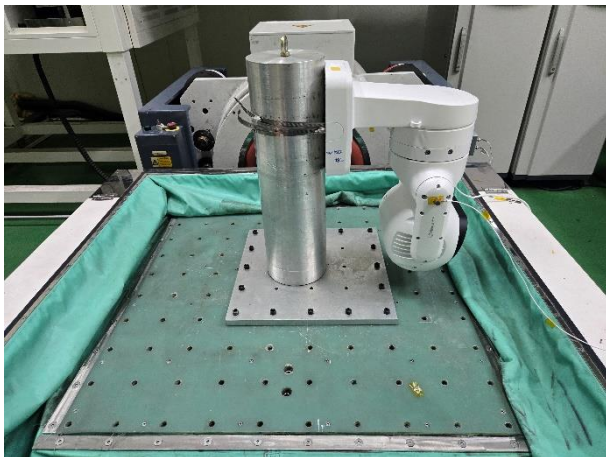

Y axis_1

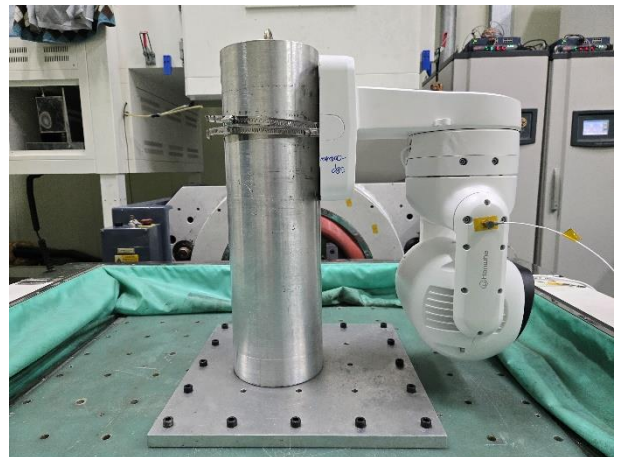

Y axis_2

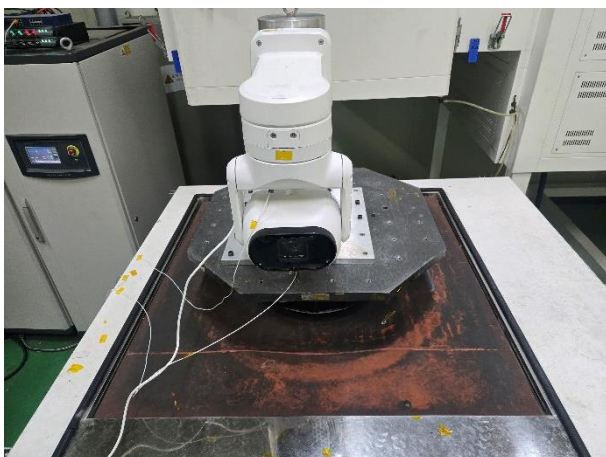

Z axis_1



Z axis_2

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (10) / (20) pages

3.4 Test Result

3.4.1 Test result table

Evaluation Criteria		Test Results	Comment
Resonant search Test	Before	Normal	
	After	Normal	
Endurance Test	Before	Normal	
	After	Normal	




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (11) / (20) pages

3.5 Test Data

3.5.1 Test Data X Axis

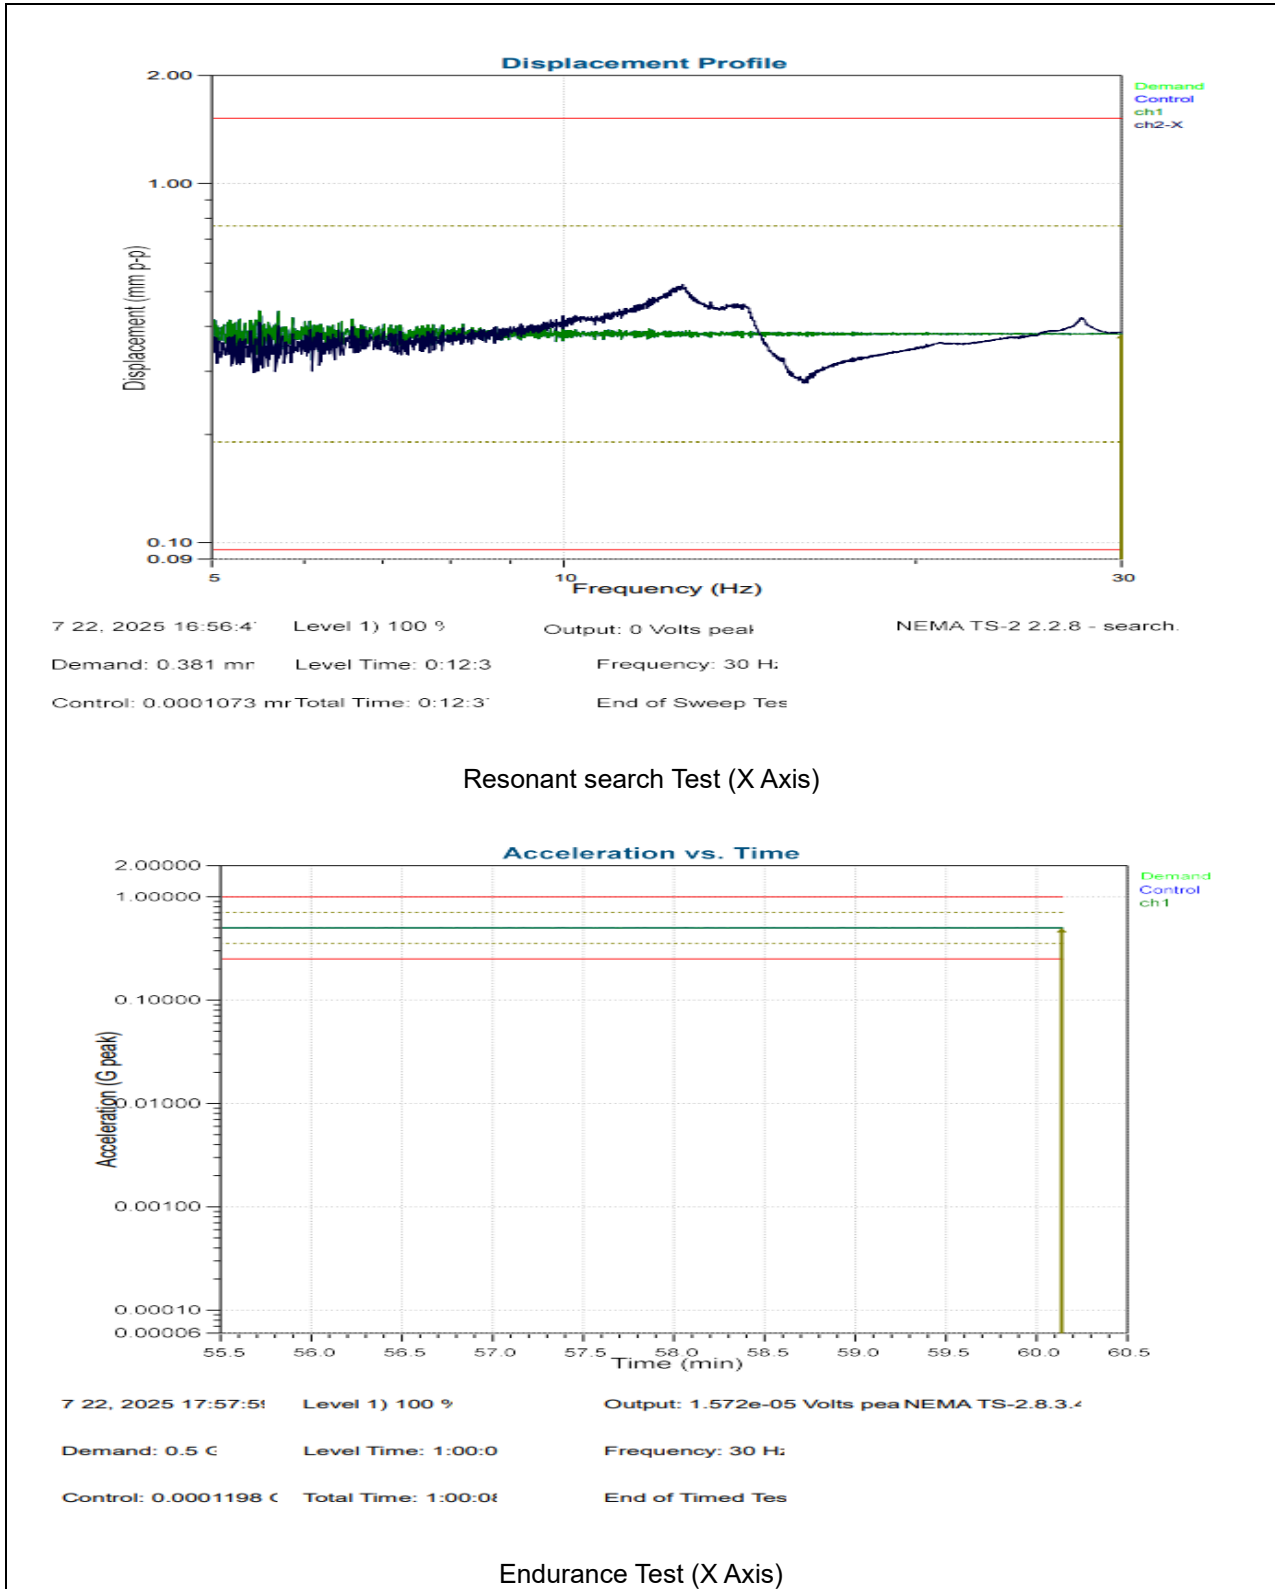




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (12) / (20) pages

3.5.2 Test Data Y Axis

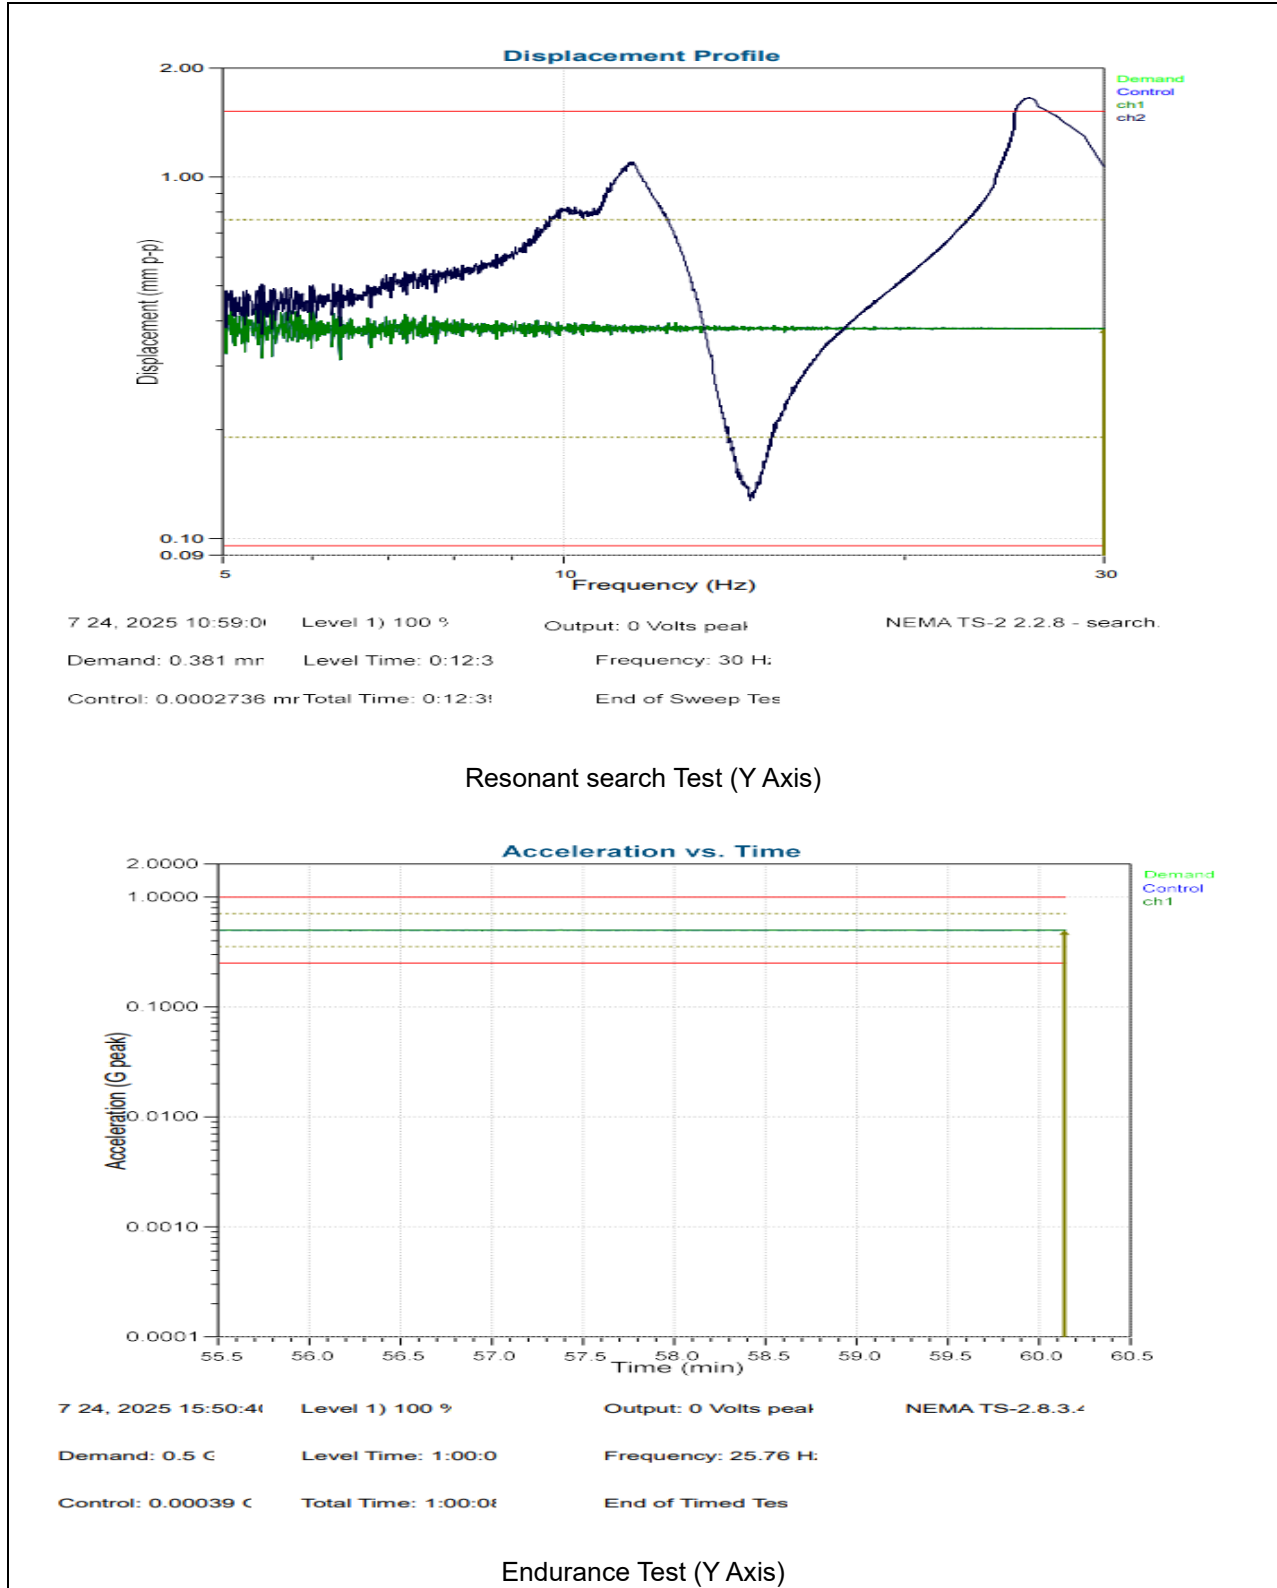




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02422
Page (13) / (20) pages

3.5.3 Test Data Z Axis

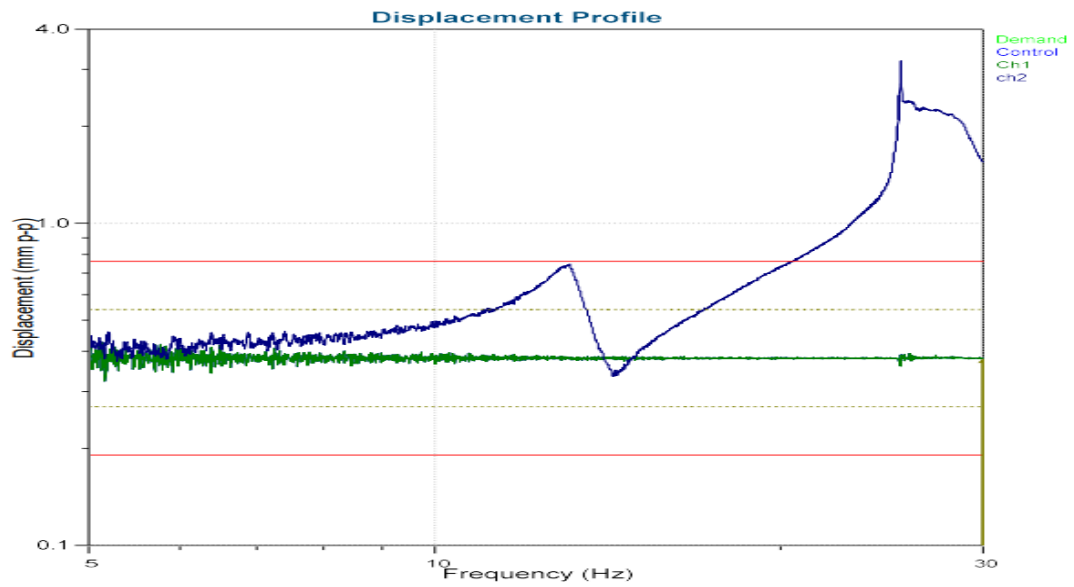

7 24, 2025 16:33:12 Level 1) 100 % Output: 0.06312 Volts peak NEMA-TS 2.2.8.3
Demand: 0.381 mm Level Time: 0:12:30 Frequency: 30 Hz
Control: 0.3803 mm Total Time: 0:12:37 End of Sweep Test

Resonant search Test (Z Axis)

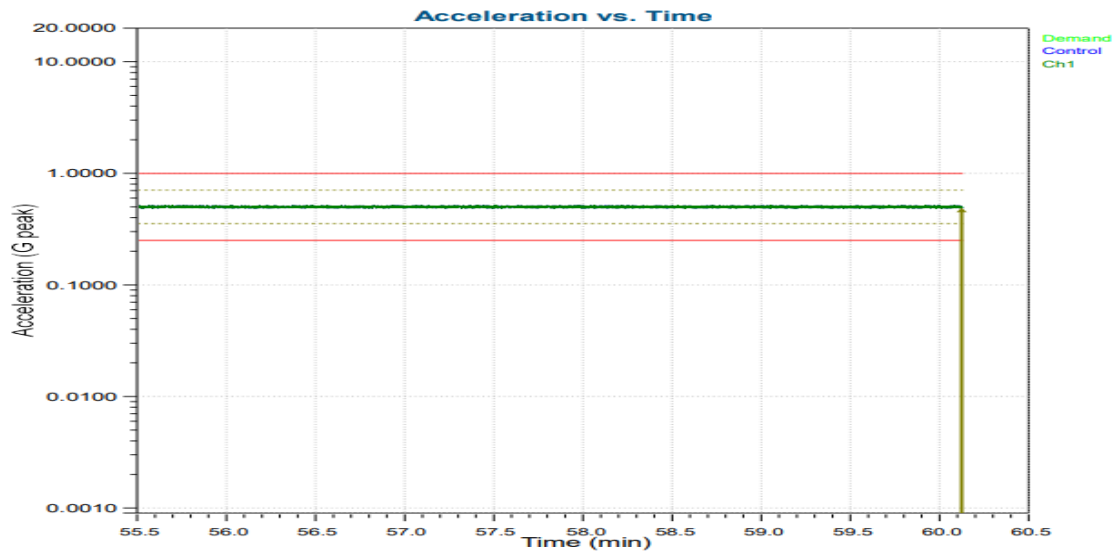

7 24, 2025 17:38:27 Level 1) 100 % Output: 0.0707 Volts peak NEMA-TS 2.2.8.3.4
Demand: 0.5 G Level Time: 1:00:00 Frequency: 25.46 Hz
Control: 0.4909 G Total Time: 1:00:07 End of Timed Test

Endurance Test (Z Axis)

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (14) / (20) pages

4. Shock(impact) Test [NEMA TS 2-2013 2.2.9]

4.1 Test date and environmental conditions

4.1.1 Test date: Jul. 24, 2025 ~ Jul. 31, 2025

4.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	24.8	45.2	89.9

4.2 Test conditions and methods

4.2.1 Sample status: unpackaged / not in operation

4.2.2 Applied waveform: Half sine

4.2.3 Acceleration(G): 10 G

4.2.4 Nominal duration (ms): 11


4.2.5 Applicable axis : X, Y, Z

4.2.6 Number of impacts: 1 per direction (total 6)


4.2.7 Evaluation items: Check for mechanical damage before and after testing

4.3 Testing images


4.3.1 Evidence of test setting (NEMA TS 2-2013 2.2.9)

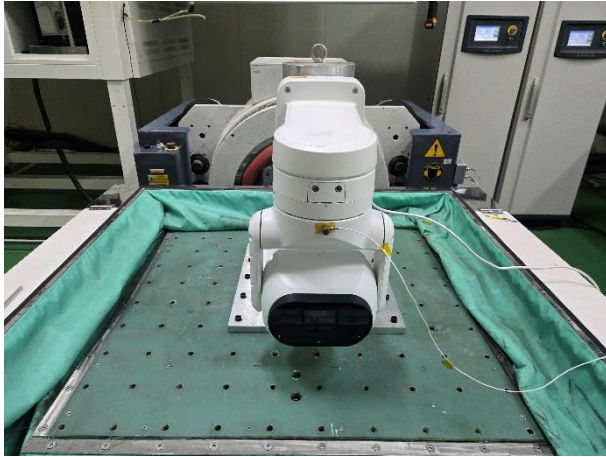


X axis_1

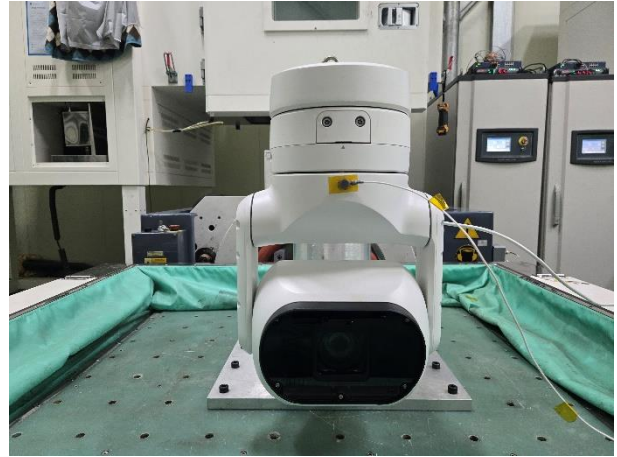


X axis_2

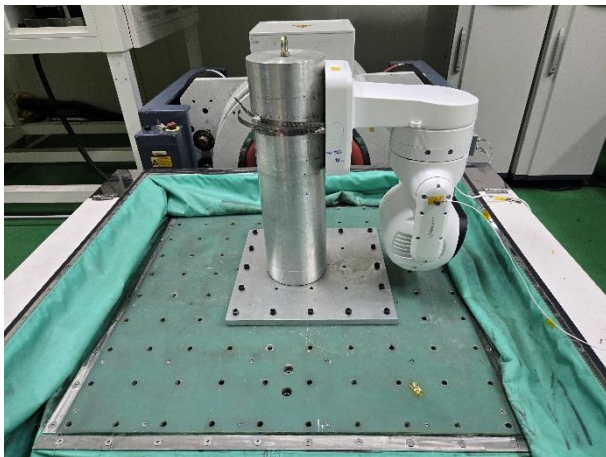

Y axis_1

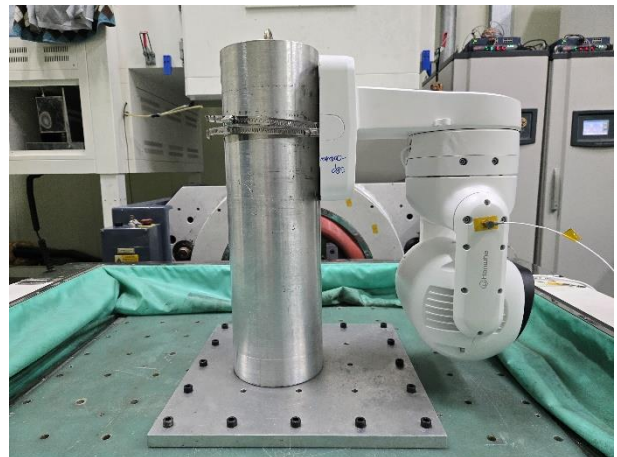

Y axis_2

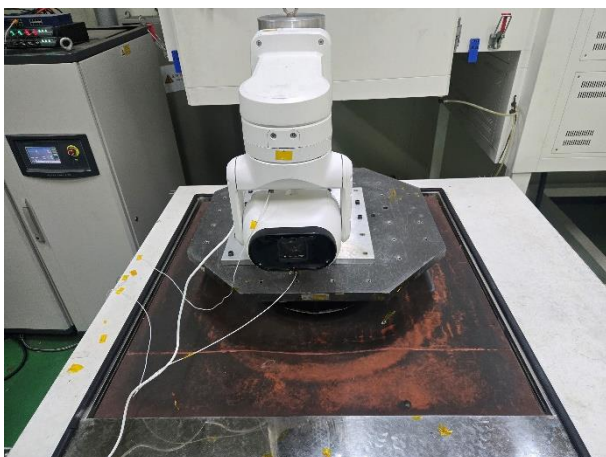

Z axis_1



Z axis_2

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (16) / (20) pages

4.4 Test Result

4.4.1 Test result table

Evaluation Criteria		Test Results	Comment
Shock(impact) Test	Before	Normal	
	After	Normal	




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (17) / (20) pages


4.5 Test Data

4.5.1 Test Data X Axis

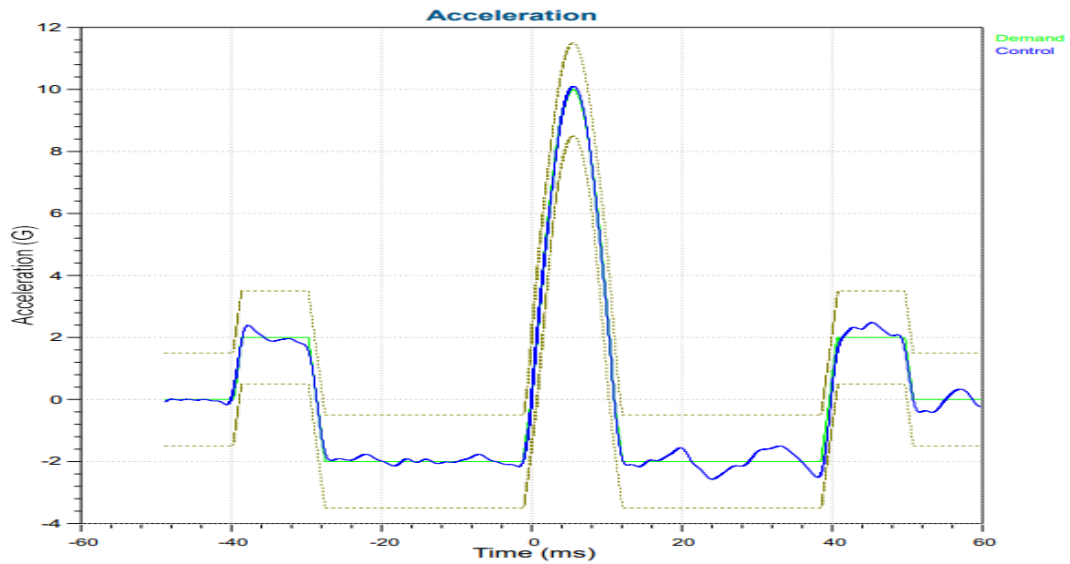

7 24, 2025 10:27:34 Level 1) 100 % Output: 0.7656 Volts peak 2025-05-02 NEMA TS-2 2.2.5
Demand: 10 G
Control: 10.1 G Pulse: 1 of 1 Running

X+

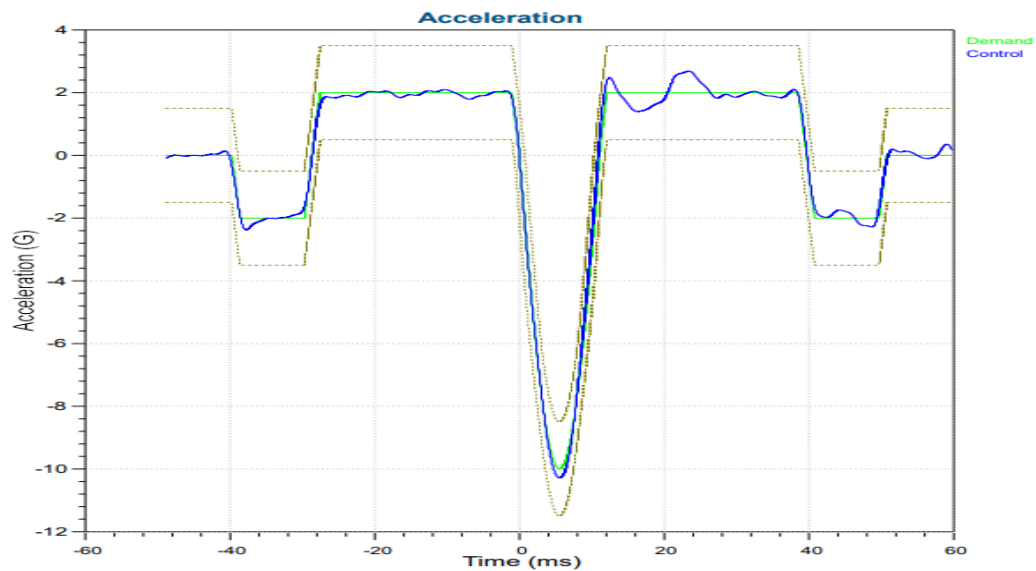

7 24, 2025 10:28:04 Level 2) 100 % Output: 0.7629 Volts peak 2025-05-02 NEMA TS-2 2.2.5
Demand: 10 G
Control: 10.28 G Pulse: 1 of 1 End of Test

X-




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (18) / (20) pages

4.5.2 Test Data Y Axis

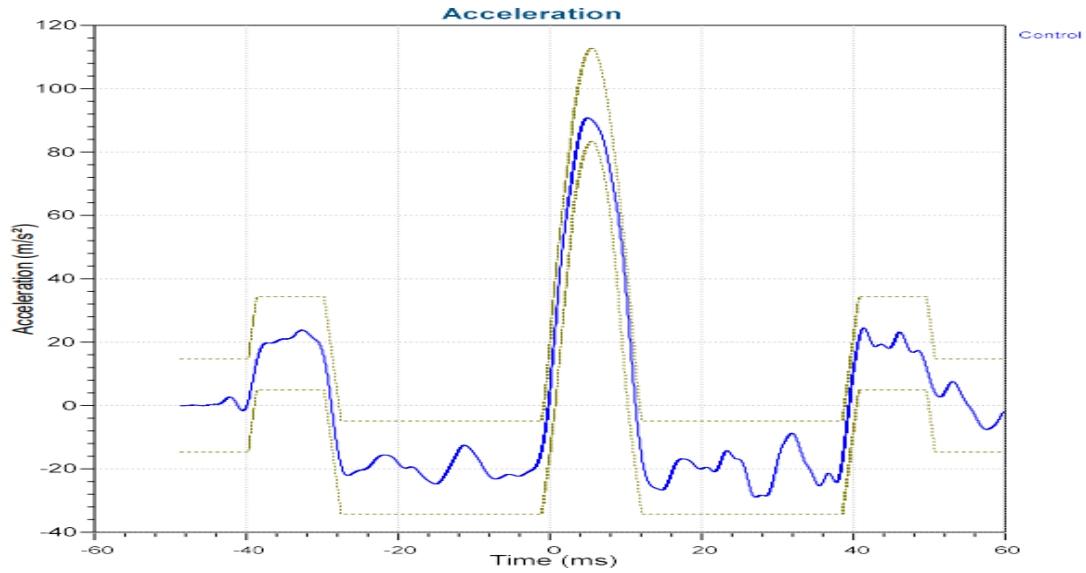


7 31, 2025 14:37:42 Level 1) 100 % Output: 0.743 Volts peak NEMA-TS 2.2.9

Demand: 98.07 m/s^2

Control: 90.82 m/s^2 Pulse: 1 of 1 Running

Y+

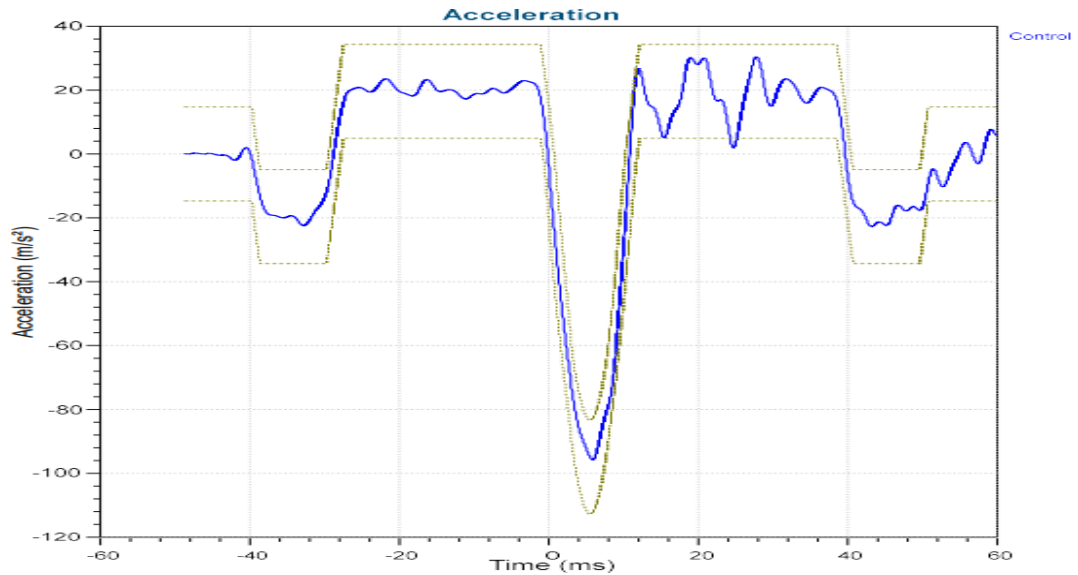

7 31, 2025 14:37:54 Level 2) 100 % Output: 0.7652 Volts peak NEMA-TS 2.2.9

Demand: 98.07 m/s^2

Control: 95.84 m/s^2 Pulse: 1 of 1 End of Test

Y-




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02422
Page (19) / (20) pages

4.5.3 Test Data Z Axis

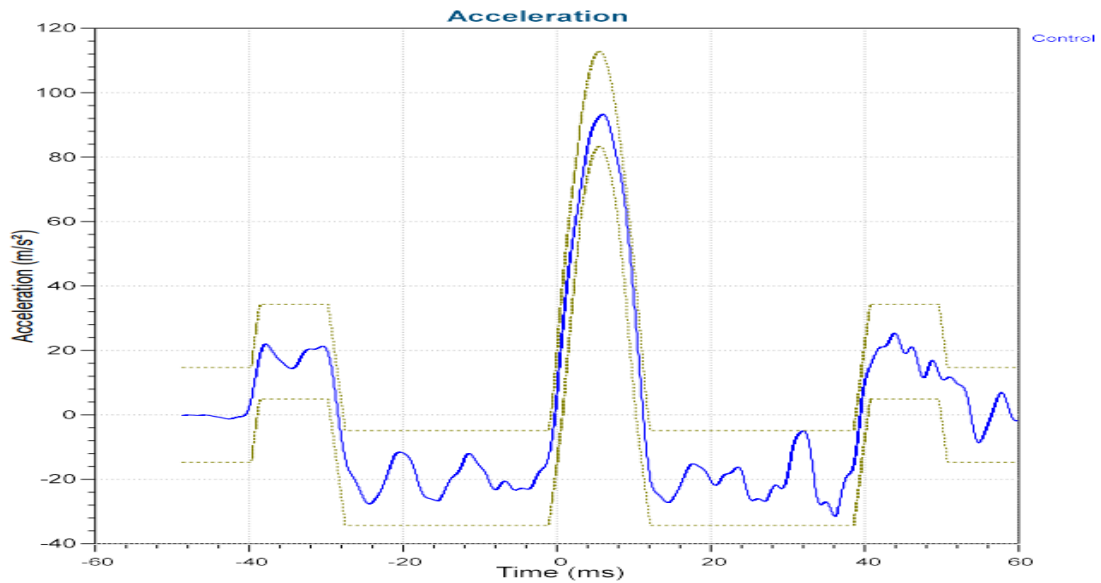


7 31, 2025 11:20:56 Level 1) 100 % Output: 0.7576 Volts peak NEMA-TS 2.2.9

Demand: 98.07 m/s^2

Control: 93.3 m/s^2 Pulse: 1 of 1 Running

Z+

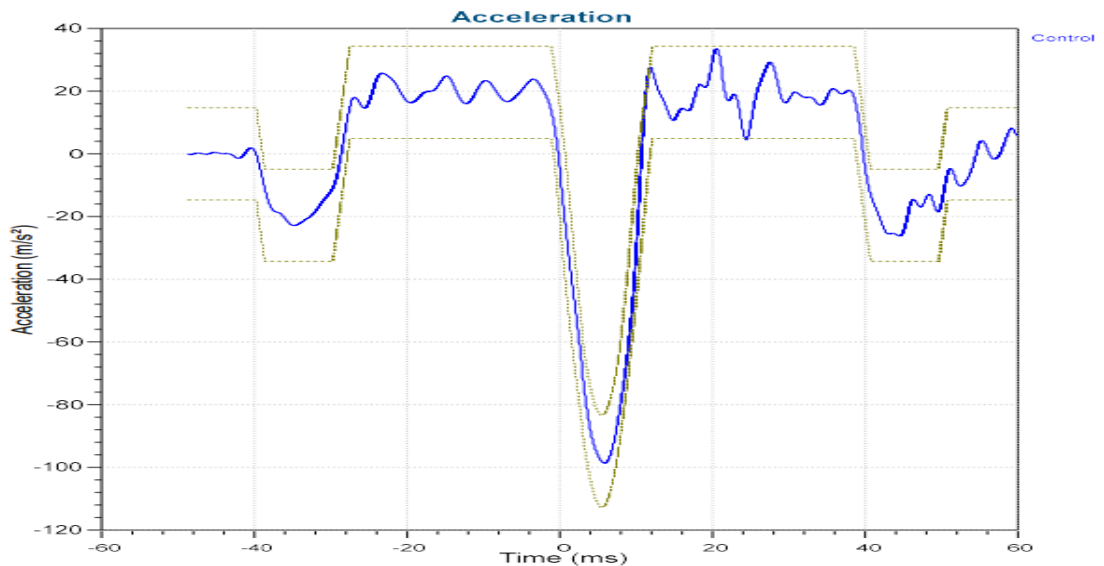

7 31, 2025 11:21:32 Level 2) 100 % Output: 0.7531 Volts peak NEMA-TS 2.2.9

Demand: 98.07 m/s^2

Control: 98.68 m/s^2 Pulse: 1 of 1 End of Test

Z-

4.6 Post-test product images

4.6.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side

- End -