

TEST REPORT

**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (1) / (15) pages

1. Applicant

- Name : Hanwha Vision Co., Ltd.
- Address : 6 Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si,
Gyeonggi-do, 13488 Republic of Korea
- Date of Receipt : Jan. 20, 2025

2. Manufacturer

- Name : Hanwha Vision Co., Ltd.

3. Use of Report :

For submission to customer

4. Test sample / Model :

NETWORK CAMERA / XND-A9084RV

5. Date(s) of test :

Feb. 14, 2025 ~ Feb. 17, 2025

6. Test Standard (Method) used :

IEC 60529:1989 +A1:1999+A2:2013

7. Testing Environment :

Temperature: (25 ±10) °C, Humidity: (50 ±25) % R.H.

Pressure: (96 ±10) kPa

8. Test Results :

Refer to the test results

9. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing
(113, Yejik-ro, Cheoin-gu, Yongin-si, Gyeonggi-do Republic of Korea)

The results shown in this test report refer only to the sample(s) tested unless otherwise stated. This report cannot be reproduced or copied without the written consent of CTK.

Approval	Tested by	Technical Manager
	Name: HyungUk Jeon (Signature) 	Name: HoHyun Lee (Signature) 

Remark. This report is not related to KOLAS accreditation and relevant regulation.

Aug. 26, 2025

CTK Co., Ltd.



**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (2) / (15) pages

Table of Contents

1. Testing laboratory	3
1.1 Testing laboratory information	3
1.2 Testing laboratory accreditation status.....	3
2. Product description and equipment information	4
2.1 Product description	4
2.2 Model description	4
2.3 Equipment information	4
2.4 Pre-test product images	5
2.5 Testing equipment images.....	6
2.6 Product appearance.....	7
3. Degrees of protection provided by enclosures (IP code)	8
3.1 Test date and environmental conditions	8
3.2 Test conditions and methods.....	8
3.3 Testing images	11
3.4 Test result.....	13
3.5 Post-test product images	14

**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (3) / (15) pages

1. Testing laboratory

1.1 Testing laboratory information

Lab. Name	CTK Co., Ltd.
Representative	Young Joseph Seungwon
Address	5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si Gyeonggi-do, Republic of Korea
Tel.	+82-31-339-9970
Fax.	+82-31-624-9501
E-Mail	all.youngin@element.com
Website	www.elementkorea.kr

1.2 Testing laboratory accreditation status

Country	Classification	Accreditation Number	Logo
International	KOLAS	TESTING NO. KT119	

**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (4) / (15) pages

2. Product description and equipment information

2.1 Product description

Product Name	Model Name	Quantity	Comment
NETWORK CAMERA	XND-A9084RV	1 EA	-

2.2 Model description

Basic Model	XND-A9084RV
Series model	XND-A8084RV, XND-A6084RV
Model differences	Use of the same external shape and materials (case, finishing material, PCB, cable, etc.), differences in image sensor, lens.

2.3 Equipment information

Testing equipment	Model Name	Manufacturer	Manufacturing Number	Calibration Date
Stop Watch	NONE	Casio	612Q01R-1	Jan. 23, 2026
Push Pull Gage	FB30K	Imada	83805	Jan. 16, 2026
Test Rod Probe Ø1.0	TRP-02	ED&D	S1-J15	May. 16, 2027
Dust Chamber	NONE	JFM	S5-IP02	Feb. 23, 2025
Water flow meter with Drip box	M-15	LZT	200971	Feb. 19. 2025
Drip box	Drip Box, IPX1/ IPX2	Kingpo	ZH13388-1	
Steel measuring meter	5.5 m	KOMELON	225851	Jan. 16, 2026



CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (5) / (15) pages

2.4 Pre-test product images

2.4.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side



CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (6) / (15) pages

2.5 Testing equipment images

2.5.1 Test equipment



Push Pull Gage



Test Rod Probe Ø1.0



Dust Chamber



Water flow meter with Drip box



Drip box



Steel measuring meter




CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (7) / (15) pages

2.6 Product appearance

Enclosure dimensions [unit : mm]

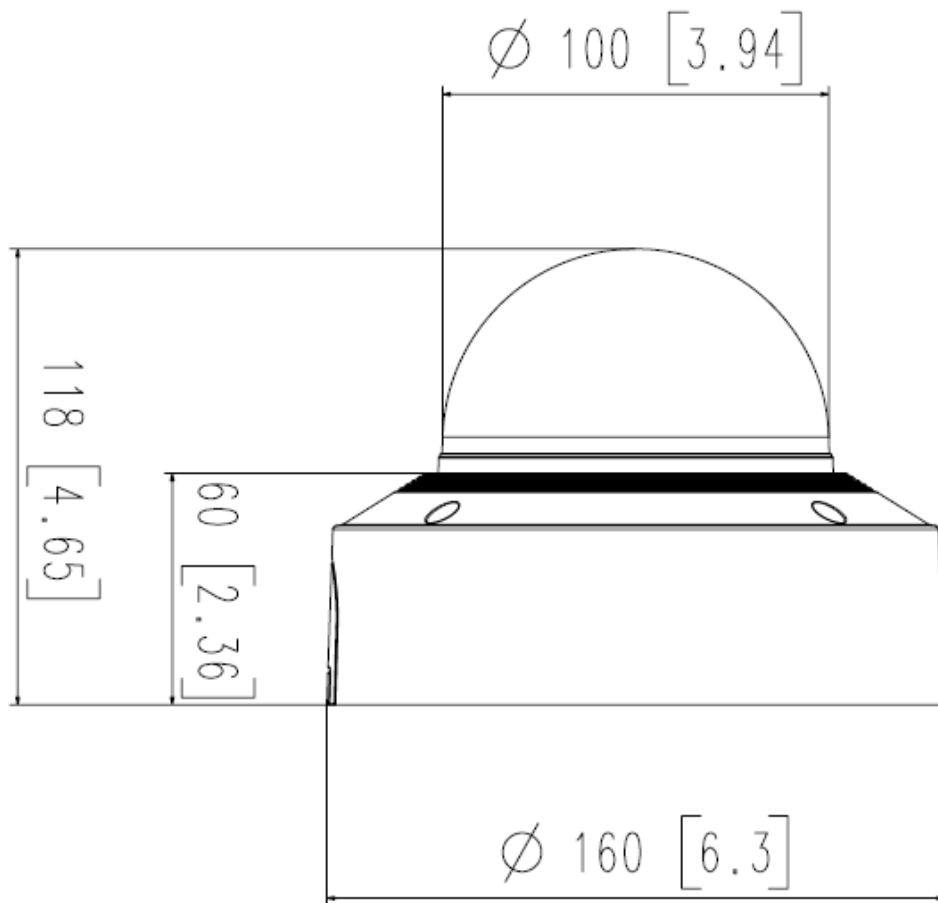

**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (8) / (15) pages

3. Degrees of protection provided by enclosures (IP code)

3.1 Test date and environmental conditions

3.1.1 Test date: Feb. 14, 2025 ~ Feb. 17, 2025

3.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	20.7	39.3	99.9

3.2 Test conditions and methods

3.2.1 Test standard: IEC 60529:1989+A1:1999+A2:2013

3.2.2 Arrangement of the IP code

	IP	5	2
Code letters (International protection)	←		
First characteristic numeral (numerals 0 to 6, for letter X)	←	←	
Second characteristic numeral (numerals 0 to 8, for letter X)	←		←

3.2.2.1 Degree of protection against access to hazardous parts indicated by the first characteristic numeral

First characteristic numeral	Degree of protection	Application
5	Protected against access to hazardous parts with a wire. The access probe of 1.0 mmØ, shall not penetrate. Test force: 1 N ± 10 %	☒

NOTE In the case of the first characteristic numerals 3, 4, 5 and 6, protection against access to hazardous parts is satisfied if adequate clearance is kept. The adequate clearance should be specified by the relevant product committee in accordance with 12.3.

Due to the simultaneous requirement specified in table 2, the definition “shall not penetrate” is given in table 1.



CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (9) / (15) pages

3.2.2.2 Degree of protection against solid foreign objects indicated by the first characteristic numeral

First characteristic numeral	Degree of protection	Application
5	Dust Testing Equipment Whether reductions in pressure below the atmospheric pressure are present or not, ingress of dust is not totally preventive, but dust shall not penetrate in a quantity to interfere with satisfactory operation of the apparatus or to impair safety. (The talcum powder must pass through a calibrated sieve with a 50 µm wire mesh, spaced at 75 µm intervals in a square pattern. Additionally, the bulk density of the talcum powder should be 2 kg/m³)	—
	Category 1: Enclosures where the normal working cycle of the equipment causes reductions in air pressure within the enclosure below that of the surrounding air, for example, due to thermal cycling effects. Products in volume: cm³ → L Target intake volume (Products in volume 80) : L Suction volume (Max product in volume 60) ...: LPH → LPM Actual Suction volume: L Suction pressure (Up to 2 kPa): kPa Test time (Up to 8 time): hr	☐
	Category 2: Enclosures where no pressure difference relative to the surrounding air is present.	☒
¹⁾ The full diameter of the object probe shall not pass through an opening of the enclosure. Due to the simultaneous requirement specified in table 2, the definition “shall not penetrate” is given in table 1.		

**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (10) / (15) pages

3.2.2.3 Degree of protection against water indicated by the second characteristic numeral

Second characteristic numeral	Degrees of protection	Application
2	When outskirts of the product have been tilted by 15° Water that drops verticality has to be harmless. Drip box Fig.3, Enclosure in 4 fixed positions of 15° tilt Water flow rate: 3 mm/min Duration of test: 2.5 min for each position of tilt	☒



CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (11) / (15) pages

3.3 Testing images

3.3.1 Evidence of test setting (1)



Probe test



Probe test



Probe test



Probe test



Probe test



Probe test

3.3.2 Evidence of test setting (2)



Dust test



Dust test



Dust test Monitor



Water test

**CTK Co., Ltd.**

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (13) / (15) pages

3.4 Test result

3.4.1 Test result table

IP code	Evaluation Criteria	Test Results	Remark
IP 5X	No ingress of Probe	Normal	-
	No ingress of dust	Normal	
IP X2	No ingress of water	Normal	

※ Refer to the product photos after the completion of testing in section 3.5.



CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (14) / (15) pages

3.5 Post-test product images

3.5.1 Product internal images after test [The first characteristic numeral test]





CTK Co., Ltd.

5 Dongbu-ro, 221beon-gil, Cheoin-gu, Yongin-si
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02272
Page (15) / (15) pages

3.5.2 Product internal images after test [The second characteristic numeral test]



- End -