

TEST REPORT

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (1) / (12) pages

1. Applicant

- Name : Hanwha Vision Co., Ltd
- Address : 6 Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si,
Gyeonggi-do, 13488 Republic of Korea
- Date of Receipt : Sep. 02, 2025

2. Manufacturer

- Name : Hanwha Vision Co., Ltd

3. Use of Report :

For submission to customer

4. Test sample / Model :

NETWORK CAMERA / XND-A9085RV

5. Date(s) of test :

Oct 02, 2025

6. Test Standard (Method) used :

IEC 62262:2002+AMD1:2021

7. Testing Environment :

Temperature: (25 ±10) °C, Humidity: (50 ±25) % R.H.

Pressure: (96 ±10) kPa

8. Test Results :

Refer to the test results

9. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing
(5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea)

The results shown in this test report refer only to the sample(s) tested unless otherwise stated. This report cannot be reproduced or copied without the written consent of CTK.

Approval	Tested by	Technical Manager
	Name: HyungUk Jeon (Signature)	Name: HoHyun Lee (Signature)

Remark. This report is not related to KOLAS accreditation and relevant regulation.

Oct. 17, 2025

CTK Co., Ltd.



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (2) / (12) pages

Table of Contents

1. Testing laboratory	3
1.1 Testing laboratory information	3
1.2 Testing laboratory accreditation status	3
2. Product description and equipment information	4
2.1 Product description	4
2.2 Model description	4
2.3 Equipment information	4
2.4 Pre-test product images	5
2.5 Testing equipment images	6
3. Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts (IK code)	7
3.1 Test date and environmental conditions	7
3.2 Test condition	7
3.3 Testing images	8
3.4 Test result	9
3.5 Post-test product images and hit area images	10
3.6 Enclosure Dimensions or Impact point	12

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (3) / (12) pages

1. Testing laboratory

1.1 Testing laboratory information

Lab. Name	CTK Co., Ltd.
Representative	Young Joseph Seungwon
Address	5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea
Tel.	+82-31-339-9970
Fax.	+82-31-624-9501
E-Mail	all.youngin@element.com
Website	www.elementkorea.kr

1.2 Testing laboratory accreditation status

Country	Classification	Accreditation Number	Logo
International	KOLAS	TESTING NO. KT119	

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (4) / (12) pages

2. Product description and equipment information

2.1 Product description

Product Name	Model Name	Quantity	Comment
NETWORK CAMERA	XND-A9085RV	1 EA	-

2.2 Model description

Basic Model	XND-A9085RV
Series model	XND-A8085RV
Model differences	Use of the same external shape and materials (case, finishing material, PCB, cable, etc.), differences in SW.

2.3 Equipment information

Testing equipment	Model Name	Manufacturer	Manufacturing Number	Next Cal. Date
Vertical Hammer Tester	Vertical Hammer	Kingpo	0190605A01002	-
Vertical Hammer	10000g	Kingpo	TX-029-50J	2026-07-08
Steel measuring meter	5.5 m	KOMELON	225851	2026-01-16

2.4 Pre-test product images

2.4.1 Test sample #1



Top



Bottom



Front



Rear



Left side




Right side

2.5 Testing equipment images

2.5.1 Test equipment (1)



Vertical Hammer

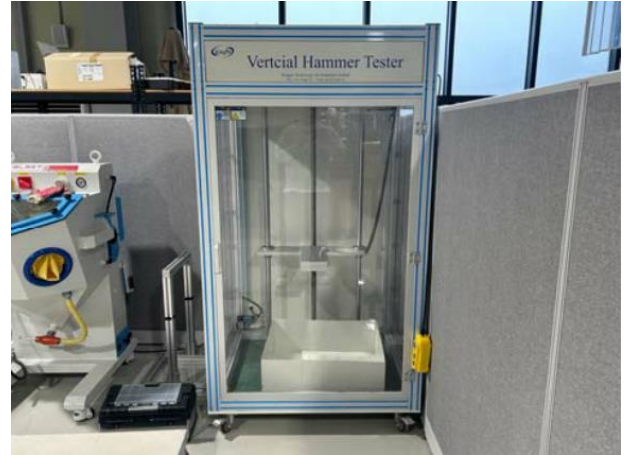

Vertical Hammer Tester



Steel measuring meter

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (7) / (12) pages

3. Degrees of protection provided by enclosures for electrical equipment against external mechanical impacts (IK code)

3.1 Test date and environmental conditions

3.1.1 Test date: Oct 02, 2025

3.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	25.2	56.7	101.5

3.2 Test condition

3.2.1 Test standard: IEC 62262:2002+AMD1:2021

3.2.2 Sample status: Non-operation

IK code	Impact Energy (J)	Equivalent mass (kg)	Drop height (mm ± 1%)	Application
00	Non-protected	-	-	☐
01	0.14	0.25	56	☐
02	0.20	0.25	80	☐
03	0.35	0.25	140	☐
04	0.50	0.25	200	☐
05	0.70	0.25	280	☐
06	1.00	0.25	400	☐
07	2.00	0.50	400	☐
08	5.00	1.70	300	☐
09	10.00	5.00	200	☐
10	20.00	5.00	400	☒
11	50.00	10.00	500	☐
Impact times: five times for each of the exposed surface. (Do not impact more than 3 times in the same spot)				




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (8) / (12) pages

3.3 Testing images

3.3.1 Evidence of test setting (1)

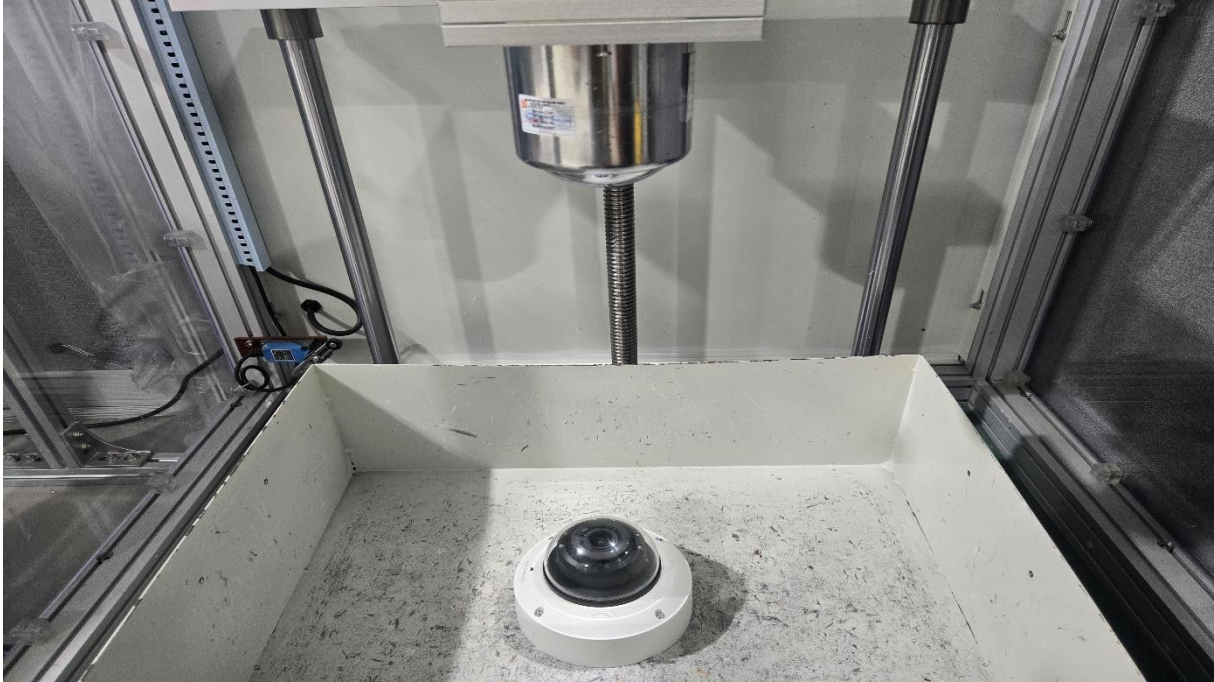

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02845
Page (9) / (12) pages


3.4 Test result**3.4.1 Test result table**

Evaluation Criteria	Test Results	Remark
Visual Inspection	Some scratches were generated on the outside of the product.	-

※ Refer to the product photos after the completion of testing in section 3.5.2

3.5 Post-test product images and hit area images


3.5.1 Check the hit area during the test

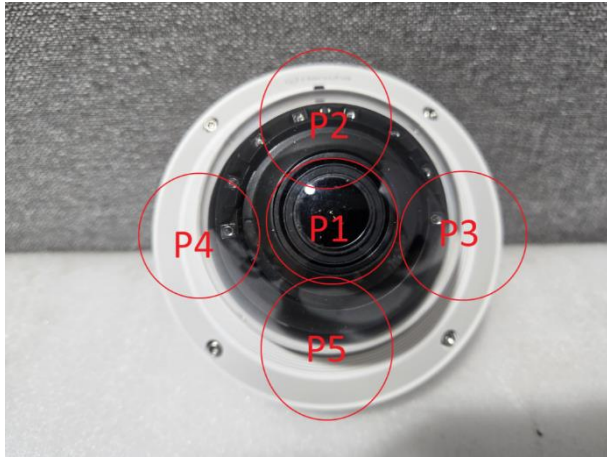

Check the hit area the test_1



Check the hit area the test_2

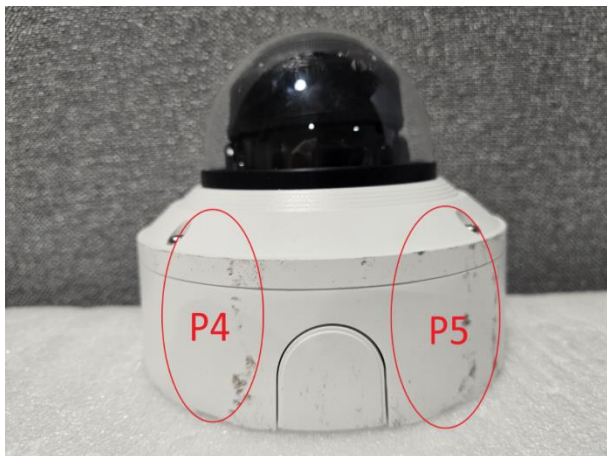

Check the hit area the test_3

3.5.2 Post-test product images



Top



Bottom



Front



Back




Left side



Right side

3.6 Enclosure Dimensions or Impact point

3.6.1 Enclosure Dimensions (Unit: mm)

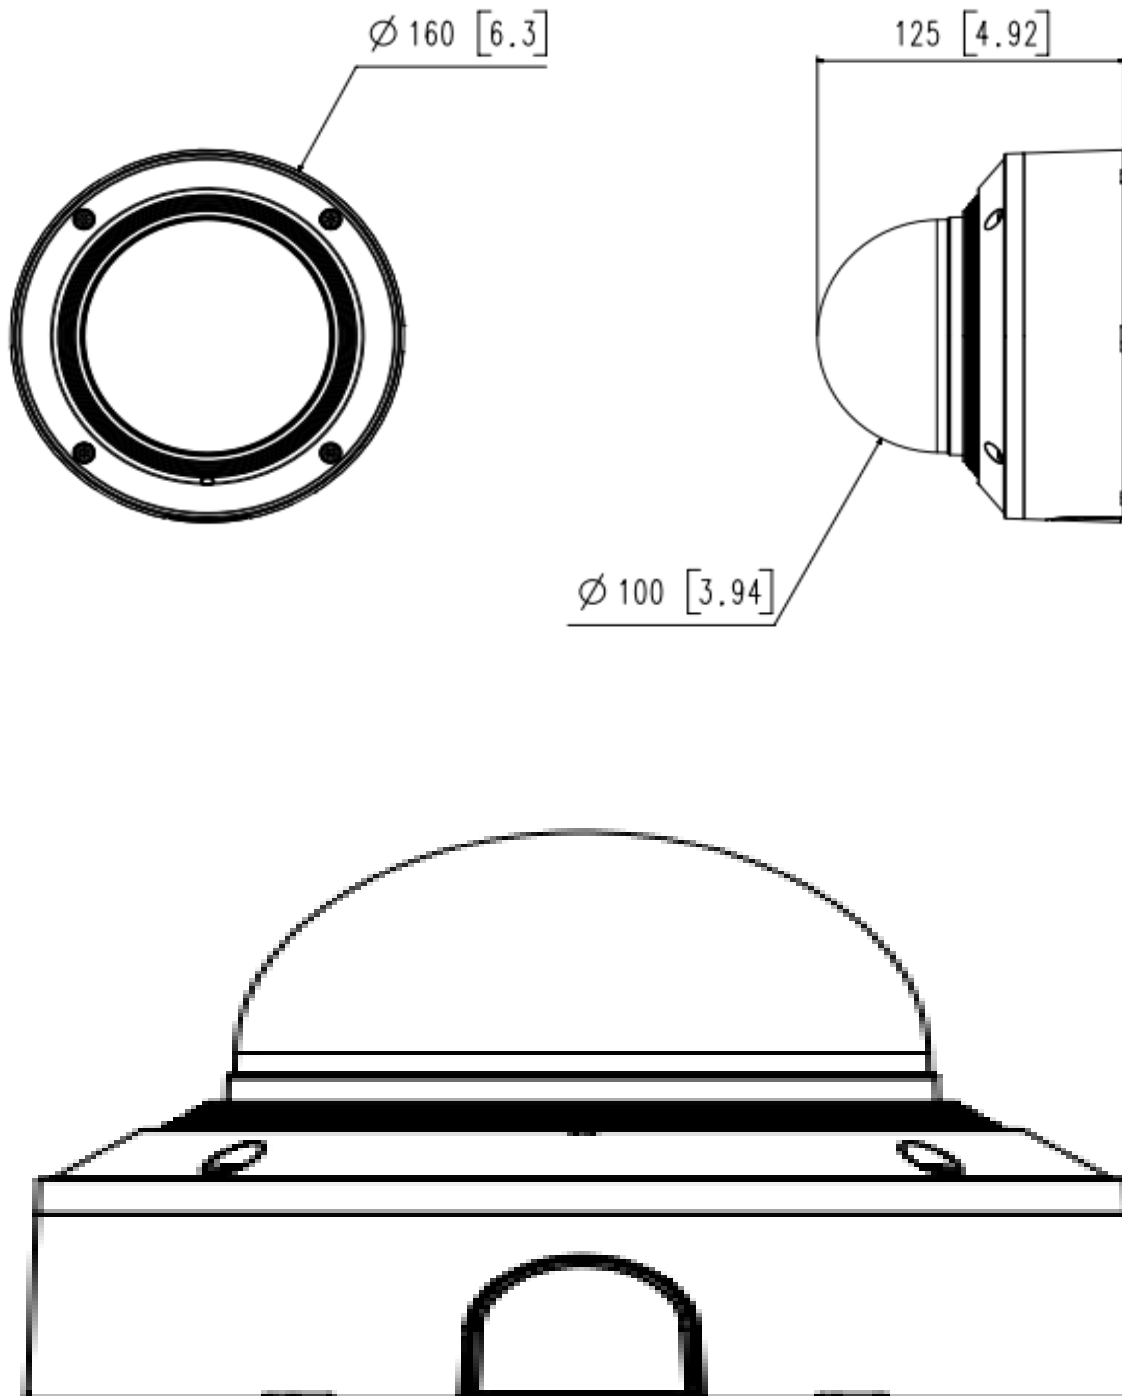

- End -