

TEST REPORT

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (1) / (26) pages

1. Applicant

- Name : Hanwha Vision Co., Ltd
- Address : 6 Pangyo-ro 319Beon-gil, Bundang-gu, Seongnam-si,
Gyeonggi-do, 13488 KOREA
- Date of Receipt : Aug. 24, 2025

2. Manufacturer

- Name : Hanwha Vision Co., Ltd

3. Use of Report :

For submission to customer

4. Test sample / Model :

NETWORK CAMERA / XNV-A6084R

5. Date(s) of test :

Aug. 27, 2025 ~ Sep. 16, 2025

6. Test Standard (Method) used :

NEMA TS 2-2013 2.2.7.3 Test C ~ 2.2.7.8 Test H,
NEMA TS 2.2.8, NEMA TS 2.2.9

7. Testing Environment :

Temperature: (25 ±10) °C, Humidity: (50 ±25) % R.H.
Pressure: (96 ±10) kPa

8. Test Results :

Refer to the test results

9. Location of Test :

☒ Permanent Testing Lab ☐ On Site Testing
(5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea)

The results shown in this test report refer only to the sample(s) tested unless otherwise stated. This report cannot be reproduced or copied without the written consent of CTK.

Approval	Tested by	Technical Manager
	Name: HyungUk Jeon (Signature)	Name: HoHyun Lee (Signature)

Remark. This report is not related to KOLAS accreditation and relevant regulation.

Sep. 22, 2025

CTK Co., Ltd.



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (2) / (26) pages

Table of Contents

1. Testing laboratory	4
1.1 Testing laboratory information	4
1.2 Testing laboratory accreditation status	4
2. Product description and equipment information	5
2.1 Product description	5
2.2 Equipment information	5
2.3 Pre-test product images	6
2.4 Testing equipment images	7
3. NEMA TS 2-2013 2.2.7.3 Test C ~ 2.2.7.8 H	8
3.1 Test date and environmental conditions	8
3.2 Test conditions and methods	8
3.3 Testing images	9
3.4 Test Result	10
3.5 Test Data	11
3.6 Test sample operation images	12
4. Resonant search, Endurance Test [NEMA TS 2-2013 2.2.8]	13
4.1 Test date and environmental conditions	13
4.2 Test conditions and methods	13
4.3 Testing images	15
4.4 Test Result	16
4.5 Test Data	17
5. Shock(impact) Test [NEMA TS 2-2013 2.2.9]	20
5.1 Test date and environmental conditions	20
5.2 Test conditions and methods	20
5.3 Testing images	21

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (3) / (26) pages

5.4 Test Result	22
5.5 Test Data	23
5.6 Post-test product images	26

 CTK Co., Ltd. 5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea Tel: +82-31-339-9970 Fax: +82-31-624-9501	REPORT No.: CTK-2025-02259 Page (4) / (26) pages	
--	---	--

1. Testing laboratory

1.1 Testing laboratory information

Lab. Name	CTK Co., Ltd.
Representative	Young Joseph Seungwon
Address	5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si, Gyeonggi-do, Republic of Korea
Tel.	+82-31-339-9970
Fax.	+82-31-624-9501
E-Mail	all.youngin@element.com
Website	www.elementkorea.kr

1.2 Testing laboratory accreditation status

Country	Classification	Accreditation Number	Logo
International	KOLAS	TESTING NO. KT119	

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (5) / (26) pages

2. Product description and equipment information

2.1 Product description

Product Name	Model Name	Quantity	Comment
NETWORK CAMERA	XNV-A6084R	1 EA	–

2.2 Equipment information

Testing equipment	Model Name	Manufacturer	Manufacturing Number	Calibration Date
Temperature & Humidity Chamber	ARS-1100-AE	ESPEC	1110024015	Oct 07, 2025
VIBRATION TESTING SYSTEM	LT1010	FAMTECH	D2012335	N/A
Acceleration sensor	8703A250M5	KISTLER	5830236	Jan. 16, 2026
Acceleration sensor	8703A250M5	KISTLER	5722241	Jan. 16, 2026



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (6) / (26) pages

2.3 Pre-test product images

2.3.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (7) / (26) pages

2.4 Testing equipment images

2.4.1 Test equipment



Temperature & Humidity Chamber



VIBRATION TESTING SYSTEM



8703A250M5



8703A250M5



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (8) / (26) pages

3. NEMA TS 2-2013 2.2.7.3 Test C ~ 2.2.7.8 H

3.1 Test date and environmental conditions

3.1.1 Test date: Aug. 27, 2025 ~ Aug. 29, 2025

3.1.2 Measured Environmental Conditions


Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	25.1	60.5	101.1

3.2 Test conditions and methods

- 3.2.1 2.2.7.3 Test C: - 34 °C, 89 Vac, 10 h (Check interim operation after 5 h and operation check after 10h)
- 3.2.2 2.2.7.4 Test D: - 34 °C, 135 Vac, 1 h (Operating state)
- 3.2.3 2.2.7.5 Test E: 74 °C, 18 %, 135 Vac, 15 h (Operating state)
- 3.2.4 2.2.7.6 Test F: 74 °C, 18 %, 89 Vac (Operation check after 2.2.7.5 Test E)
- 3.2.5 2.2.7.7 Test G: (21 ±6) °C, 120 Vac (Operating state)
- 3.2.6 2.2.7.8 Test H: Check for mechanical damage

3.2.7 Test Methods

- Evaluations Criteria :
 - Check for mechanical damage before and after testing
- Test methods

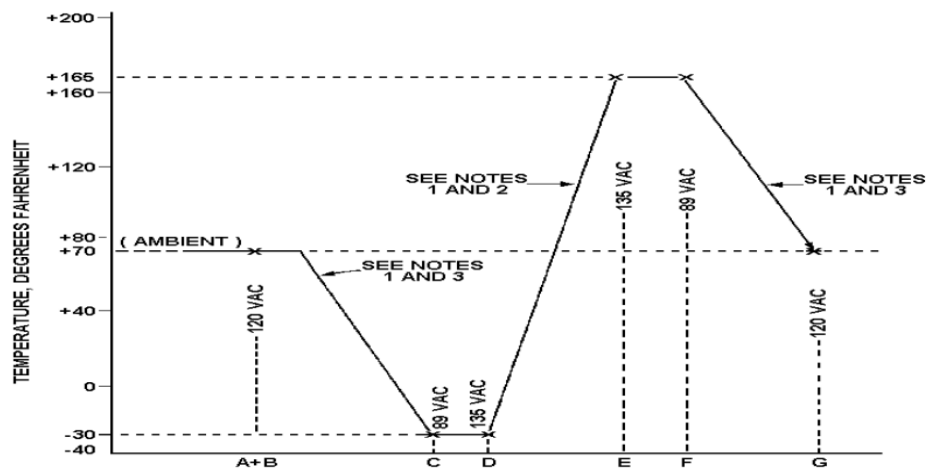



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (9) / (26) pages

3.3 Testing images

3.3.1 Evidence of test setting



**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (10) / (26) pages

3.4 Test Result

3.4.1 Test result table

Evaluation Criteria		Test Results	Comment
2.2.7.3 Test C ~ 2.2.7.8 Test H	Before	Normal	
	After	Normal	




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (11) / (26) pages

3.5 Test Data

3.5.1 Test data and graph

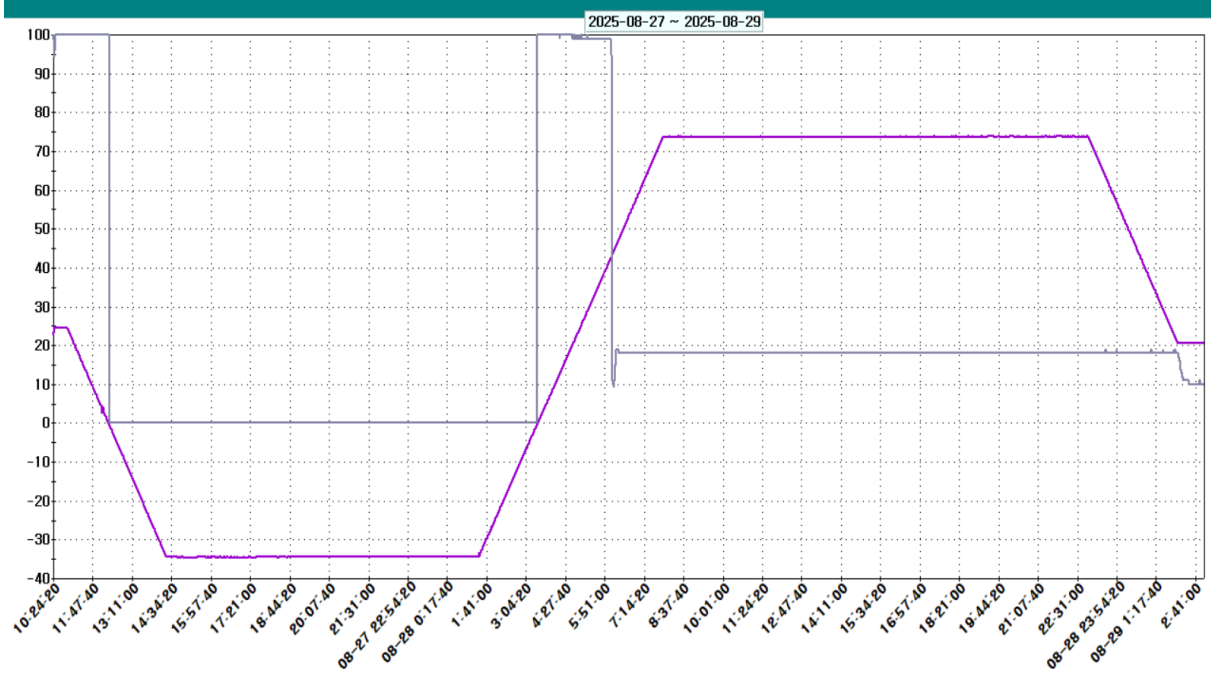

Temperature Data




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02259
Page (12) / (26) pages

3.6 Test sample operation images


3.6.1 Test sample operation and function

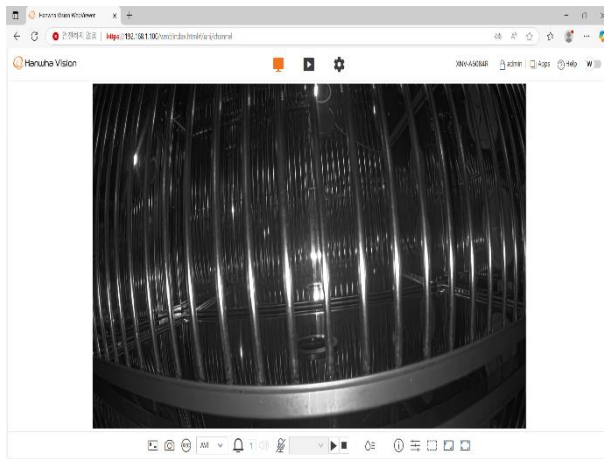


-34 °C 89 Vac

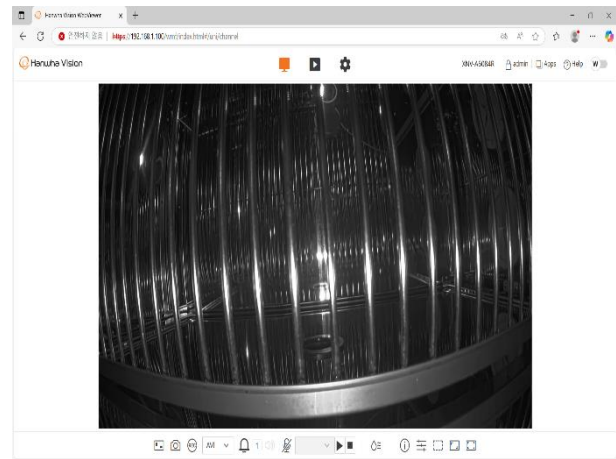


-34 °C 135 Vac

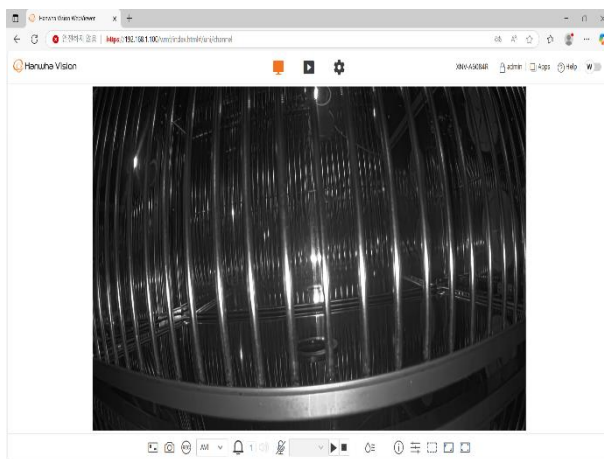

74 °C 135 Vac

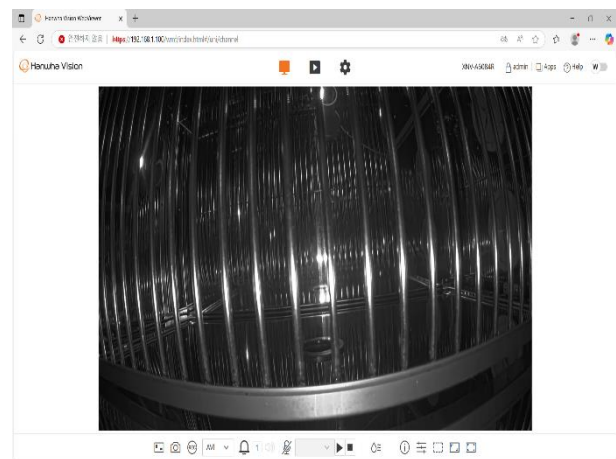

74 °C 89 Vac

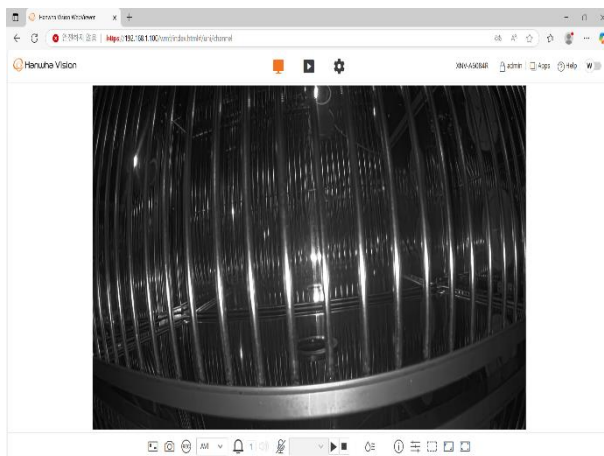

(21 ±6) °C 120 Vac

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (13) / (26) pages

4. Resonant search, Endurance Test [NEMA TS 2-2013 2.2.8]

4.1 Test date and environmental conditions

4.1.1 Test date: Sep. 15, 2025 ~ Sep. 16, 2025

4.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	25.4	55.1	101.1

4.2 Test conditions and methods

4.2.1 Resonant search [NEMA TS 2-2013 2.2.8.3]

- Sample status : unpackaged / not in operation
- Applied waveform : Sine
- Frequency(Hz) : 5 ~ 30
- Double amplitude displacement (inch) : 0.015
- Sweep rate(Sweep/min) : 12.5
- Applicable axis : X, Y, Z
- Test time(h) : 12.5
- Evaluation items
 - Check for mechanical damage before and after testing
- Test methods
 - With the test unit securely fastened to the test table, set the test table for a double amplitude displacement of 0.015 inch.
 - Cycle the test table over a search range from 5 to 30 Hz and back within a period of 12.5 minutes.
 - Conduct the resonant frequency search in each of the three mutually perpendicular planes.
 - Note and record the resonant frequency determined from each plane.
 - ◆ In the event of more than one resonant frequency in a given plane, record the most severe a. resonance.
 - ◆ b. If resonant frequencies appear equally severe, record each resonant frequency.
 - ◆ c. If no resonant frequency occurs for a given plane within the prescribed range, 30 Hz shall be recorded.

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (14) / (26) pages

4.2.2 Endurance Test[NEMA TS 2-2013 2.2.8.4]

- Sample status : unpackaged / not in operation
- Applied waveform : Sine
- Frequency(Hz) : 30 or 3.2.2 Test results
- Acceleration(G) : 0.5
- Applicable axis : X, Y, Z
- Test time(h) : All 3(Each axis 1)
- Evaluation items
 - Check for mechanical damage before and after testing
- Test methods
 - Vibrate the test unit in each plane at its resonant frequency for a period of 1 hour at an amplitude resulting in 0.5 g acceleration. (test profile)
 - When more than one resonant frequency has been recorded in accordance with Section 1.2 Item 4, the test period of 1 hour shall be divided equally between the resonant frequencies.
 - The total time of the endurance test shall be limited to 3 hours, 1 hour in each of three mutually perpendicular planes.



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02259
Page (15) / (26) pages

4.3 Testing images


4.3.1 Evidence of test setting (NEMA TS 2-2013 2.2.8)



X axis

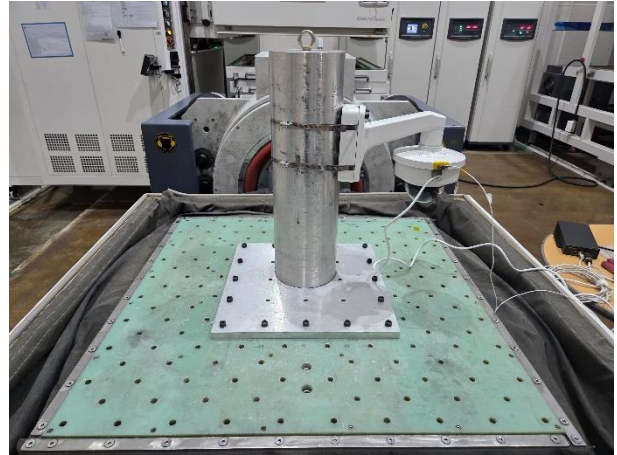

Y axis

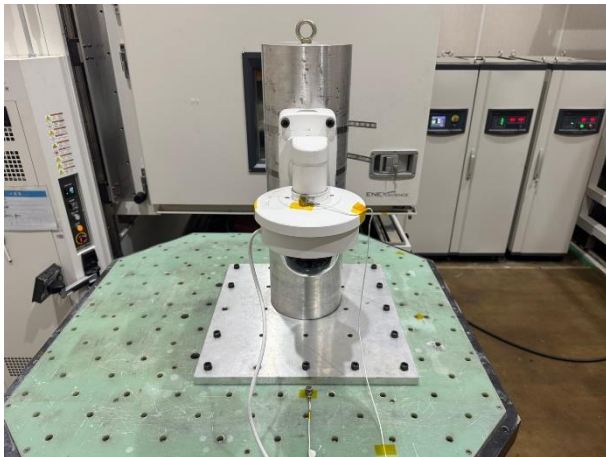

Z axis

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (16) / (26) pages

4.4 Test Result

4.4.1 Test result table

Evaluation Criteria		Test Results	Comment
Resonant search Test	Before	Normal	
	After	Normal	
Endurance Test	Before	Normal	
	After	Normal	




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (17) / (26) pages


4.5 Test Data

4.5.1 Test Data X Axis

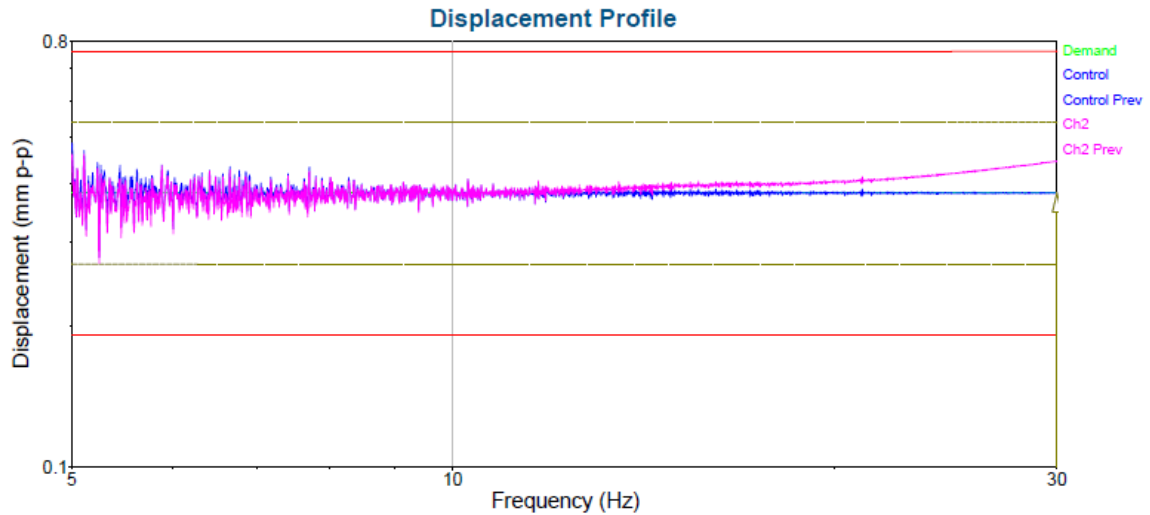

9 15, 2025 14:23:05	Level 1) 100 %	Output: 0.0479 Volts peak	NEMA TS-2 2.2.8
Demand: 0.381 mm	Level Time: 0:12:30	Frequency: 30 Hz	
Control: 0.3812 mm	Total Time: 0:12:36	End of Sweep Test	

Resonant search Test

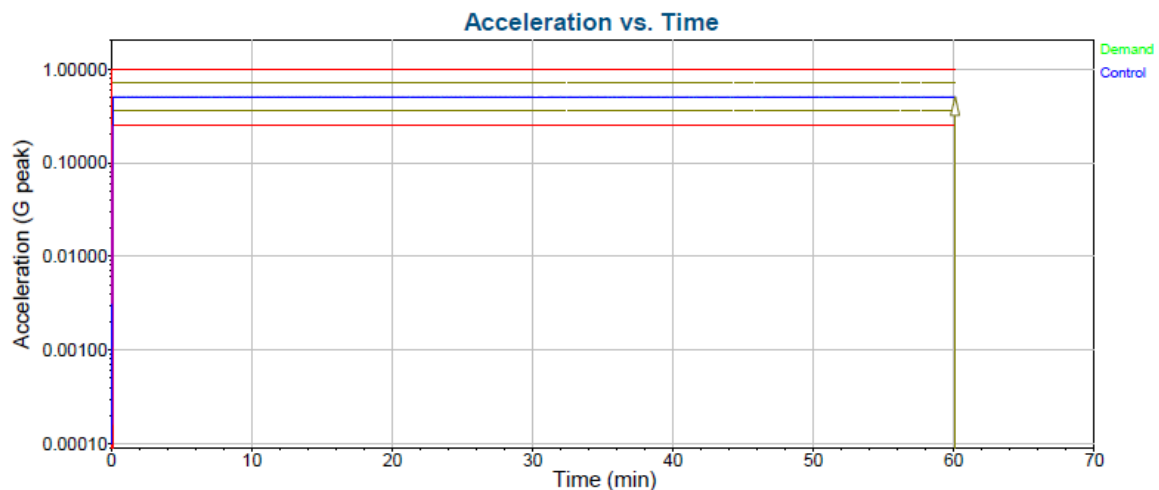

9 15, 2025 15:26:36	Level 1) 100 %	Output: 0.03526 Volts peak	NEMA TS-2 2.2.8 내구
Demand: 0.5 G	Level Time: 1:00:00	Frequency: 30 Hz	
Control: 0.5006 G	Total Time: 1:00:07	End of Timed Test	

Endurance Test




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02259
Page (18) / (26) pages

4.5.1 Test Data Y Axis

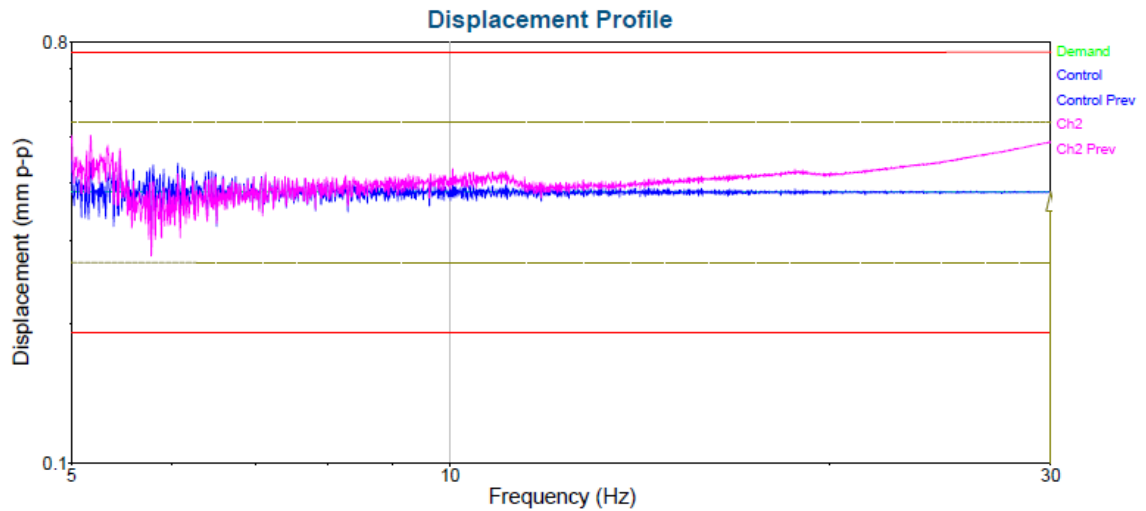

9 15, 2025 16:02:19	Level 1) 100 %	Output: 0.04802 Volts peak	NEMA TS-2 2.2.8
Demand: 0.381 mm	Level Time: 0:12:30	Frequency: 30 Hz	
Control: 0.3808 mm	Total Time: 0:12:36	End of Sweep Test	

Resonant search Test

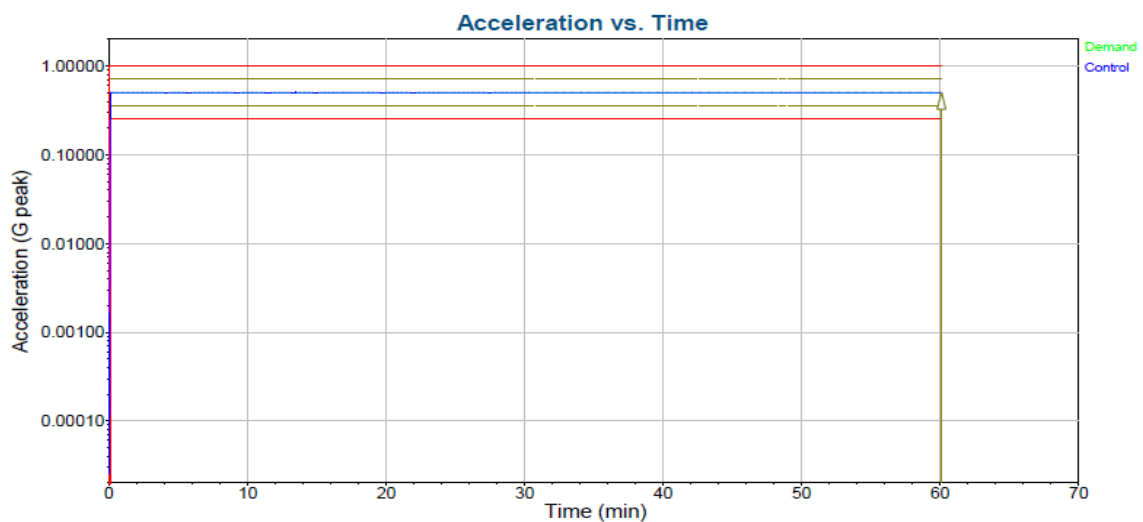

9 15, 2025 17:04:15	Level 1) 100 %	Output: 0.03531 Volts peak	NEMA TS-2 2.2.8 내구
Demand: 0.5 G	Level Time: 1:00:00	Frequency: 30 Hz	
Control: 0.4991 G	Total Time: 1:00:07	End of Timed Test	

Endurance Test




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02259
Page (19) / (26) pages

4.5.2 Test Data Z Axis

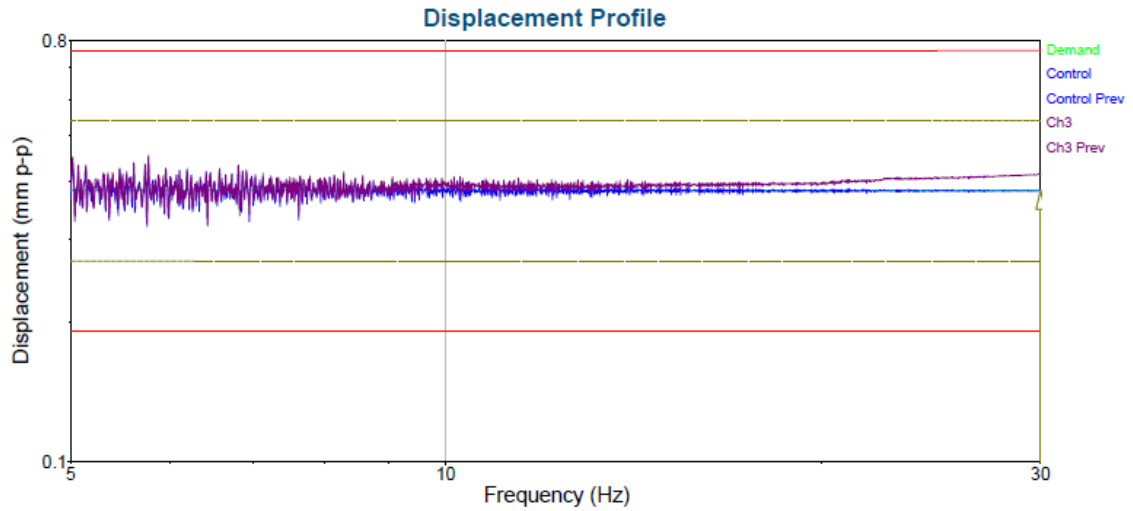

9 16, 2025 17:33:39	Level 1) 100 %	Output: 0.04827 Volts peak	NEMA TS-2 2.2.8
Demand: 0.381 mm	Level Time: 0:12:30	Frequency: 30 Hz	
Control: 0.3816 mm	Total Time: 0:12:36	End of Sweep Test	

Resonant search Test

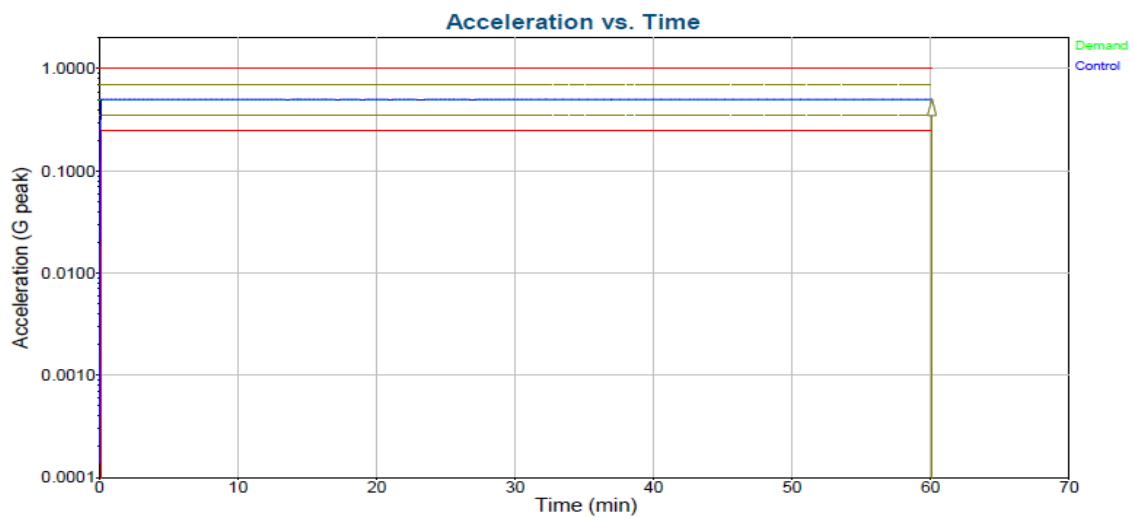

9 16, 2025 18:36:57	Level 1) 100 %	Output: 0.03508 Volts peak	NEMA TS-2 2.2.8 내구
Demand: 0.5 G	Level Time: 1:00:00	Frequency: 30 Hz	
Control: 0.5001 G	Total Time: 1:00:06	End of Timed Test	

Endurance Test

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (20) / (26) pages

5. Shock(impact) Test [NEMA TS 2-2013 2.2.9]

5.1 Test date and environmental conditions

5.1.1 Test date: Sep. 16, 2025 ~ Sep. 17, 2025

5.1.2 Measured Environmental Conditions

Item	Temperature (°C)	Humidity (% R.H.)	Pressure (kPa)
Measurement	25.4	55.1	101.1

5.2 Test conditions and methods

5.2.1 Sample status: unpackaged / not in operation

5.2.2 Applied waveform: Half sine

5.2.3 Acceleration(G): 10 G

5.2.4 Nominal duration (ms): 11

5.2.5 Applicable axis : X, Y, Z

5.2.6 Number of impacts: 1 per direction (total 6)

5.2.7 Evaluation items: Check for mechanical damage before and after testing



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501


REPORT No.:
CTK-2025-02259
Page (21) / (26) pages

5.3 Testing images


5.3.1 Evidence of test setting (NEMA TS 2-2013 2.2.9)



X axis

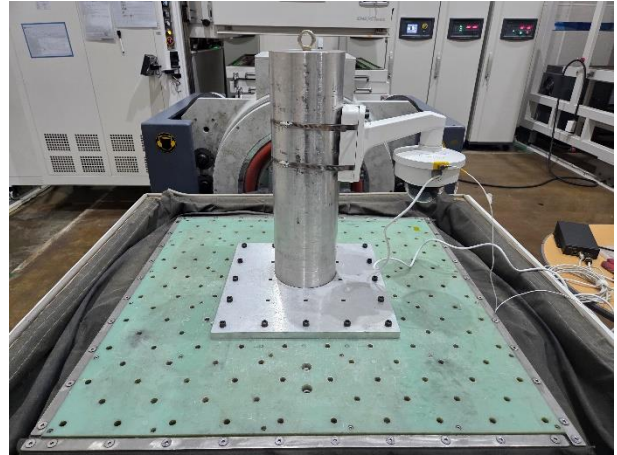

Y axis

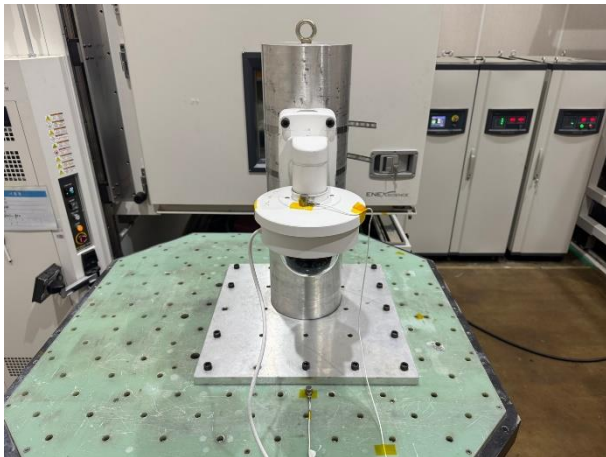

Z axis

**CTK Co., Ltd.**

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (22) / (26) pages

5.4 Test Result

5.4.1 Test result table

Evaluation Criteria		Test Results	Comment
Shock(impact) Test	Before	Normal	
	After	Normal	




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (23) / (26) pages

5.5 Test Data

5.5.1 Test Data X Axis

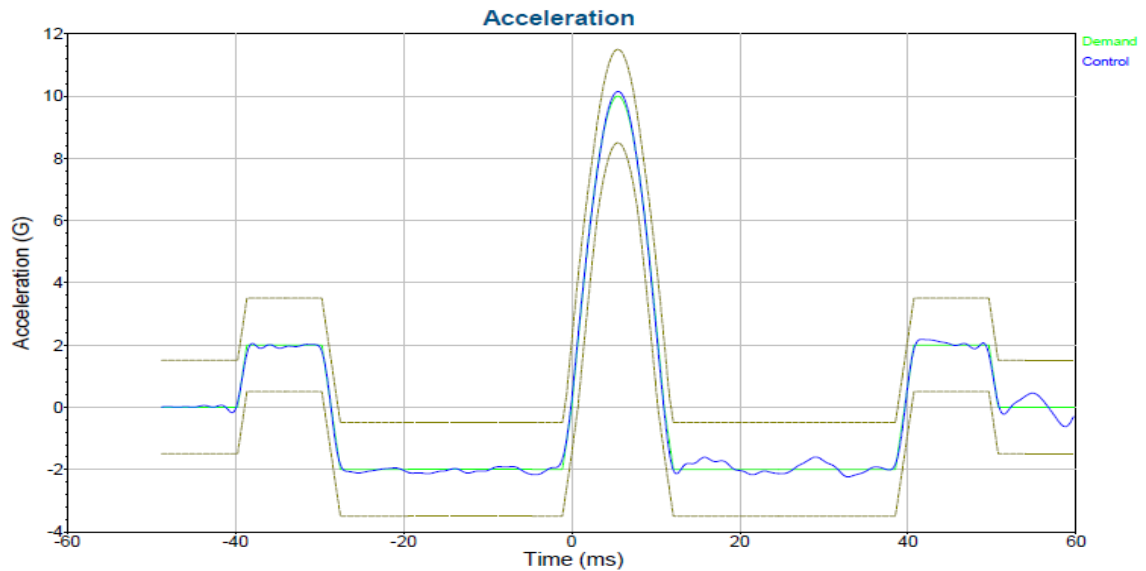

9 16, 2025 15:11:01

Level 1) 100 %

Output: 0.509 Volts peak

NEMA TS-2 2.2.9


Demand: 10 G

Control: 10.14 G

Pulse: 1 of 1

Running

+

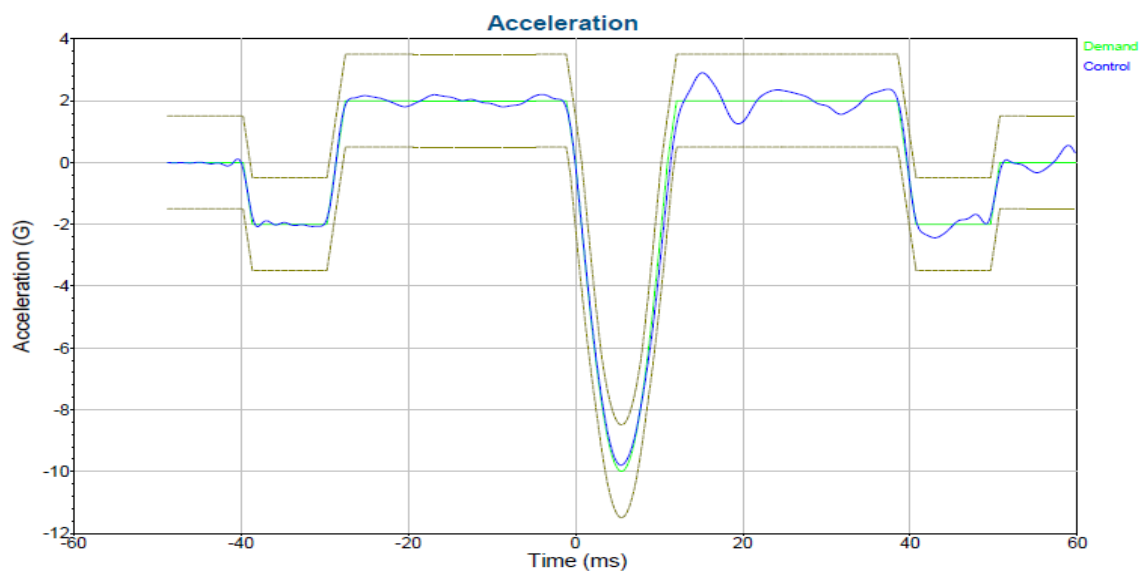

9 16, 2025 15:11:04

Level 2) 100 %

Output: 0.5226 Volts peak

NEMA TS-2 2.2.9

Demand: 10 G

Control: 9.803 G

Pulse: 1 of 1

End of Test

-




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (24) / (26) pages

5.5.1 Test Data Y Axis

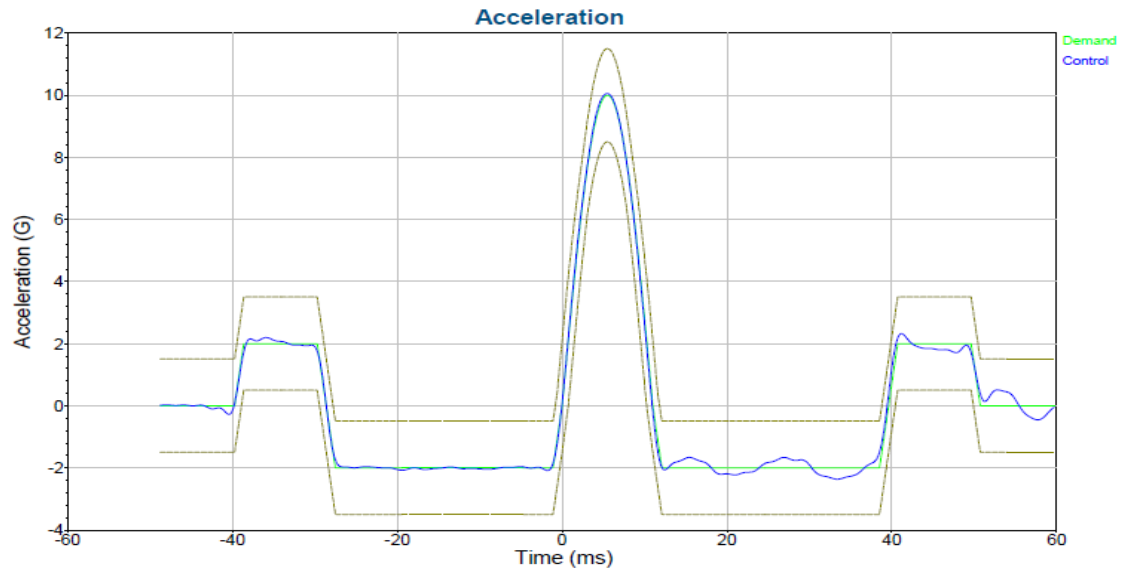

9 16, 2025 15:06:05

Level 1) 100 %

Output: 0.5122 Volts peak

NEMA TS-2 2.2.9


Demand: 10 G

Control: 10.05 G

Pulse: 1 of 1

Running

+

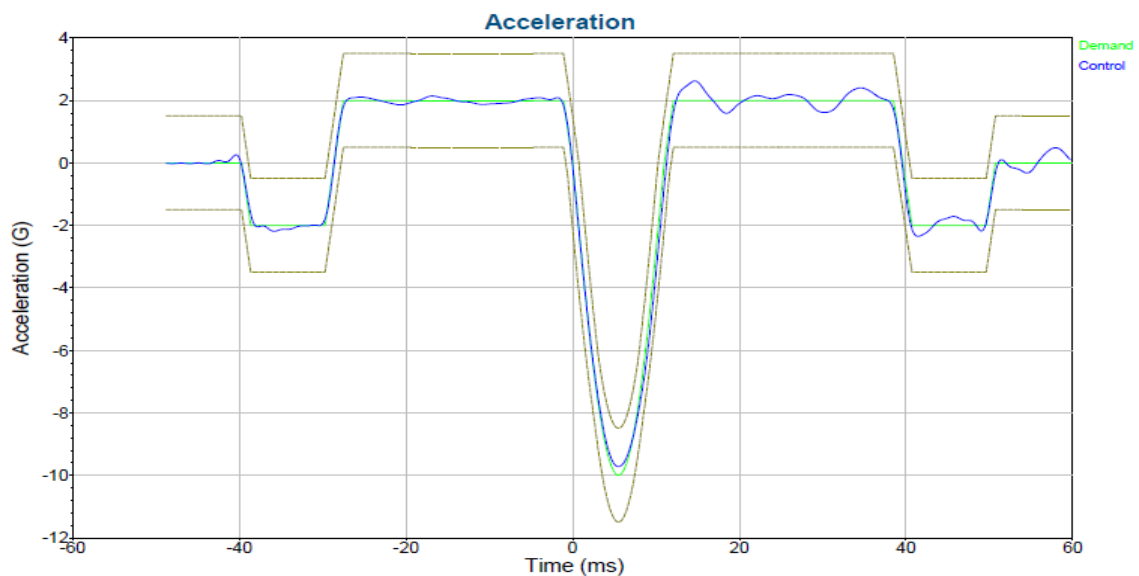

9 16, 2025 15:06:08

Level 2) 100 %

Output: 0.5156 Volts peak

NEMA TS-2 2.2.9

Demand: 10 G

Control: 9.727 G

Pulse: 1 of 1

End of Test

-




CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (25) / (26) pages


5.5.2 Test Data Z Axis

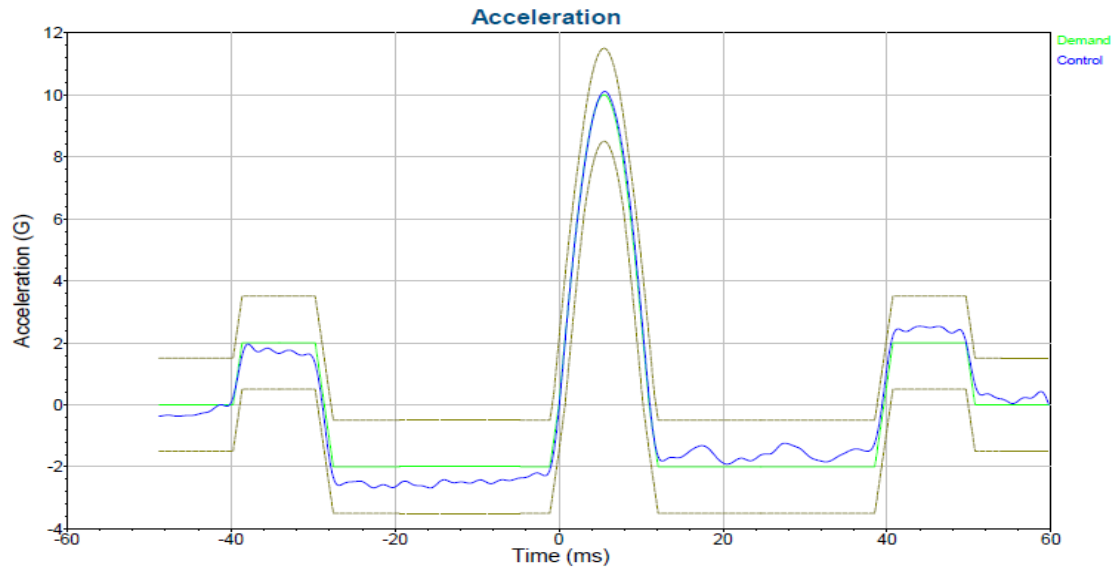

9 17, 2025 09:12:31 Level 1) 100 %
Demand: 10 G
Control: 10.11 G Pulse: 1 of 1

Output: 0.5309 Volts peak NEMA TS-2 2.2.9
Running

+

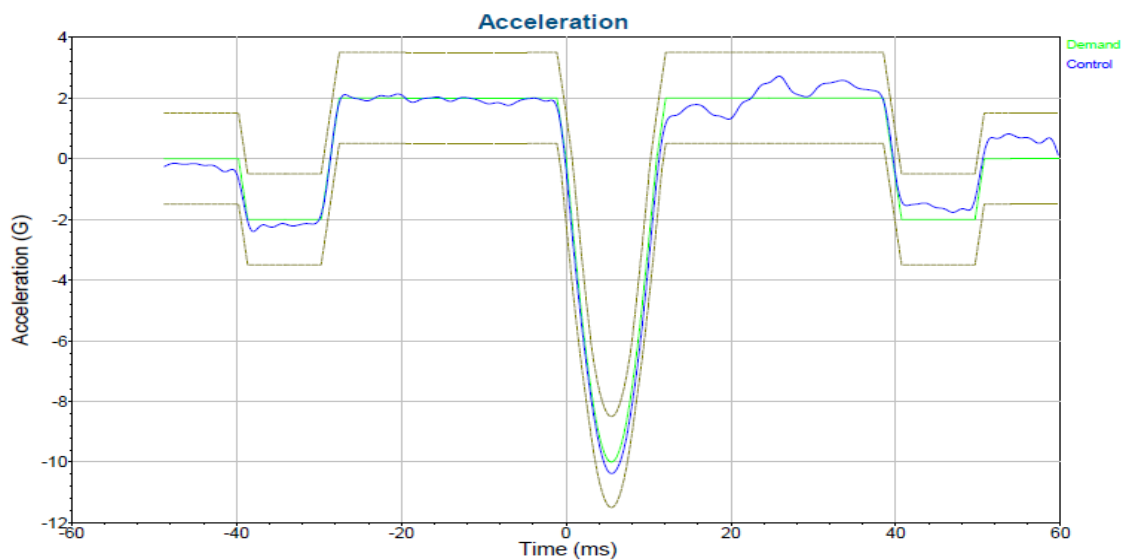

9 17, 2025 09:12:34 Level 2) 100 %
Demand: 10 G
Control: 10.38 G Pulse: 1 of 1

Output: 0.5257 Volts peak NEMA TS-2 2.2.9
End of Test

-



CTK Co., Ltd.

5 Dongbu-ro 221beon-gil, Cheoin-gu, Yongin-si,
Gyeonggi-do, Republic of Korea
Tel: +82-31-339-9970
Fax: +82-31-624-9501

REPORT No.:
CTK-2025-02259
Page (26) / (26) pages

5.6 Post-test product images

5.6.1 Test sample



Top



Bottom



Front



Rear



Left side



Right side

- End -